LE-1 36

T3N, R2E 6-2-99

M-2 EAST 1/4 COR SEC. 1

FOUND 1/2" BAR AS SET BY SURVEYOR P. BENTON L4, P. 387 UNDER 3/4" REBAR AT SURFACE OF GRAVEL RD CORNER IS 5± SOUTH of ℄ HUSCHKE & ON ℄ of WALLACE RD. TO SOUTH PREVIOUS TRAVERSE FOUND THE MARKER 22' MORE OR LESS EAST of A LINE BETWEEN M-3 & M-1 EXCAVETED 6'X8' HOLE ± 15' WEST of THE CORNER DOWN 2.5± TO EXISTING CLAY. AREA IN FILL AREA. DID NOT FIND ANY EVIDENCE OF A PREVIOUS CORNER. ACCEPTED THE POSITION of THE BAR AS FAITHFUL PERPETUATION of THE CORNER & SET PLASTIC CAP 6" BELOW GRADE

D. HUGHES

FD N&T #19834 W/SIDE 14" ASH Az 329° 24.14'
" " " N/SIDE POWER POLE Az. 92° 35.49'
" " N/SIDE 12" MAPLE Az 258° 58.59'
FD N&T " SW/SIDE 20" ASH Az 165° 84.48'
184° SOUTH, 66.02' to A-2 LIVINGTON Co. HANDY TWP
LEDY TRAV B&C Az 338° 8.07'

P.A 132 SURVEYS L4, P. 1269 R. LESTER

6-2-99 LE-1 36

L-2 LEROY TWP

CENTER of SECTION 1

(STEADMAN SET 3/4" PIPE) FD 1/2" REBAR OVER 3/4" PIPE IN MON. BOX 4.5± SOUTH of ℄ HUSCHKE ROAD ON LINE WITH FENCE to SOUTH FD B.T NE&SW WITH NO TAGS BT SE GONE. EXCAVATED DOWN & FD. 1/2" BAR OVER 3/4" PIPE. CORNER COMPUTED TO BE ON LINE BETWEEN NORTH & SOUTH 1/4 CORNERS & 3' SOUTH of A LINE BETWEEN THE EAST & WEST 1/4 CORNERS. ACCEPTED POSITION of 1/2" BAR & 3/4" PIPE AS FAITHFUL PERPETUATION of THE CORNER & SET STANDARD INGHAM CO. 2" DSK P.A 345, R.S. 18994.

HUGHES

FD N&T #18934 SW/S 10" ELM Az. 349° 32.32'
FD " #18934 NW/S 30" MAPLE Az 61° 33.92'
" " " W/S 18" MAPLE Az 160° 20.39'
" " " N/S 20" CHERRY Az 240° 24.52'
SET N&T 18994 E/S 20" CHERRY Az. 41° 33.70'
FD N&T 18998 S/S 28" OAK Az. 297° 88.86

INDEX

RH RON HEGSEL P.S.
SI SCOTT IDE
FS FRANK SICA

PG.	COR
30	M-3
31	M-2
32	K-3
33	TRAVERSE
34	K-1, K-2
35	L-3

LE-1 30

7-22-98 30
FS, SI LE-1
RH

M-3

SE COR SEC. 1, T3N, R2E

FOUND 4" CONC. MON. WITH 1/2" B&C
19998 (R. LESTER) 2' WEST ℄ WALLACE
RD. 10" BELOW GRAVEL SURFACE

1) FD. N&T # 19834 (D. HUGHES) NW/SIDE
30" MAPLE AZ 60°, 25.70'

2) FD N&T # 19834 S/SIDE 28" MAPLE
AZ. 120°, 22.19'

3) FD. N&T # 39100 (WIEGMAN) W/SIDE 36" MAPLE
AZ. 159°, ~~29.62'~~ 51.23'

4) FD N&T # 18998 N/SIDE 32" ~~TWIN ELM~~ BASSWOOD
AZ. 300°, 29.62' (REC. 29.57')

5) FD N&T # 18998, E/SIDE 34" OAK
AZ. 349°, 49.14

COR. REC. L. 4, P. 29 [illegible] 19826
" " L 5, P. 124 CETA PROC. R. LESTER

ACCEPTED EVIDENCE AS FOUND
BY CETA-LESTER SET ALUM DISK
OVER MON.

6) SOUTH, 65.94' ~~APPARENT PIPE~~ AT A3
HANDY TWP. LIVINGSTON CO.

FOUND WIEGMAN # 39100
1/2" BAR & CAP

LE

M-2

CG-1 31

FOUND 5/8" BAR DID NOT
LIKE THIS LOCATION

LE-1
32

K-3

COR. COMMON TO SEC.S 1, 2, 11 & 12

L.5. P.104 FOUND CONC. MON

& ½" REBAR WITH MANGLED CAP. INSIDE CONC. COLLAR 6" BELOW SURFACE OF PARDEE RD. ACCEPTED FROM PREVIOUS CETA REMON SEPT 14, 1978

SET STANDARD INGHAM CO. DISK STAMPED P.A. 345 P.S. No. 18994 OVER ½" REBAR SET 6" STEEL WATER VALVE BOX INSIDE 8" CONC. COLLAR AT ROAD SURFACE.

FD. BOSS #29238 W/S 12" TWIN W. CHERRY

AZ 30°, 30.63'

FD WHITE #12034 S/S 14" W. CHERRY AZ 69°, 48.13

FD RUSTED LESTER N & C (SET NEW NAIL & TAG # 18994 ON S/S 26" W. CHERRY AZ 296°, 70.75

SW COR FND of GAR HSE # 5020

AZ 161°, 109.92

4" STEEL GATE POST @ FACE & BASE

AZ 196°, 36.74'

9-21-98 LE-1
RH-FS

(32)

LE-1
34

K-2

1/4 COR COMMON TO SEC'S 1 & 2 LEROY
F.D. SPIKE ON TOP OF 18"
WOOD ANCHOR POST FENCE EAST & SOUTH
TREE LINE TO NORTH

		Az	
SET NET	W/SIDE 8" CHERRY	139°	33.15'
"	" E/SIDE 8 "	Az 198°	14.87'
"	" E/SIDE 16" OAK	A. 338°	7.54
"	" N/SIDE TWIN CHERRY 18" DIA	Az 81°	7.95
"	" E/SIDE 10" OAK	Az 177°	37.08

SET 3/4 PIN & CAP 2.0' EAST

DISTANCES TO REMON DISK

Az	± 139°	31.59'	NET W/S 8" CHRY
Az	± 198°	15.32'	NET E/S 8" CHERRY
Az	± 333°	8.94'	" E/S 16" OAK
Az	± 81°	6.12'	" N/S TWIN 18" W. CHERRY
Az	± 177°	37.08'	" E/S 10" OAK

RH-FS

LE-2
34

K-1

NW COR. SEC. 1, T3N, R2E
LZ P.47 O. BOSS SET PK NAIL
NO DESCRIPTION OF METHOD
EXCAVATED @ 32 LINKS DOWN TO CLAY F.D. NOTHING
SET 3/4" x 24 FORM PIN & ING. CO.
CAP AT G.L.O FALLING OF 32 LINK
OR 21.12' ON LINE BETWEEN
STANDARD CORNERS T3N 2E WEST
& SEC COR 36 (M-13 LOCKE & M-1 LEROY EAST)
COR 3.7± WEST OF FENCE LINE TO
SOUTH. 2' SOUTH & ALIGNED

WEST 21.12' M-13 LOCK
1/2" BAR & CAP 6" BEHIND & IN CENTER OF CURB
Az 13° 31.62'
SET NET W/SIDE 40" OAK
Az 04° 93.54'
1/2" BAR & CAP 6' BEHIND & IN CENTER OF CURB
Az 310° 53.51'
SET NET N/SIDE 42" OAK Az 111° 75.22

LE-1
33

T LO-2-31-17
BS LO-2-31-18
FS LE-1-33-40

BSD 05-39-10
FS 162-49-40
BSR 170-49-00
FS 327-59-85
BSD 358-11-55
FS 155-22-25
BSR 173-59-55
FS 331-08-20
MA 157°10'27"

17 → 40
11 58.585
11 58.585
11 58.580
11 58.585
M 11 58.585

T LE-1-33-40
BS LO-2-31-17
F/S LE-1-33-41 (K-2)

BSD 92-47-15
FS 355-16-40
BSR 06-40-05
FS 269-09-35
BSD 206-14-20
FS 108-43-50
BSR 21-12-40
FS 283-42-10
MA 262-29-29

40 → 41
504.160
504.160
504.160

T LE-1-33-40
BS LO-2-31-17
F/S LE-1-33-42

B/SD 21-21-10
F/S 284-01-40
B/SR 44-14-05
F/S 306-54-40
B/SD 03-42-00
F/S 266-22-50
B/SR 17-47-30
F/S 280-27-55

40 → 42
502.925
502.925
502.925

MA 262-40-30

9-30-98
RH-SI LE-1 33

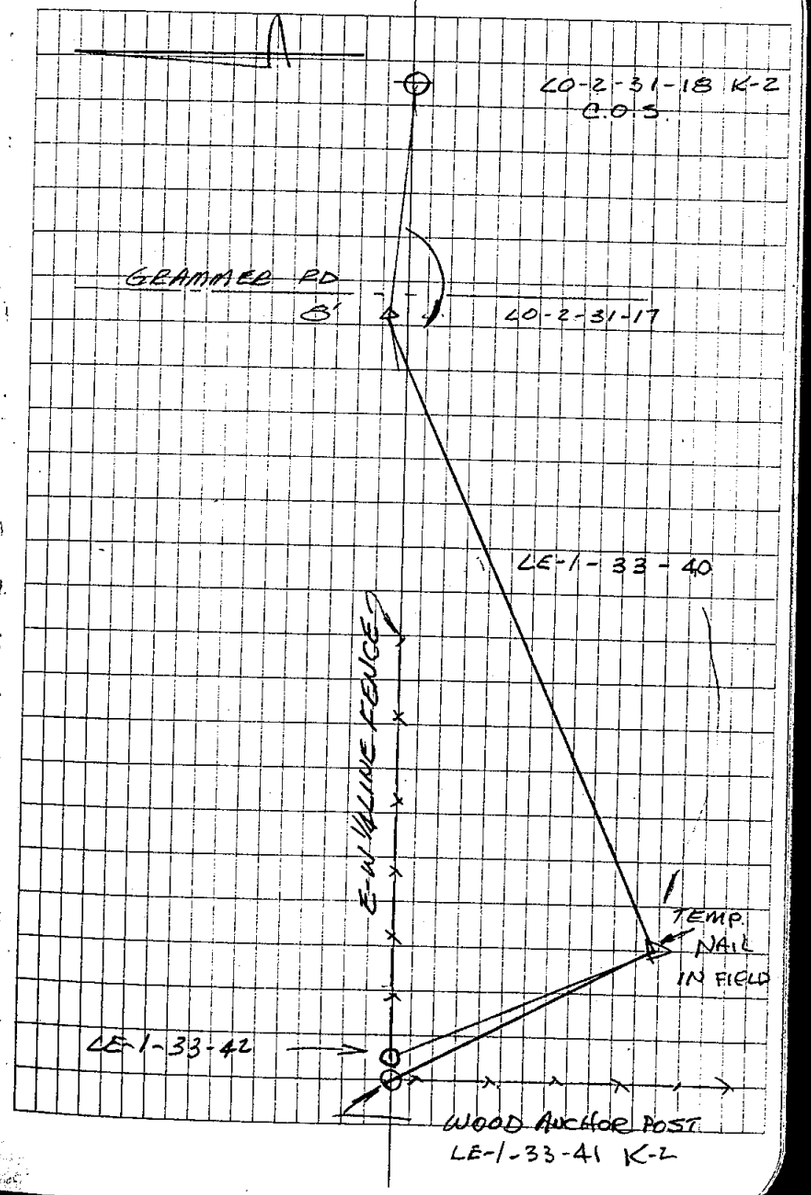

LE 1/35

10-13-98

L-3 RH-FS

¼ COR. COMMON TO SECTIONS 1 & 12
LEROY TWP T3N, R2E

FOUND BAR & CAP #19826,
P. BENTON L. 4 P. 389. AT NELY
SIDE OF FALLEN WOOD ANCHOR POST
OF 4-WAY FENCE. FD ALL (3)
BRG. TREES (HICKORY IS AN IRONWOOD)
FD. ALL (4) WITNESSES SET
BY R. LESTER #19998 REPLACED

1) SET NET #18994 OVER NET #18998
SOUTH 14" IRONWOOD AZ 269°, 16.78'
2) SET NET #18994 BELOW SPIKE, EAST SIDE
36" OAK, AZ. 186°, 23.85'
3) NET #18998 - N/SIDE TWIN OAK 24"
AZ, 107°, 30.70'
4) SE NET #18994 OVER NET #18998, W/SIDE
30" CHERRY. AZ 06°, 29.05'

ACCEPTED THE POSITION OF
CORNER & LEFT IN TACT

LE-1

(35)

L-1

NORTH ¼ COR
SEC. 1, T3N, R2E

SET 3/4" BAR & PLASTIC CAP
STAMPED PA 345 P.S. # 18994
AT MID POINT BETWEEN (M-1) &
K-1 LEROY TWP & ON LINE
BETWEEN K-13 & M-13 LOCKE
TWP. (STANDARD LINE)
IN TILLED FIELD
WEST 2637.44 TO K-1
EAST 2637.44 TO (M-1 & M-13)
SOUTH 2019.93 TO L-2 AS
RECORDED
NO AVAILIABLE WITNESSES
CORNER SET 2' BELOW
PLOWED GROUND.