INGHAM CO. - ONONDAGA TWP.

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF—:	LOCATED IN—:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 1 N. R. 2 W.	M-5
2. PROPERTY CONTROL CORNER IN SECTION	,T. N. S., R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	,T. N. S., R. E. W.	
4. LOT NO.	RECORDED PLAT	
5. PRIVATE CLAIMS		

Liber 4 Pg 275

FILED

AUG 11 12 53 PM '78

REGISTER OF DEEDS

INGHAM COUNTY, MICH.

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Ronnie M. Lester, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 6, 19 78, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required by the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, the corner points mentioned in lines 3 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established and described below and in conformance with rules of the Michigan State Board of Registration for Land Surveyors or, by, a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
M-5
Post set for monument in original government survey by Harvey Parke between Oct. 8, 1825 and Jan. 6, 1826. Monument, MONUMENT STONE WITNESS, BEARING, bearing & distance given by A.P. Drake, County Surveyor, April 1877, (v.3, p.129), W.A. Rowe, County Surveyor, Feb. 1898 and E.A. Calkins, Deputy County Surveyor, August 1900, (v.5, p.13).

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
M-5
Excavated hole 4.7' x 4.8' at average depth of 3.4' at centerline of Covert Road and intersection of Ridley Road. Found large pointed stone 1.9' below surface surrounded by red brick, 3.92' south of centerline of Covert Road and 5.35' east of centerline of Ridley Road, 9.25' south of A-5, T1N-R1W as called for above by A. Drake and E. Calkins.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
M-5
SE Corner Section 12, NE Corner Section 13.
Set 4" x 36" concrete comument with ½" x 38" rerod with cap #18998, and concrete collar with cover in place of stone as described above:
Nail & tag, #18998 south side 16" Pine E.NE., 80.01'
Nail & tag, #18998 southeast side Power Pole NE., 69.72'
Nail & tag, #18998 northeast side Power Pole E., 51.51'
Nail & tag, #18998 east side Corner Post W.SW., 41.26'
Monument with cap #18998 N., 9.25' A-5, T1N-R1W

SIGNED BY Ronnie M. Lester DATE Aug 1978

SURVEYOR'S MICHIGAN REGISTRATION NO. 18998

XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX

SIGNED BY _____

APPROVED AND SIGNED BY CHIEF OF SURVEY PARTY Leroy W. Fuller 8-9-78 DATE _____
MICHIGAN REGISTERED LAND SURVEYOR
Director, Ingham County Survey and Remonumentation Project

SURVEYOR'S MICHIGAN REGISTRATION NO. 17624

STATE OF MICHIGAN (SEAL) RONNIE M. LESTER LAND SURVEYOR NO. 18998 REGISTERED LAND SURVEYOR

1271

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 22, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in	Located In:	Corner Code #
INGHAM (county)		
1. Public Land Survey	T 1N R 1W	C-05
CORNER COMMON TO	T___ R___	___
SECTIONS 7, 8, 17 & 18	T___ R___	___
LESLIE TOWNSHIP	T___ R___	___
2. Property Controlling	S___ T___ R___	
in Section	S___ T___ R___	
3. Miscellaneous	S___ T___ R___	___

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS RECORDED
REYNOLDS LAND SURVEYING & M CRNR 11.00

L-10 P-308
2002-075425

2002-075425
Page: 1 of 2
11/21/2002 08:06A

Register of Deeds Stamp & File Number

4. Lot No_____, Recorded Plat_____
5. Private Claims_____

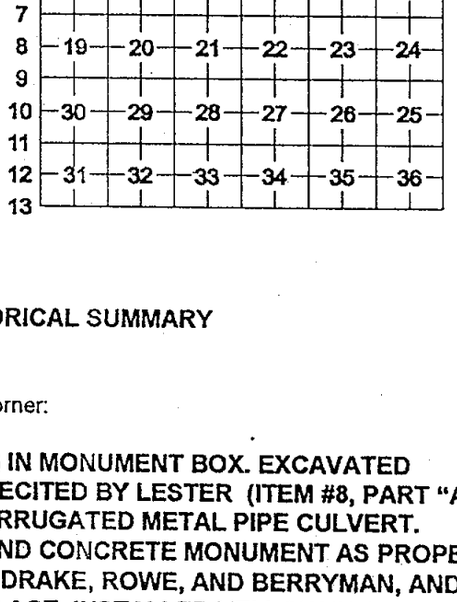

I, Brian Reynolds, In a field survey on April 1, 2002 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.
NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

SEE REVERSE SIDE OF THIS FORM FOR HISTORICAL SUMMARY

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" IRON WITH YELLOW PLASTIC CAP (INSCRIPTION OBLITERATED) IN MONUMENT BOX. EXCAVATED THROUGH BOX, FOUND CONCRETE AROUND IRON. AT WITNESS POINTS RECITED BY LESTER (ITEM #8, PART "A") AS "DENT IN CENTERLINE CULVERT END, FOUND "PK" NAILS THROUGH CORRUGATED METAL PIPE CULVERT. SYCAMORE AND POWER POLE WITNESSES REMAIN ALSO. ACCEPTED FOUND CONCRETE MONUMENT AS PROPER PERPETUATION OF CORNER POSITION BY COUNTY SURVEYORS JACKSON, DRAKE, ROWE, AND BERRYMAN, AND BY PROFESSIONAL SURVEYOR LESTER. LEFT CONCRETE MONUMENT IN PLACE, INSTALLED YELLOW PLASTIC CAP "REYNOLDS 31602" ON IRON, THEN PLACED STANDARD ALUMINUM REMON CAP OVER THAT. REWITNESSED AS DESCRIBED BELOW.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

FOUND NAIL & "KEBS 25832 (LARRY BRYAN, P.S.) 31588 (JEFFREY AUTENRIETH, P.S.) 41095 (ANTHONY BUMSTEAD, P.S.)" TAG IN S. SIDE OF 42" SYCAMORE NAZ 76°23' 129.80'
FOUND NAIL & WHITE SHINER IN NORTH SIDE OF POWER POLE NAZ 241°28' 60.88'
FOUND NAIL & TAG 18998 IN NORTHEAST SIDE OF POWER POLE NAZ 313°17' 73.04'
FOUND 'PK" NAIL IN TOP OF EAST END OF CMP CULVERT NAZ 15°08' 68.68'
FOUND 'PK" NAIL IN TOP OF WEST END OF CMP CULVERT NAZ 344°13' 67.17'

NO OTHER FIXED OBJECTS NEAR.

STATE OF MICHIGAN
BRIAN REYNOLDS
LAND SURVEYOR
NO. 31602
LICENSED LAND SURVEYOR

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/24/02 PL

Signed by _____ Date 11/12/2002

Surveyor's Michigan License No 31602

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS. JAN. 28, 1971
REVISED MAY 14, 1975 REVISED JANUARY, 1983 REVISED OCTOBER 1995

/scription of original monument and accessories and/or subsequent restoration: (T1N R1W C-05 CONTINUED)

1. GENERAL LAND OFFICE DEPUTY SURVEYOR HERVEY PARKE, 1826, "BEECH 10 N19E 18 Do 10 S57 1/2W 22 "
2. MARGINAL NOTE IN GLO TRANSCRIPTION, NO NAME OR DATE, "W. OAK 26 N41 1/2W 44 BUTTERNUT 2 N13 3/4E 188 "
3. COUNTY SURVEYOR A. JACKSON, MAY 1854, VOLUME 1, PAGE 354, "WHITEWOOD 22 N20W 103 Do 20 S42E 93
4. COUNTY SURVEYOR A. P. DRAKE, MARCH 1878, VOLUME 3, PAGE 135
5. COUNTY SURVEYOR W. A. ROWE, OCTOBER 1899, VOLUME 5 PAGE 1, "STONE & CROCKERY SET BY DRAKE FROM WHICH A SYCAMORE 20 IN. DIAMETER BEARS N76°E 193 LKS & BUTTERNUT 12 IN. N12°E 187 1/2 LKS.." THE NARRATIVE OF THE SAME SURVEY IN THE SMALL FIELD BOOK, PAGES 102 & 103 READS IN PERTINENT PART, "..FROM (B-05) N89 3/4E ALONG SEC. LINE 40.25 1/2 CH.TO STONE AT SE COR .O. P. F. & O. W. ..."
6. COUNTY SURVEYOR Wm. BARRYMAN?
7. ROAD COMMISSION WITNESS MAP, "STONE BRICK 36" SYCAMORE NE 129.5' ANCHOR POST NW 52.45'
   P.P. ESE 31.22' ANCH. POST NE 42.0' HD WALL WNW 60.74'
8. LAND CORNER RECORDATION CERTIFICATE LIBER 4, PAGE 393, BY RONNIE M. LESTER, RECORDED SEPTEMBER 28, 1978, (PART B) "EXCAVATED HOLE 3.5' X 2' TO AN AVERAGE DEPTH OF 3.0' AT THE INTERSECTION OF THE CENTERLINES OF COVERT ROAD AND TUTTLE ROAD NORTH. FOUND BOAT SPIKE IN CENTERLINE OF COVERT ROAD AND TUTTLE ROAD. FOUND A 3/4" SQUARE IRON SPIKE, LEANING AGAINST AND PARTIALLY OVER A 1.5' X 0.8' POINTED ROCK SURROUNDED BY RED BRICK, 0.8' BELOW THE SURFACE, DIRECTLY UNDER THE FOUND BOAT SPIKE. FOUND A SECOND BOAT SPIKE, 0.8' BELOW THE SURFACE ± 1.5' WEST OF THE CENTERLINE OF TUTTLE ROAD ON THE CENTERLINE OF COVERT ROAD. ACCEPTED POINTED ROCK AS CORNER DESCRIBED BY Wm. BARRYMAN AND OTHERS IN SURVEYS NOTED ABOVE. (PART C) SET 4" X 36" CONCRETE MONUMENT WITH 1/2" X 38" REROD WITH CAP #18998, AND CONCRETE COLLAR WITH COVER AT LOCATION OF POINTED ROCK DESCRIBED ABOVE:
   NAIL & TAG, #18998, SOUTHEAST SIDE 36" SYCAMORE ENE., 129.78'
   NAIL & TAG, #18998, NORTH SIDE POWER POLE NW., 73.06'
   DENT IN CENTERLINE CULVERT END, NNW, 67.68' DENT IN CENTERLINE CULVERT END, NNE., 68.88'

2002-075425
Page: 2 of 2
11/21/2002 08:06A

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in	Located In:	Corner Code #
INGHAM (county)		
1. Public Land Survey	T 1N R 1W	B-07
1/4 CORNER COMMON	T___ R___	___
TO SECTIONS 18 & 19	T___ R___	___
LESLIE TOWNSHIP	T___ R___	___

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS RECORDED
REYNOLDS LAND SURVEYING & M CRNR 11.00

L-10 P-312
2002-075427
2002-075427
Page: 1 of 2
11/21/2002 08:06A

Register of Deeds Stamp & File Number

2. Property Controlling S___ T___ R___
in Section S___ T___ R___

3. Miscellaneous S___ T___ R___ _____

4. Lot No_____, Recorded Plat_____
5. Private Claims_____

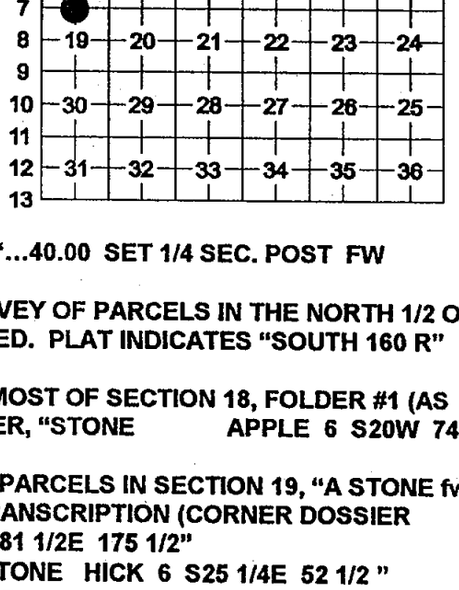

I, Brian Reynolds, in a field survey on May 29, 2002 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. GENERAL LAND OFFICE DEPUTY SURVEYOR HERVEY PARKE, 1826, "...40.00 SET 1/4 SEC. POST FW SUGAR 14 S89W 16 BOXWOOD 6 S57 1/2E 6..."
2. COUNTY SURVEYOR A. JACKSON, JUNE 21, 1855, VOL. 2, P. 247, SURVEY OF PARCELS IN THE NORTH 1/2 OF SECTION 19, "BOXWOOD 6 S57 1/2°E 6" MONUMENT NOT DESCRIBED. PLAT INDICATES "SOUTH 160 R" TO B-08. "S89 2/3W 80 R" MIDWAY TO A-07.
3. COUNTY SURVEYOR A. P. DRAKE, AUGUST 28-29, 1878, SURVEY OF MOST OF SECTION 18, FOLDER #1 (AS AN UNNUMBERED ATTACHMENT IN THE 1980'S ERA CORNER DOSSIER, "STONE APPLE 6 S20W 74 1/4 SWP OAK 10 N81 1/3 175 1/2
4. COUNTY SURVEYOR A. P. DRAKE, MARCH 11 & 18, 1880, SURVEY OF PARCELS IN SECTION 19, "A STONE fw AN APPLE TREE 6 in. BEARS S20°W 74 1/4 LINKS". A SEPARATE TRANSCRIPTION (CORNER DOSSIER ATTACHMENT #11) HAS AN ADDITIONAL WITNESS, "SWP OAK 10 N81 1/2E 175 1/2"
5. DEPUTY COUNTY SURVEYOR E. A. CALKINS, AUGUST 28-29, 1900, "STONE HICK 6 S25 1/4E 52 1/2 "
6. NO CORNER DATA SHOWN ON THE ROAD COMMISSION WITNESS MAP.

ADDITIONAL HISTORICAL CORNER DATA ON THE REVERSE OF THIS FORM

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND CONCRETE MONUMENT WITH 1/2" X 38" REROD (BENT) IN MONUMENT BOX, COVER MISSING, AND MOST WITNESSES FROM LCRC BY LESTER, ITEM #7, PART A. IT APPEARS THAT THE ROAD HAS SUBSIDED SOMEWHAT MORE THAN THE MONUMENT. AS THE FOUND MONUMENT CONFORMS CLOSELY WITH PREVIOUS WITNESSES, ACCEPTED FOUND CONCRETE MONUMENT AS PERPETUATION OF CORNER POSITION. CHISELED SOME CONCRETE OFF THE TOP OF THE MONUMENT, THEN CUT 4" OF REROD OFF AT BEND. PLACED YELLOW PLASTIC CAP "REYNOLDS 31602" ON 1/2" IRON, THEN PLACED STANDARD ALUMINUM CAP STAMPED "31602" OVER THAT. WITNESSED AS DESCRIBED BELOW.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

FOUND NAIL & "KEBS 25832" TAG IN THE EAST SIDE OF A UTILITY POLE N06°36'E 136.03'
FOUND ½" CAPPED IRON (#18657 GLENN A. FAUSER, P.S.) NORTH 32.81'
FOUND NAIL & TAG #18998 IN THE NORTH SIDE OF A 26" BLACK ASH S52°08'W 36.87'
SOUTHEAST CORNER OF GARAGE (CONCRETE FOUNDATION) N67°07'W 198.26'
FOUND NAIL & "KEBS 25832" TAG IN THE EAST SIDE OF A UTILITY POLE S04°31'E 186.25'
SET NAIL & PLASTIC "REYNOLDS 31602" TAG IN THE SOUTHEAST SIDE OF A 24" WALNUT S85°07'W 223.39'

P.A. 345 INGHAM COUNTY
PEER APPROVED 6/4/02 M

Signed by _____ Date 11/12/2002

Surveyor's Michigan License No 31602

STATE OF MICHIGAN
BRIAN REYNOLDS
LAND SURVEYOR
NO 31602

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975 REVISED JANUARY, 1983 REVISED OCTOBER 1995

A. Description of original monument and accessories and/or subsequent restoration: (T1N R1W B-07 CONTINUED)

7. LAND CORNER RECORDATION CERTIFICATE BY RONNIE M. LESTER, P. S. #18998, DATED 9/11/1978, LIBER 4, PAGE 339, PART B, "EXCAVATED A HOLE 7.5' X 5.6' TO AN AVERAGE DEPTH OF 2.5', MOSTLY SOUTH OF CENTERLINE OF KINNEVILLE ROAD ON AN EXTENDED FIELD SEPARATION TO THE NORTH. FOUND 3/4" IRON AT SURFACE ±7.5' SOUTH OF THE CENTERLINE OF KINNEVILLE ROAD...FOUND 2" GAS PIPE , LYING DOWN, SURROUNDED BY CROCKERY AND CHINA, 1.3' BELOW THE SURFACE, NEAR TO AND JUST ABOVE A 2" X 6" DECAYED WOOD STAKE 1.95' BELOW THE SURFACE, ±4.0' SOUTH OF THE CENTERLINE OF KINNEVILLE ROAD, 1.5' WEST OF FIELD SEPARATION NORTH. MEASURED EAST ±2655' TO C-7 IN CLOSE ACCORD WITH DRAKE'S 1880 SURVEY. ACCEPTED WOODEN STAKE AS CORNER; RESET 3/4" IRON. EXCAVATION CONDUCTED BY INGHAM COUNTY SURVEY AND REMONUMENTATION PROJECT CREW. PART C: "SET 4" X 36" CONCRETE MONUMENT WITH 1/2" X 38" REROD, CAP #18998, WITH CONCRETE COLLAR AND COVER, IN LOCATION OF STAKE DESCRIBED ABOVE: NAIL & TAG #18998, NORTH SIDE 26" BLACK ASH, SW, 37.16'
NAIL & TAG #18998, SOUTHEAST SIDE 20" WALNUT, WSW, 223.17'
FOUND 1/2" PROPERTY IRON , #18657, NORTH 29.85'
SOUTHEAST CORNER GARAGE AT GROUND LEVEL, WNW 198.25'
8. AN ACT 132 SURVEY OF A PARCEL IN THE NORTHWEST 1/4 OF SECTION 19, THE NORTH LINE OF WHICH IS THE NORTH LINE OF SECTION 19, SURVEY BY GLENN A. FAUSER, P. S. #18657, DATED OCTOBER 3, 1973, RECORDED JUNE 30, 1975 IN LIBER 2 OF SURVEYS, PAGE 384. THE PLAT OF THE SURVEY DISPLAYS THE NORTH LINE OF SECTION 19 CONTROLLED BY THE NORTHWEST CORNER AND THE NORTHEAST CORNER OF THE SECTION. THE SUBJECT CORNER IS NOT SHOWN OR MENTIONED.
9. ACT 132 SURVEY BY GEORGE M. YOUNG P. S. #17640, DATED SEPTEMBER 12, 1978, RECORDED NOVEMBER 29, 1978 IN LIBER 3, PAGE 614, SURVEY OF A PARCEL IN THE NORTHWEST 1/4 OF SECTION 19, MONUMENT AND WITNESSES RECITED SAME AS LCRC BY LESTER, ITEM #7 ABOVE.
10. ACT 132 SURVEY BY GEORGE M. YOUNG P. S. #17640, DATED JANUARY 14, 1985, RECORDED AUGUST 23, 1985 IN LIBER 4, PAGES 1056-1057, SURVEY OF A PARCEL IN THE SOUTHWEST 1/4 OF SECTION 18, MONUMENT AND WITNESSES RECITED SAME AS LCRC BY LESTER, ITEM #7 ABOVE.
11. ACT 132 SURVEY BY RONNIE M. LESTER, P. S. 18998, DATED 9/18/1984, RECORDED OCTOBER 9, 1984 IN LIBER 4, PAGE 908, MONUMENT AND WITNESSES SAME AS ITEM #7 ABOVE.

2002-075427
Page: 2 of 2
11/21/2002 08:06A

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in INGHAM (county)	Located In:	Corner Code #
1. Public Land Survey	T 1N R 1W	A-07
CORNER COMMON	T____ R____	
TO SECTIONS 18 & 19	T____ R____	
LESLIE TOWNSHIP	T____ R____	
ON RANGE LINE		
2. Property Controlling	S____ T____ R____	
in Section	S____ T____ R____	
3. Miscellaneous	S____ T____ R____	

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS RECORDED
REYNOLDS LAND SURVEYING & M CRNR 11.00

L-10 P-314
2002-075428

2002-075428
Page: 1 of 2
11/21/2002 08:06A

Register of Deeds Stamp & File Number

4. Lot No_____, Recorded Plat_____
5. Private Claims_____

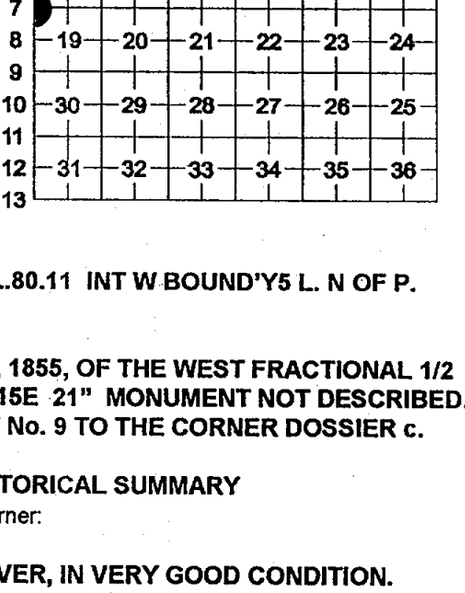

I, Brian Reynolds, in a field survey on May 29, 2002 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. **GENERAL LAND OFFICE DEPUTY SURVEYOR HERVEY PARKE, 1826, "..80.11 INT W BOUND'Y5 L. N OF P. BEECH 10 S44E .23 SUGAR 7 N15E .21...."**
2. **NO DATA FROM ROAD COMMISSION MAP**
3. **SURVEY BY COUNTY SURVEYOR A. JACKSON, DATED JANUARY 30TH, 1855, OF THE WEST FRACTIONAL 1/2 OF THE SOUTHWEST 1/4 OF SECTION 18, VOL. 2, P. 246, "SUGAR 7 N15E 21" MONUMENT NOT DESCRIBED. A SEPARATE TRANSCRIPTION OF THIS SAME SURVEY, ATTACHMENT No. 9 TO THE CORNER DOSSIER c. 1978, AN ADDITIONAL WITNESS, "BEECH 10 S44E 23"**

SEE REVERSE OF THIS FORM FOR CONTINUATION OF HISTORICAL SUMMARY

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND CONCRETE MONUMENT WITH CAP (ILLEGIBLE) IN CASTING WITH COVER, IN VERY GOOD CONDITION. ACCEPTED FOUND MONUMENT AS PROPER PERPETUATION OF CORNER POSITION BY COUNTY SURVEYORS JACKSON AND CALKINS, AND BY PROFESSIONAL SURVEYOR LESTER. LEFT CONCRETE MONUMENT WITH 1/2" IRON IN PLACE. PLACED YELLOW PLASTIC CAP "REYNOLDS 31602" ON IRON IN CONCRETE MONUMENT, THEN PLACED STANDARD ALUMINUM CAP STAMPED "31602" OVER THAT. WITNESSED AS DESCRIBED BELOW.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

WITNESSES TO CONCRETE MONUMENT IN MON BOX WITH ALUMINUM INGHAM REMON CAP STAMPED "31602"
FOUND NAIL & TAG #18998 IN THE NORTHWEST SIDE OF A 15" TWIN CHERRY N18°W 90.33'
FOUND NAIL & TAG #18998 IN THE WEST SIDE OF A 24" WALNUT S09°W 235.40'
SET NAIL & ORANGE PLASTIC TAG #31602 IN THE NORTHWEST SIDE OF A 15" SPRUCE S07°40'W 130.55'
TOP CENTER OF A 4" STEEL FENCE POST S24°47'W 69.69'
M-07 T1N R2W ONONDAGA TWP. SOUTH 3.28'

STATE OF MICHIGAN
BRIAN REYNOLDS
LAND SURVEYOR
NO 31602
REGISTERED LAND SURVEYOR

P.A. 345 INGHAM COUNTY
PEER APPROVED 6/4/02 PL

Signed by_____ Date 11/12/2002

Surveyor's Michigan License No 31602

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS. JAN. 28, 1971
REVISED MAY 14, 1975 REVISED JANUARY, 1983 REVISED OCTOBER 1995

A. Description of original monument and accessories and/or subsequent restoration: (T1N R1W A07 CONTINUED)

4. SURVEY BY DEPUTY COUNTY SURVEYOR E. A. CALKINS, DATED AUGUST 28-29, 1900, SURVEY OF THE LINE FROM A-07 TO B-07, "STONE SURROUNDED WITH STONE CHERRY 8 N16°E 149 ¼ SUGAR 16 S13°E 236"
5. LAND CORNER RECORDATION CERTIFICATE BY GLENN A FAUSER, P. S. #18657, DATED OCTOBER 27, 1978, LIBER 5, PAGE 57, "FOUND 3/4" PIPE FENCE POST N48°30'E 39.00 FENCE POST N46°W 30.30' 26" W. CHERRY S27°E 66.20' ST. SIGN POST S50°W 46.15' CORNER IS 2' WEST OF C/L OF ROAD CORNER IS 5' NORTH OF C/L OF ROAD GOING WEST" AN ACT 132 SURVEY BY FAUSER, LIBER 2, PAGE 384, DATED OCTOBER 3, 1973 AND RECORDED JUNE 30, 1975, RECITES THE SAME MONUMENT AND WITNESSES.
6. LAND CORNER RECORDATION CERTIFICATE BY RONNIE M. LESTER, P. S. #18998, DATED 5/20, 1981, LIBER 6, PAGE 170, .PART B: "EXCAVATED A 10' X 13' AT INTERSECTION OF ROADWAYS. FOUND LARGE STONE SURROUNDED BY SMALL STONES AS CALLED FOR BY CALKINS IN SURVEY OF AUGUST, 1900. FOUND DISTURBED STONE PILE ±3.3' SOUTH OF M-7 AS CALLED FOR BY CALKINS. SET MONUMENT AT STONE PILE TO NORTH. CORNER FALLS ±6.5' EAST OF CORNER RECORDED IN L.5, P. 57. MEASURED NORTH TO A-6 2640.45', MEASURED SOUTH TO A-8 2656.44'.."
PART C: "SET CONCRETE MONUMENT, COLLAR AND LID AT LOCATION DESCRIBED ABOVE:
FOUND 4" CONCRETE MONUMENT AT M-7 ONONDAGA, SOUTH 3.30'
NAIL & TAG, #18998, NORTHWEST SIDE TWIN 12" WILD CHERRY, S70°W, 111.59'
NAIL & TAG, #18998, NORTHWEST SIDE 24" WILD CHERRY, S50°W, 75.43'
NAIL & TAG, #18998, NORTHWEST SIDE 12" WILD CHERRY, S45°W, 54.97'
TOP CENTER MBT CABLE BOX, S45°E, 55.20'
7. ACT 132 SURVEY BY GEORGE M. YOUNG, P. S. 17640, DATED SEPTEMBER 12, 1978, RECORDED NOVEMBER 29, 1978, LIBER 3 OF SURVEYS, PAGE 614, PARCEL IN THE NORTHWEST FRACTIONAL 1/4 OF SECTION 19, MONUMENT AND WITNESSES SAME AS LCRC BY LESTER, ITEM #6 ABOVE.
8. ACT 132 SURVEY BY GEORGE M. YOUNG, P. S. 17640, DATED 14 JAN 84, RECORDED AUGUST 23, 1985, LIBER 4 OF SURVEYS, PAGES 1056-1057, PARCEL IN THE WEST FRACTIONAL 1/2 OF SECTION 18, MONUMENT AND WITNESSES SAME AS LCRC BY LESTER, ITEM #6 ABOVE.

2002-075428
Page: 2 of 2
11/21/2002 08:06A

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in	Located In:	Corner Code #
INGHAM (county)		
1. Public Land Survey	T 1N R 1W	A-06
WEST 1/4 CORNER	T___ R___	
SECTION 18	T___ R___	
LESLIE TOWNSHIP	T___ R___	
ON RANGE LINE		
2. Property Controlling	S___ T___ R___	
in Section	S___ T___ R___	
3. Miscellaneous	S___ T___ R___	

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS RECORDED
REYNOLDS LAND SURVEYING & M CRNR 11.00

L-10 P-316
2002-075429

2002-075429
Page: 1 of 2
11/21/2002 08:06A
Register of Deeds Stamp & File Number

4. Lot No_____, Recorded Plat_____
5. Private Claims_____

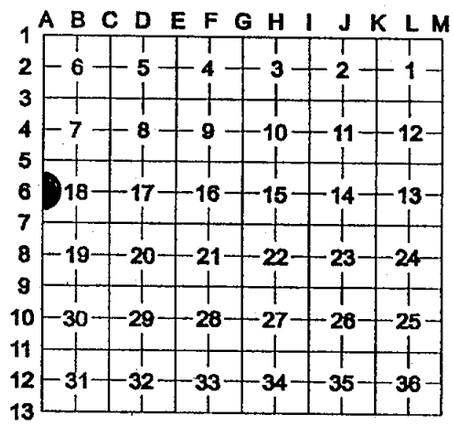

I, Brian Reynolds, in a field survey on May 29, 2002 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. **THIS CORNER WAS NOT MONUMENTED BY THE GENERAL LAND OFFICE SURVEY**
2. **A SURVEY OF THE NORTHEAST 1/4 OF SECTION 18 BY COUNTY SURVEYOR A. JACKSON, DATED JANUARY 29, 1839, MAKES NO DIRECT REFERENCE TO THE SUBJECT CORNER. THE PLAT INDICATES THAT JACKSON RAN BOTH QUARTER LINES AND ESTABLISHED THE CENTER OF SECTION, IMPLYING THAT HE FIRST ESTABLISHED THE SUBJECT CORNER. A SEPARATE TRANSCRIPTION OF THE SAME SURVEY VOL. 1, P. 135, "POST 9 LKS. NORTH OF CORNER IN OTHER TOWN" NO MONUMENT OR WITNESSES RECITED.**
3. **A SURVEY OF THE WEST FRACTIONAL 1/2 OF THE SOUTHWEST ¼ OF SECTION 18 BY A. JACKSON, COUNTY SURVEYOR, DATED JANUARY 20, 1855, "R. OAK 16 S58E 39 2/3 BEECH 11 N52 1/2E 12"**

HISTORICAL SUMMARY CONTINUED ON REVERSE OF THIS FORM

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND CONCRETE MONUMENT WITH 1/2" REROD IN CASTING WITH COVER IN GOOD CONDITION. ACCEPTED AS PROPER RESTORATION OF CORNER POSITION BY PROFESSIONAL SURVEYOR LESTER. LEFT CONCRETE MONUMENT AND CASTING IN PLACE. PLACED A YELLOW PLASTIC CAP INSCRIBED "REYNOLDS 31602" OVER THE 1/2" IRON, THEN PLACED A STANDARD ALUMINUM CAP STAMPED "31602" OVER THAT. WITNESSED AS DESCRIBED BELOW.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

WITNESSES TO CONCRETE MONUMENT WITH ALUMINUM CAP IN CASTING.
FOUND NAIL & TAG #18998 IN THE SOUTHWEST SIDE OF A 20" OAK S55°50'E 29.93'
FOUND IRON WITH CAP #17640 (GEORGE M. YOUNG, P. S.) EAST 32.83'
FOUND NAIL & TAG #25832 (LARRY A. BRYAN, P. S.) IN THE EAST SIDE OF A UTILITY POLE N11°27'W 128.98'
FOUND NAIL & TAG #25832 IN THE SOUTHEAST SIDE OF A UTILITY POLE S14°23'W 106.74'
FOUND NAIL & TAG #25832 IN THE SOUTHWEST SIDE OF A UTILITY POLE S17°10'E 113.05'
M-06 T1N R2W (CONCRETE MONUMENT IN CASTING) SOUTH 5.90' CORNER IS 1'± WEST OF ROAD C/L
A-05 LIES N00°18'39"W 2645.28' A-07 LIES S00°19'30"E 2640.30'

STATE OF MICHIGAN
BRIAN REYNOLDS
LAND SURVEYOR
NO 31602

P.A. 345 INGHAM COUNTY
PEER APPROVED 6/4/02 M

Signed by Brian Reynolds

Date 11/12/2002

Surveyor's Michigan License No 31602

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS. JAN. 28, 1971
REVISED MAY 14, 1975 REVISED JANUARY, 1983 REVISED OCTOBER 1995

A. Description of original monument and accessories and/or subsequent restoration: (TIN R1W A-06 CONTINUED)

4. A SURVEY BY COUNTY SURVEYOR A. P. DRAKE, ARRIL 23, 1877, VOLUME 3, PAGE 129, SURVEY OF A PART OF SECTION 13, T1N R2W, READS, IN PERTINENT PART, "THE CORNER WAS LOST, BUT THE CORRESPONDING CORNER IN T1N-R1W, ESTABLISHED BY MR. JACKSON, WAS READILY FOUND, AND THIS CORNER WAS LOCATED AT ITS PROPER DISTANCE SOUTH OF IT, BEING NINE LINKS THEREFROM."
5. SURVEY BY COUNTY SURVEYOR A. P. DRAKE, MARCH 19 & 25, 1878, ATTACHMENT #7, c. 1978 CORNER DOSSIER, SURVEY OF MOST OF SECTION 18, "POST 8 LINKS N. FROM ONONDAGA POST"
6. NO CORNER DATA IS DISPLAYED ON THE ROAD COMMISSION WITNESS MAP
7. LAND CORNER RECORDATION CERTIFICATE BY RONNIE M. LESTER, P. S. #18998, DATED MAY 20, 1981, LIBER 6, PAGE 183, PART B: "EXCAVATED A TOTAL OF 15' NORTH AND SOUTH BY 10' EAST AND WEST TO AN AVERAGE DEPTH OF 1.5 FEET. NO PHYSICAL EVIDENCE FOUND. CORNER DETERMINED TO BE LOST. SET CORNER ON TOWNSHIP LINE 5.94 FEET NORTH OF ONONDAGA PER COUNTY SURVEYORS RECORD DATED MARCH, 1878...."
PART C: "SET 4" X 38" CONCRETE MONUMENT WITH 1/2" X 38" REROD AND CAP #18998 AT LOCATION DESCRIBED ABOVE: NAIL & TAG, #18998, SOUTH SIDE 3" FENCE POST, S85°E, 25.54'
NAIL & TAG, #18998, SOUTHWEST SIDE 12" OAK, S70°E, 30.13'
NAIL & TAG, #18998, SOUTHWEST SIDE 12" OAK, S45°E, 34.44'
NAIL & TAG, #18998, SOUTHWEST SIDE 12" ASH, S20°E, 68.21'
CONCRETE MONUMENT AT M-6 ONONDAGA, SOUTH, 5.94'
8. ACT 132 SURVEY BY GEORGE M. YOUNG, P. S. #17640, DATED JANUARY 14, 1984, A PARCEL IN THE WEST FRACTIONAL 1/2 OF THE SOUTHWEST 1/4 OF SECTION 18, LIBER 4 OF SURVEYS, PAGES 1056-1057, MONUMENT AND WITNESSES AS RECITED IN ITEM # 7 ABOVE.

2002-075429
Page: 2 of 2
11/21/2002 08:06A

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in	Located In:	Corner Code #
INGHAM (county)		
1. Public Land Survey CORNER COMMON TO SECTIONS 7 & 18 LESLIE TOWNSHIP ON RANGE LINE	T 1N R 1W	A-05
	T___ R___	___
	T___ R___	___
	T___ R___	___
2. Property Controlling Corner in Section	S___ T___ R___	
	S___ T___ R___	
3. Miscellaneous	S___ T___ R___	___

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS RECORDED
REYNOLDS LAND SURVEYING & M CRNR 11.00

L-10 P-318
2002-075430

2002-075430
Page: 1 of 2
11/21/2002 08:06A

Register of Deeds Stamp & File Number

4. Lot No_____, Recorded Plat_____
5. Private Claims_____

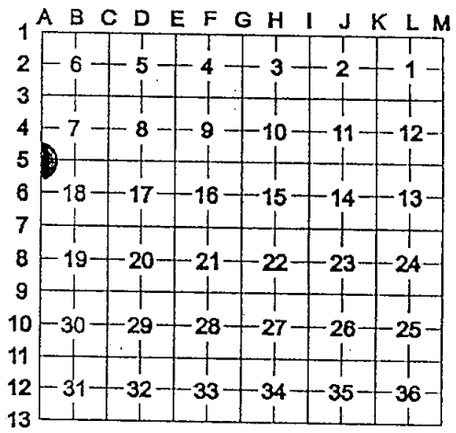

I, Brian Reynolds, in a field survey on May 1, 2002 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

SEE REVERSE SIDE OF THIS FORM FOR HISTORICAL SUMMARY

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND CONCRETE MONUMENT IN GOOD CONDITION IN MONUMENT BOX AS DESCRIBED IN ITEM #7 OF PART "A". FOUND ALL WITNESSES FROM ITEM #7, EXCEPT CORNER POST SW. ACCEPTED AS PROPER PERPETUATION OF CORNER POSITION BY COUNTY SURVEYORS DRAKE, ROWE AND BARRYMAN, AND BY PROFESSIONAL SURVEYOR LESTER. LEFT CONCRETE MONUMENT IN PLACE. INSTALLED YELLOW PLASTIC CAP "REYNOLDS 31602" ON 1/2" IRON IN CONCRETE MONUMENT, THEN INSTALLED STANDARD INGHAM ALUMINUM CAP OVER THAT. REWITNESSED AS DESCRIBED BELOW.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

WITNESSES TO STANDARD MONUMENT IN MON BOX WITH ALUMINUM INGHAM REMON CAP STAMPED "31602"

FOUND NAIL AND TAG #18998 IN S. SIDE OF 24" WHITE PINE NAZ 68°48' 75.90'
FOUND NAIL AND TAG #18998 IN NORTH SIDE OF POWER POLE NAZ 114°58' 54.73'
FOUND NAIL AND WHITE SHINER IN SOUTH SIDE OF SAME POWER POLE NAZ 116°00' 54.78'
FOUND NAIL AND "KEBS 25832 31588 41095" TAG IN 3" WOOD POST NAZ 342°55' 17.56'
FOUND NAIL AND TAG #18998 IN SE SIDE OF POWER POLE NAZ 49°44' 63.36'
SET 'PK" NAIL IN TOP OF WEST END OF 8" CMP CULVERT NAZ 12°44' 13.08'
SET 'PK" NAIL IN TOP OF EAST END OF 8" CMP CULVERT NAZ 60°48' 29.91'
CONC MON W/ALUMINUM REMON CAP IN MON BOX (M-05 T1N R2W) NAZ 180° 9.25'

P.A. 345 INGHAM COUNTY
PEER APPROVED 6/4/02 RL

Signed by_____ Date 11/12/2002

Surveyor's Michigan License No 31602

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS. JAN. 28, 1971
REVISED MAY 14, 1975 REVISED JANUARY, 1983 REVISED OCTOBER 1995

A. Description of original monument and accessories and/or subsequent restoration: (T1N R1W A05 CONTINUED)

1. GENERAL LAND OFFICE DEPUTY SURVEYOR HERVEY PARKE, 1826, "INT 14 L N OF POST BEECH 9 S31E 27 W. ASH 11 N73W 14"
2. COUNTY SURVEYOR A. P. DRAKE, SURVEY OF NEARLY ALL OF SECTIONS 17 & 18, MARCH 19-25, 1878, VOL. 3, P. 135, "A STONE 14 LKS NORTH OF CORRESPONDING CORNER IN OTHER TOWN" NO WITNESSES
3. COUNTY SURVEYOR W. A. ROWE, VOLUME 5, PAGE 1, OCTOBER 1899, "STONE SET BY DRAKE PLUM 4 IN. N48°E 66LKS BUTTERNUT 8 IN. S67 1/4°E 81 LKS AND BUTTERNUT 8 IN. S34 1/4°W 77 LKS AND STONE SET FOR ONONDAGA CORNER SOUTH 13 LKS." THE NOTES FROM THE SAME SURVEY IN THE SMALL FIELD BOOK, PAGES 102-103 READ, IN PERTINENT PART, "..(FROM B-05) THENCE S89 1/2W 40,19 TO SW COR SEC. STONE FOUND 14 L. NORTH OF ONONDAGA STONE, F/W PLUM 4 N48°E 67 L. BUTTERNUT 8. S67 1/4E 82 1/2 L. BUTTERNUT 8 S34 1/4W 78 L. ..."
4. LCRC (ITEM 7 BELOW) REFERS TO RECORDS OF COUNTY SURVEYOR BARRYMAN, "BLUE POINTED STONE & WITNESSES" THE RECORDS BY BARRYMAN WERE NOT FOUND.
5. IN REFERENCE TO THE CORRESPONDING STANDARD CORNER, DEPUTY COUNTY SURVEYOR E.A. CALKINS, AUGUST 28-29, 1900, VOLUME 5, PAGE 13, "STONE 14 LINKS SOUTH OF LESLIE STONE"
6. ROAD COMMISSION WITNESS MAP, "STONE BRICK: 7" PINE ENE 76.7'; SW CORN HOUSE NE 116.1'; P.P. SE 53.9' THE NOTHSTINE NOTES CALL FOR A "BLUE POINTED STONE" AND SAME WITNESSES, EXCEPT THE 7" PINE IS CALLED A "JACK PINE."
7. LAND CORNER RECORDATION CERTIFICATE, LIBER 4, PAGE 275, BY RONNIE M. LESTER, RECORDED AUGUST12,1978, PART B) "EXCAVATED HOLE 6' X 5' AT AVERAGE DEPTH OF 3.8 FEET NORTH OF CENTERLINE OF COVERT ROAD AND INTERSECTION OF RIDLEY ROAD.. FOUND LARGE POINTED STONE 1.6' BELOW SURFACE, 6.71' NORTH OF CENTERLINE OF COVERT ROAD AND 5.29 FEET EAST OF CENTERLINE OF RIDLEY ROAD, 9.25' NORTH OF M-5, TIN-R2W AS CALLED FOR ABOVE BY DRAKE AND E. CALKINS"
   (PART C) SET 4" X 36" CONCRETE MONUMENT WITH ½" X 38" REROD WITH CAP #18998, AND CONCRETE COLLAR WITH COVER AS DESCRIBED ABOVE:
   NAIL & TAG, #18998 SOUTHEAST SIDE POWER POLE E.NE., 63.39'
   NAIL & TAG, #18998 SOUTH SIDE 16" PINE TREE E.NE., 76.17'
   NAIL & TAG, #18998 EAST SIDE POWER POLE, ESE., 54.76'
   NAIL & TAG, #18998 NORTHEAST SIDE POWER POLE, E., 51.51'
   NAIL & TAG, #18998 SOUTHEAST SIDE CORNER POST SW., 47.85'
   MONUMENT WITH CAP #18998 S., 9.25' M-5 T1N-R2W

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in (county)	Located In:	Corner Code #
INGHAM		
1. Public Land Survey	T 1N R 1W	C-06
1/4 CORNER COMMON TO	T___ R___	
SECTIONS 17 & 18	T___ R___	
LESLIE TOWNSHIP	T___ R___	

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS
OFFICIAL SEAL

L-11 P-107
CRNR 17.00 2003-105259

2003-105259
Page: 1 of 2
12/09/2003 08:50A

Register of Deeds Stamp & File Number

2. Property Controlling S___ T___ R___
in Section S___ T___ R___

3. Miscellaneous S___ T___ R___ _____

4. Lot No_____, Recorded Plat_____
5. Private Claims_____

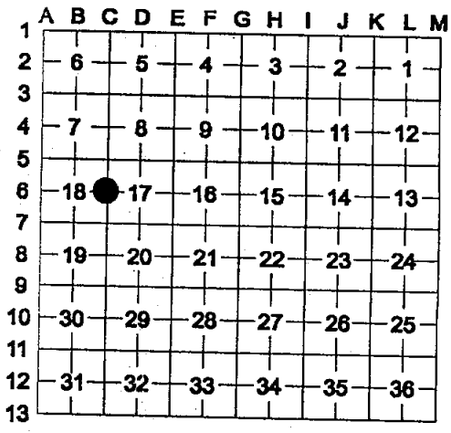

I, Brian Reynolds, in a field survey on JUNE 20 , 2003 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

SEE PAGE TWO FOR HISTORICAL SUMMARY

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

THE APPARENT LOCATION OF THE SUBJECT CORNER IS IN A CULTIVATED FIELD WITH THE NEAREST LINE OF OCCUPATION ABOUT 330 FEET NORTH, THE CENTERLINE OF THE NEAREST ROAD ABOUT 500 FEET EAST. THE SURVEY BY DRAKE IN 1878 INDICATES THAT THE LAND IN ALL QUADRANTS FROM THE SUBJECT CORNER WAS IN THE COMMON OWNERSHIP OF LEMUEL A. ROYSTON. THE LAND IS STILL IN COMMON OWNERSHIP IN ALL DIRECTIONS. THERE IS NO VISIBLE EVIDENCE TO INDICATE EVEN AN APPROXIMATION OF THE CORNER LOCATION. TRAVERSED ENTIRE SECTION 18, TYING IN EXISTING MONUMENTATION AND OCCUPATION. COMPUTED THE THEORETICAL CORNER POSITION AT MID-POINT ON LINE BETWEEN FOUND MONUMENTATION AT C-5 AND C-7, CHECKED AND FOUND THAT POSITION CONSISTENT WITH THE OCCUPATION 330'± NORTH, WHICH WAS A LINE FROM THE DRAKE SURVEY. DUG BY HAND A LARGE HOLE AT THE THEORETICAL POSITION, AT LEAST 6 FEET IN DIAMETER, TO A DEPTH OF 5 FEET, FOUND NO EVIDENCE OF PREVIOUS MONUMENTATION. DETERMINED THE CORNER TO BE LOST, RESTORED THE CORNER AT THE MID-POINT AND ON LINE BETWEEN C-5 AND C-7. PLACED AN UNCAPPED STANDARD REMON IRON (3/4" DIAMETER X 24" FORM PIN) WITH TOP FULLY 3+ FEET BELOW GRADE, PLACED ANOTHER IRON (CAPPED) ABOVE THAT WITH TOP 8+ INCHES BELOW GRADE, AND WITNESSED AS DESCRIBED BELOW.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

STANDARD REMON IRON (3/4" DIAMETER X 24" FORM PIN WITH ALUMINUM CAP STAMPED "31602"
SET NAIL AND TAG #31602 IN THE SOUTH SIDE OF A 12" ASH NAZ 92° 467.83
SET NAIL AND TAG #31602 IN THE SOUTHWEST SIDE OF A 32"WALNUT NAZ 134° 638.58'
SET NAIL AND TAG #31602 IN THE SOUTHWEST SIDE OF A 30" WALNUT NAZ 122° 546.59'
SET NAIL AND TAG #31602 IN THE SOUTHWEST SIDE OF A 36" ASH NAZ 112° 510.01'
CENTERLINE OF ROAD TO EAST IS 493±'
C-05 IS N00°17'49"W 2649.05'
C-07 IS S00°17'49"E 2649.05'
B-06 IS S89°55'14"W 2655.15'

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/30/2003

STATE OF MICHIGAN
BRIAN REYNOLDS
LAND SURVEYOR
NO. 31602
LICENSED LAND SURVEYOR

Signed by _____ Date NOVEMBER 30, 2003

Surveyor's Michigan License No 31602

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS. JAN. 28, 1971
REVISED MAY 14, 1975 REVISED JANUARY, 1983 REVISED OCTOBER 1995

A. Description of original monument and accessories and/or subsequent restoration: (T1N R1W, C-06, CONTINUED)

1. CORNER ESTABLISHED BY GENERAL LAND OFFICE DEPUTY SURVEYOR HERVEY PARKE "...40.00 SET 1/4 SEC. POST F/W SUGAR 7 N47E 3 BEECH 9 S48W 39
2. A SURVEY OF THE ENTIRETY OF SECTIONS 17 AND 18 BY COUNTY SURVEYOR A. P. DRAKE, DATED MARCH 19TH – 25TH, 1878, RECORDED APRIL 9TH, 1878, VOLUME 3, PAGE 135. THE VARIOUS GRID CORNERS AND CORNERS OF THE PROPERTY SURVEYED BY DRAKE ARE REFERRED TO ON THE PLAT BY LETTER , UPPER CASE A-Z AND LOWER CASE a THROUGH i, AND CROSS-REFERENCED IN THE NOTES WITH DESCRIPTION OF MONUMENT AND WITNESSES. THE SUBJECT CORNER IS NOT SO REFERENCED, AND IS NOT LISTED WITH THE CORNER MONUMENTS AND WITNESSES. ON THE PLAT, THE EAST-WEST QUARTER LINE THROUGH BOTH SECTIONS IS A DASHED LINE, AND LABELED WITH THE WORDS "QUARTER POST LINE" WITH THE WORD "POST" DIRECTLY ABOVE THE MAP LOCATION OF THE SUBJECT CORNER. THE LABEL "POST" WAS APPARENTLY INTENDED TO REFER TO THE SUBJECT CORNER MONUMENT, AND THAT THE WORDS "QUARTER LINE" WERE INTENDED TO BE READ SEPARATELY. THE PLAT INDICATES A CUMULATIVE DISTANCE OF EXACTLY 80 CHAINS FOR THE FULL MILE NORTH-SOUTH, AND DISTANCE OF 20 CHAINS FROM C-7 TO THE MID-POINT BETWEEN C-6 AND C-7. A COPY OF A SEPARATE PLAT OF SECTION 17 ONLY FROM THE SAME SURVEY, IN THE CORNER DOSSIER FILE OF THE INGHAM COUNTY SURVEY AND REMONUMENTATION PROJECT, c. 1980, MISLABELS THE CORNER E-6 AS C-6, INCORRECTLY IMPLIES THAT THE MONUMENT SHOULD BE "STONE IN CENTER OF HIGHWAY."
3. FROM THE CORNER DOSSIER OF THE INGHAM COUNTY SURVEY AND REMONUMENTATION PROJECT, c. 1980, A PUBLISHED DESCRIPTION OF THE "ROYSTON COUNTY DRAIN OF LESLIE" INTERSECTS THE EAST AND WEST 1/4 LINE OF SECTION 17 "16 CHS 70 LKS E U. S. 1/4 POST BETWEEN SEC'S 17 & 18." THAT POINT IS NOT AN ANGLE POINT OF THE DRAIN. THE PUBLISHED DESCRIPTION CONCLUDES WITH THE FOLLOWING: "THE ABOVE DESCRIBED LINE WAS RUN MAY 12TH, 13TH, AND THE LEVELS RUN MAY 14TH, 1892. JOHN McCREARY, SURVEYOR."

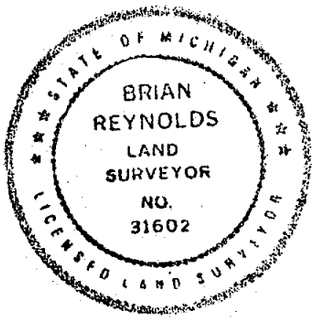

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in INGHAM (county)	Located In:	Corner Code #
1. Public Land Survey CORNER COMMON TO SECTIONS 7, 8, 17 & 18 LESLIE TOWNSHIP	T 1N R 1W	C-07
	T___ R___	
	T___ R___	
	T___ R___	
2. Property Controlling in Section	S___ T___ R___	
	S___ T___ R___	
3. Miscellaneous	S___ T___ R___	

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS
OFFICIAL SEAL

L-11 P-109
CRNR 17.00 2003-105260

2003-105260
Page: 1 of 2
12/09/2003 08:50A

Register of Deeds Stamp & File Number

4. Lot No_____, Recorded Plat_____
5. Private Claims_____

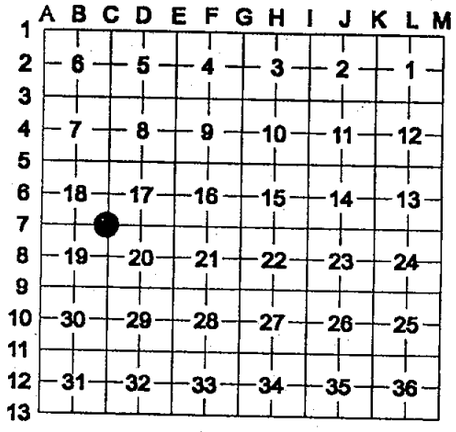

I, Brian Reynolds, in a field survey on May 29, 2002 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

SEE PAGE TWO FOR HISTORICAL SUMMARY

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" CAPPED IRON AS DESCRIBED IN PREVIOUS CORNER RECORDINGS BY WHITE AND FAUSER. EXCAVATED A 2' X 2' HOLE TO A DEPTH OF 2.5', ENCOUNTERED HARDPAN AT 2 FEET DEEP. CONTINUED TO DIG WITH POWER DIGGER THROUGH ABOUT 0.5 OF HARD CLAY, FOUND NO EVIDENCE OF PRIOR MONUMENTATION. REPLACED 1/2" IRON WITH STANDARD 3/4" X 24" IRON AND ALUMINUM CAP STAMPED "31602". WITNESSED AS DESCRIBED BELOW.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

WITNESSES TO STANDARD 3/4" X 24" IRON AND ALUMINUM CAP STAMPED "31602" IN MONUMENT BOX
FOUND NAIL & TAG #25832 (LARRY BRYAN, P. S.) IN NORTH SIDE OF 10" SPRUCE S48°53'E 56.19'
FOUND NAIL & TAG #25832 IN EAST SIDE OF 4" FENCE POST S24°W 62.62'
FOUND NAIL & TAG #25832 IN SOUTH SIDE OF 24" MAPLE N67°20'W 104.76'
SET NAIL & ORANGE PLASTIC TAG (REYNOLDS 31602) IN SOUTHEAST SIDE OF 10" MAPLE N58°06'E 50.26'
SET NAIL & ORANGE PLASTIC TAG IN EAST SIDE OF 12" WILD CHERRY N03°20'W 22.95'

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/30/2003

STATE OF MICHIGAN
BRIAN REYNOLDS
LAND SURVEYOR
NO. 31602
LICENSED LAND SURVEYOR

Signed by_____ Date NOVEMBER 30, 2003
Surveyor's Michigan License No 31602

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS. JAN. 28, 1971
REVISED MAY 14, 1975 REVISED JANUARY, 1983 REVISED OCTOBER 1995

A. Description of original monument and accessories and/or subsequent restoration: (T1N R1W C-07 CONTINUED)

1. GENERAL LAND OFFICE DEPUTY SURVEYOR HERVEY PARKE, 1826,
   "...80.00 SET POST COR SEC'S 17, 18, 19 & 20 BEECH 26 N2E 20 LYNN 7 S2E 34..."
2. NO CORNER DATA SHOWN ON THE ROAD COMMISSION WITNESS MAP
3. ACT 74 LAND CORNER RECORDATION CERTIFICATE, LIBER 1, PAGE 605, BY FRED N. WHITE,
   P.S. NO. 12034, DATED APRIL 1972 AND FILED JUNE, 1972, PART "A": "ORIGINAL CORNER &
   WITNESSES OBLITERATED" PART "B": "SET CORNER FROM ADJOINING CORNERS AND LINES"
   PART "C" "1/2" IRON ROD IN C/L KINNEVILLE & BLACKMORE RD
   POWER POLE S50°W, 55.09' 6" ASH, N15°E, 31.83' TWIN 18" CHERRY, N50°E, 66.52'
4. ACT 74 LAND CORNER RECORDATION CERTIFICATE LIBER 5, PAGE 57, BY GLENN A. FAUSER,
   P.S. NO. 18657, DATED NOVEMBER 1973,AND FILED OCTOBER 1978
   PART "A" HAS NO INFORMATION ABOUT THE SUBJECT CORNER
   PART "B": "FOUND 1/2" REROD"
   PART "C":1/2" REROD ST. SIGN S.50°W, 41.23' TO CENTER OF POST TELE-BOX S 20°30' W, 54.70'
   TO TOP CENTER, FENCE POST S.20°E. 42.00' TELE-BOX N.04°W, 32.65' TO TOP CENTER
5. DOSSIER FROM INGHAM COUNTY SURVEY AND REMONUMENTATION PROJECT
   TRAVERSE POINT WITNESS REPORT, JANUARY 1978 IS FOR A TRAVERSE POINT 15.20' NORTH OF THE
   CENTERLINE OF KINNEVILLE ROAD AND 4' EAST OF THE CENTERLINE OF BLACKMORE ROAD
   SET NAIL & TAG ON E/SIDE OF 10 IN. ASH N.N.W. 10.25'
   SET NAIL & TAG ON W/SIDE OF 6 IN. ASH E.N.E. 10.92'
   SET NAIL & TAG ON W/SIDE OF 18 IN. TIN CHERRY N.E. 55.19'
6. MONUMENTED CORNER REPORT, APRIL 1978, INDICATES "FD. 1/2" IRON AS REC. BY RLS 12034,
   LIBER 1 PG 605, IN C/L OF INTER. C/L TWIN 18" CHERRY, N50E, 66.52 C/L 6" ASH (CHERRY), N15E, 31.83
   C/L TOP OF BURIED CABLE BOX S40E 53.48...." THE DIAGRAM INDICATES THAT THE
   RECORDED CORNER POSITION IS 6.2' WEST AND 16.0 FEET SOUTH OF THE TRAVERSE POINT,
   AND 17.24 FEET DIRECT MEASURE

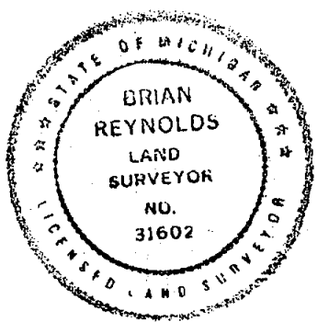

2003-105260
Page: 2 of 2
12/09/2003 08:50A

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in INGHAM (county)	Located In:	Corner Code #
1. Public Land Survey CENTER 1/4 CORNER SECTION 18 LESLIE TOWNSHIP	T 1N R 1W	B-06
	T___ R___	
	T___ R___	
	T___ R___	

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS
OFFICIAL SEAL

L-11 P-117
CRNR 14.00 2003-105264
2003-105264
Page: 1 of 1
12/09/2003 08:50A

Register of Deeds Stamp & File Number

2. Property Controlling in Section S___ T___ R___
S___ T___ R___

3. Miscellaneous S___ T___ R___ _____

4. Lot No_____, Recorded Plat_____
5. Private Claims_____

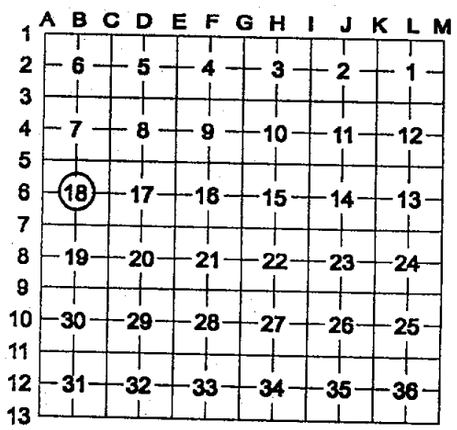

I, Brian Reynolds, in a field survey on JUNE 20 , 2003 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. THE SUBJECT CORNER WAS NOT MONUMENTED BY GENERAL LAND OFFICE SURVEY.
2. SURVEY BY COUNTY SURVEYOR A. JACKSON, VOLUME 2, PAGE 246.
3. A SURVEY OF THE ENTIRETY OF SECTIONS 17 AND 18 BY COUNTY SURVEYOR A. P. DRAKE, DATED MARCH 19TH – 25TH, 1878, RECORDED APRIL 9TH, 1878, VOLUME 3, PAGE 135. THE SUBJECT CORNER IS REFERENCED AS (UPPER CASE) "O", AND IS AND CROSS-REFERENCED IN THE NOTES AS "STONE BEECH 11 N48 3/4E 13 LKS. Do. 7 N52 1/2W 4 LKS." THE PLAT INDICATES A DISTANCE OF 39.95 CHAINS TO B-5, AND A DISTANCE OF 19.95 1/2 CHAINS TO THE MID-POINT BETWEEN B-6 AND B-7, IMPLYING 39.91 CHAINS FROM THE SUBJECT B-6 TO B-7. THE PLAT ALSO SHOWS A CUMULATIVE DISTANCE OF 19.92 CHAINS TO THE MID-POINT BETWEEN B-6 AND A-6, WITH A NOTATION OF THE DISTANCE FROM THAT MID-POINT WEST TO A-6 AS "20.03 CH. BY MR. JACKSON."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

AT THE APPARENT CORNER LOCATION, FOUND A CORNER FENCE POST LEANING HEAVILY TO THE NORTHWEST, OLD FENCES WEST AND NORTH IN DISREPAIR. DUG AROUND THE BASE OF THE FENCE POST, DID NOT FIND STONE RECITED BY DRAKE. TRAVERSED ENTIRE SECTION 18, TYING IN EXISTING MONUMENTATION AND OCCUPATION. COMPUTED THE THEORETICAL CORNER POSITION AT INTERSECTION OF 1/4 LINES, APPROXIMATELY 6 FEET EAST OF FOUND FENCE POST. RETURNED, DUG AT COMPUTED POSITION, FOUND NO FURTHER EVIDENCE. SET A REMONUMENTATION IRON AND ALUMINUM CAP #31602 6'± EAST OF OLD FENCE POST AND 8'± WEST OF CENTERLINE OF POWER LINE.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

WITNESSES TO STANDARD REMON IRON (3/4" X 24" FORM PIN) AND ALUMINUM CAP STAMPED "31602"
SET NAIL AND TAG #31602 IN THE SOUTH SIDE OF A FENCE POST. NAZ 279° AT 5.42'
SET NAIL AND TAG #31602 IN THE EAST SIDE OF A POWER POLE. NAZ 10° AT 48.50'
SET NAIL AND TAG #31602 IN THE WEST SIDE OF A POWER POLE. NAZ 178° AT 273.14'
B-05 IS N00°17'54"W 2648.30'
B-07 IS S00°17'54"E 2645.38'
A-06 IS S89°55'14"W 2652.18'
C-06 IS N89°55'14"E 2655.27'

STATE OF MICHIGAN
BRIAN REYNOLDS
LAND SURVEYOR
NO. 31602
LICENSED LAND SURVEYOR

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/30/2003

Signed by _____ Date NOVEMBER 30, 2003

Surveyor's Michigan License No 31602

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS. JAN. 28, 1971
REVISED MAY 14, 1975 REVISED JANUARY, 1983 REVISED OCTOBER 1995

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in INGHAM (county)	Located In:	Corner Code #
1. Public Land Survey 1/4 CORNER COMMON TO SECTIONS 7 & 18 LESLIE TOWNSHIP	T 1N R 1W T____ R____ T____ R____ T____ R____	B-05
2. Property Controlling in Section	S___ T___ R___ S___ T___ R___	
3. Miscellaneous	S___ T___ R___	

Paula Johnson-
INGHAM COUNTY
REGISTER OF DEEDS
OFFICIAL SEAL

L-12 P-85
CRNR 17.00 2005-034013

2005-034013
Page: 1 of 2
06/29/2005 08:55P

Register of Deeds Stamp & File Number

4. Lot No_____, Recorded Plat_____
5. Private Claims_____

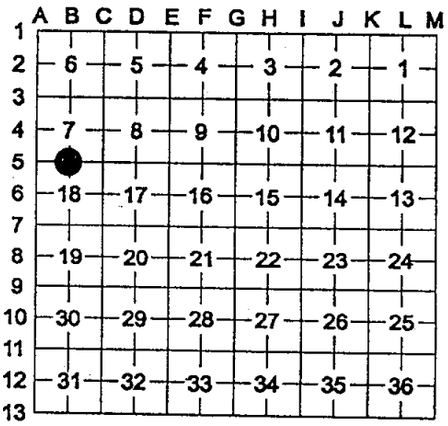

I, Brian Reynolds, in a field survey on March 9, 2005 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

SEE PAGE TWO FOR HISTORICAL SUMMARY

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND CONCRETE MONUMENT IN MONUMENT BOX IN THE CENTERLINE OF EAST – WEST BITUMINOUS ROAD. ACCEPTED FOUND MONUMENT AS PROPER PERPETUATION OF CORNER POSITION, BASED ON PREVIOUS EXCAVATION AND DOCUMENTATION BY SURVEYOR LESTER. LEFT CONCRETE MONUMENT IN PLACE, PLACED STANDARD ALUMINUM CAP ON CONCRETE MONUMENT AND WITNESSED AS DESCRIBED BELOW.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

WITNESSES TO CONC. MON. IN MONUMENT BOX WITH ALUMINUM INGHAM COUNTY CAP STAMPED "31602"
FD NAIL & "KEBS" TAG (KYES ENGINEERING – BRYAN SURVEYING) IN N. SIDE OF 40" MAPLE NAZ 112° 66.38'
FD NAIL & "KEBS" TAG IN EAST SIDE OF A UTILITY POLE NAZ 170° 47.18'
FD NAIL & "KEBS" TAG IN NORTH SIDE OF A 36" MAPLE NAZ 246° 57.88'
FD NAIL & TAG No. 18998 IN NORTHEAST SIDE OF A 14" PINE NAZ 332° 44.74'
FD NAIL & TAG No. 18998 IN NORTH SIDE OF A 36" MAPLE NAZ 105° 92.10'
SET NAIL AND TAG No. 31602 IN THE WEST SIDE OF UTILITY POLE NAZ 3° 288.40'
TO A-05 2651.37' TO C-05 2655.21' TO B-06 2648.30'

BRIAN REYNOLDS LAND SURVEYOR NO. 31602 LICENSED LAND SURVEYOR

P.A. 345 INGHAM COUNTY
PEER APPROVED 4/19/2005 M

Signed by_____ Date May 23, 2005

Surveyor's Michigan License No 31602

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS. JAN. 28, 1971
REVISED MAY 14, 1975 REVISED JANUARY, 1983 REVISED OCTOBER 1995

A. Description of original monument and accessories and/or subsequent restoration: **T1N R1W B-05 CONTINUED**
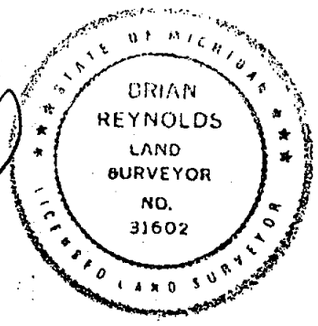
1. GENERAL LAND OFFICE DEPUTY SURVEYOR HERVEY PARKE, 1826,
   "W. OAK 28 S33W 9 BEECH 6 N27E 3 1/2"
2. ROAD COMMISSION WITNESS MAP, "1" BOLT ANCHOR POST N 27.3' ANCHOR POST S 29.4'
3. A TRANSCRIPTION OF A SURVEY BY COUNTY SURVEYOR A. P. DRAKE FROM THE CORNER DOSSIER FILE, c. 1978, ATTRIBUTED TO VOL.3, P.135, THE TEXT IS QUOTED THUS: "SURVEY OF SECTIONS SEVENTEEN AND EIGHTEEN IN TOWNSHIP No. ONE NORTH OF RANGE No. ONE WEST AS REPRESENTED BY THE ACCOMPANYING PLAT (THE SCALE OF WHICH IS THIRTEEN CHAINS TO ONE INCH) BY WHICH THE NAMES OF THE OWNERS, THE BEARINGS AND LENGTHS OF THE LINES AS MEASURED. THE POSITIONS OF THE HIGHWAYS (SHOWN BY THE RED LINES) AND LETTERS OF REFERENCE TO LINE AND CORNERS ARE RESPECTIVELY GIVEN."
4. COUNTY SURVEYOR W. A. ROWE, OCTOBER 1899, VOLUME 5 PAGE 1, "BLUE STONE SET FROM OLD WITNESSES WHITE OAK 15 IN. N52°W 58 1/2 LKS AND MAPLE 4 IN. SOUTH 32 1/2 LKS" PLAT INDICATES 40.26 CHAINS TO C-05, 40.18 CHAINS TO A-05, 40.09 CHAINS TO B-04. THE NARRATIVE FROM THIS SAME SURVEY IN THE SMALL FIELD BOOK, PAGES 102-103 READS, IN PERTINENT PART, "COM AT S 1/4 POST, SEC 7 O. P. F. & O. W. LONG BLUE STONE SET F/W W. OAK 15 N52°W 59 L. & MAP. 4 SOUTH 33 L."
5. LAND CORNER RECORDATION CERTIFICATE LIBER 5, PAGE 48 BY RONNIE M. LESTER, P.S. NO. 18998, COUNTERSIGNED AND SEALED BY GARY D. LESTER, P.S. No. 17624, DATED NOVEMBER 19, 1978 AS PART OF THE INGHAM COUNTY SURVEY AND REMONUMENTATION PROJECT. PART A: "B-5 POST SET IN ORIGINAL GOVERNMENT SURVEY BY HARVEY (sic) PARKE DATED MARCH 21, 1826. CORNER IDENTIFIED AS A STONE IN A SURVEY BY A. P. DRAKE, COUNTY SURVEYOR, MARCH 19, 1878, (v.3, p.135). BLUE STONE IN A LAND SURVEY BY W. A. ROWE, COUNTY SURVEYOR, IN A SURVEY OCTOBER 16 & 30, 1899. CORNER IDENTIFIED AS 1" BOLT, NO DATE GIVEN BY Wm. BARRYMAN, COUNTY SURVEYOR. CORNER IDENTIFIED AS 1" BOLT BY INGHAM COUNTY ROAD COMMISSION IN REVISED GRID MAP, JAN. 1, 1969."
   PART B: "EXCAVATED HOLE 10' X 12' TO AN AVERAGE DEPTH OF 3.0' ON CENTERLINE OF COVERT ROAD AND FENCE LINE TO THE NORTH AND SOUTH. FOUND A 1/2" BOLT SPIKE IN SURFACE OF ROAD, +2' NORTH OF CENTERLINE OF COVERT ROAD AND ON FENCE LINE TO NORTH AND SOUTH. FOUND A 1" X 15" IRON BOLT ON THE CENTERLINE OF COVERT ROAD AND ±0.50' WEST OF FENCE LINE TO NORTH AND SOUTH. MEASURED EAST TO C-5 +2655' AND WEST TO A-5 ± 2650' IN CLOSE ACCORD WITH G.L.O. FIGURES. ACCEPTED 1" X 15" IRON AS CORNER DESCRIBED BY Wm. BARRYMAN AND INGHAM COUNTY ROAD COMMISSION NOTER ABOVE. EXCAVATION CONDUCTED BY INGHAM CO. SURVEY AND REMONUMENTATION PROJECT CREW."
   PART C: " S1/4 CORNER, SECTION 7, T1N-R1W SET 4" X 36" CONCRETE MONUMENT WITH 1/2" X 38" REROD, CAP #18998, WITH CONCRETE COLLAR AND COVER AT LOCATION OF 1" X 15" BOLT DESCRIBED ABOVE:
   NAIL AND TAG, #18998, NORTH SIDE 15" MAPLE, WSW, 57.92'
   NAIL AND TAG, #18998, NORTH SIDE 38" MAPLE, SE, 66.98'
   NAIL AND TAG, #18998, NORTHEAST SIDE 8" PINE, NNW, 44.48'
   NAIL AND TAG, #18998, NORTH SIDE 22" MAPLE, SE, 92.13' "