950003845 Liber8 Page541

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM (County)

VEVAY TOWNSHIP

Located In: Corner Code ##

1. Public Land Survey — T 2N R 1W — K-10
2. Property Controlling in Section — S ____ T ____ R ____
3. Miscellaneous Property in Sec. — S ____ T ____ R ____
4. Lot No. ____ , Recorded Plat ____
5. Private Claims ____

STATE OF MICHIGAN
RONALD L. ENGER
LAND SURVEYOR
NO. 28409
LICENSED LAND SURVEYOR

FILED
11/28/1995 09:37:01
REGISTER OF DEEDS
PAULA JOHNSON
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

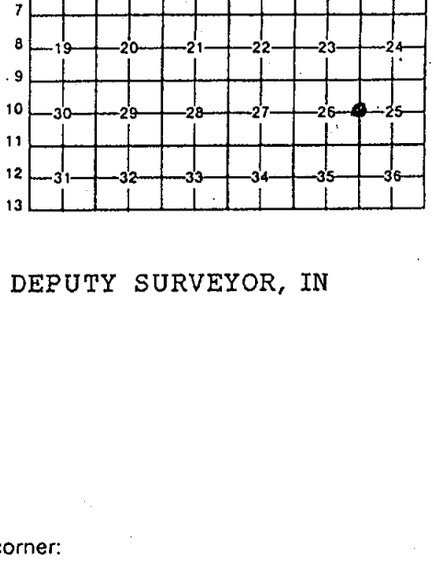

I, RONALD L. ENGER in a field survey on OCTOBER 18, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. POST SET IN ORIGINAL GOVERNMENT SURVEY BY HERVEY PARKE, DEPUTY SURVEYOR, IN FEBRUARY 1826 AND TWO BEARING TREES RECORDED:
W. OAK 20" S53W 15 LKS
W. OAK 18" S88E 23 LKS

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED AT APPARENT LOCATION OF CORNER AND FOUND 1/2" BAR AND CAP #17640 AT SOUTHWEST SIDE FENCE CORNER FOR 10' HIGH DEER YARD FENCE WITH OLD ANCHOR POST LAYING 10' TO SOUTHEAST. EXCAVATED AROUND POST ON THREE SIDES AND FOUND ONLY ORDINARY FENCE POST STONES. ACCEPTED BAR AND CAP AS PERPETUATION OF CORNER AND SET STANDARD MARKER FOR PA 345 REMONUMENTATION IN INGHAM COUNTY IN ITS PLACE.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-10 T2N R1W
3/4" DIAMETER X 24" LONG SMOOTH STEEL BAR AND CAP IMPRINTED "PA 345 PS 28409" AT SOUTHWEST SIDE FENCE POST
NAIL AND TAG 18998 IN WEST SIDE OF 15" OAK, 25° NAZ., 13.60'
NAIL AND TAG 18998 IN WEST SIDE OF 19" RED OAK, 156° NAZ., 33.85'
NAIL AND TAG 18998 IN WEST SIDE OF 17" WHITE OAK, 188° NAZ., 9.60'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN SOUTH SIDE OF 15" WHITE OAK, 250° NAZ., 22.75'
NAIL AND TAG 17640 IN EAST SIDE OF 16" WHITE OAK, 332° NAZ., 37.30'

Signed by Ronald L Enger Date NOVEMBER 2, 1995

Surveyor's Michigan License No. 28409

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/21/95 mc

K-10 T2N R1W
PART A CONTINUED

2. A. P. DRAKE, COUNTY SURVEYOR, USED CORNER IN DECEMBER 1882 IN SURVEY RECORDED IN VOLUME 3, PAGE 191 WITH THE FOLLOWING WITNESSES:
POST
W. O. 18" S88E 23

3. E. A CALKINS, COUNTY SURVEYOR, USED CORNER IN JUNE 1902 IN SURVEY RECORDED IN VOLUME 5, PAGE 30 WITH THE FOLLOWING WITNESSES:
OLD POST AND STUMP OF OLD BEARING
W. OAK 5" N3W 8-1/2 LKS (5.6')

4. G. YOUNG, PS 17640, USED CORNER IN AN ACT 132 SURVEY IN JULY 1985 RECORDED IN LIBER 4, PAGE 1113 AS A SET 1/2" IRON AND CAP IN CENTER OF ANCHOR POST WITH THE FOLLOWING WITNESSES:
NAIL AND TAG SOUTH SIDE 12" OAK SW 23.20'
NAIL AND TAG WEST SIDE 12" OAK S 9.75'
NAIL AND TAG WEST SIDE 6" POPLAR SE 19.85'
NAIL AND TAG WEST SIDE 10" OAK NE 13.70'

5. M. MAHIEU, PS 28414, RECORDED CORNER IN LIBER 7, PAGE 135 IN JULY 1989 AND USED IN AN ACT 132 SURVEY RECORDED IN LIBER 6, PAGE 114 IN FEBRUARY 1990 AS A FOUND 1/2" IRON ROD AS RECORDED IN LIBER 4, PAGE 1113 WITH THE FOLLOWING WITNESSES:
NAIL AND TAG WEST SIDE 24" OAK S10°W 10.08'
NAIL AND TAG SOUTHWEST SIDE 18" POPLAR S45E 20.12'
NAIL AND TAG NORTH SIDE 18" OAK N10E 13.52'
NAIL AND TAG EAST SIDE 24" OAK N20W 37.30'

6. R.LESTER, PS 18998, USED CORNER IN AN ACT 132 SURVEY IN FEB. 1990 RECORDED IN LIBER 6 PAGE 114 AS A FOUND 1/2" BAR & CAP # 17640
NAIL & TAG EAST SIDE 24" OAK, 332° AZ., 37.30'
NAIL & TAG WEST SIDE 15" OAK, 193° AZ., 10.1'
NAIL & TAG WEST SIDE 12" OAK, 22° AZ., 13.5'
NAIL & TAG WEST SIDE 24" OAK, 156° AZ., 34.0'

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM (County)

VEVAY TOWNSHIP

Located In: Corner Code ##

1. Public Land Survey T 2N R 1W K-11
   T ____ R ____
   T ____ R ____
   T ____ R ____
2. Property Controlling S ____ T ____ R ____
   in Section S ____ T ____ R ____
3. Miscellaneous S ____ T ____ R ____
   Property in Sec. S ____ T ____ R ____
4. Lot No. ____ , Recorded Plat ____
5. Private Claims ____

STATE OF MICHIGAN
RONALD L. ENGER
LAND SURVEYOR
NO. 28409
LICENSED LAND SURVEYOR

FILED
11/28/1995 09:37:02
REGISTER OF DEEDS
PAULA JOHNSON
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

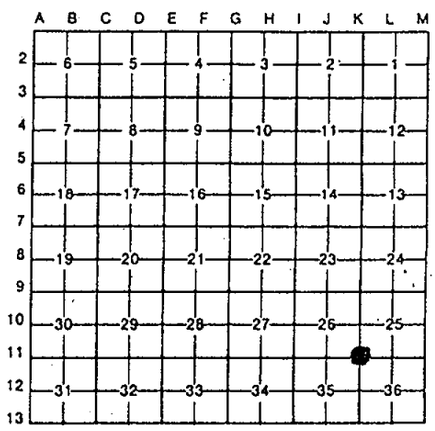

I, RONALD L. ENGER in a field survey on OCTOBER 11, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. POST SET IN ORIGINAL GOVERNMENT SURVEY BY HERVEY PARKE, DEPUTY SURVEYOR, IN FEBRUARY 1826 AND TWO BEARING TREES RECORDED:
W. OAK 12" S6W 28 LKS
MAPLE 7" N7W 28 LKS

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED AT APPARENT LOCATION OF CORNER AND FOUND 1/2" BAR AND CAP #3276 IN MONUMENT BOX 2' SOUTH OF CENTERLINE OF BARNES ROAD ON FENCE LINES NORTH AND SOUTH. PULLED IRON AND EXCAVATED BOTTOM OF BOX WITH POST HOLE DIGGERS. EXCAVATED INTO NATURAL GROUND AND FOUND NOTHING MORE. AS CORNER IS IN A 10' CUT AREA OF ROAD CHANCES OF FINDING ANY HISTORICAL EVIDENCE ARE NON EXISTENT. ACCEPTED BAR AND CAP AS PERPETUATION OF CORNER AND REPLACED IT WITH STANDARD BAR AND CAP FOR REMONUMENTATION IN INGHAM COUNTY.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-11 T2N R1W
3/4" DIAMETER X 24" LONG SMOOTH STEEL BAR AND CAP IMPRINTED "PA 345 PS 28409" IN MONUMENT BOX.
NAIL AND TAG(NO TEXT) IN SOUTH SIDE OF 40" MAPLE, 87° NAZ., 278.65'
NAIL AND TAG #25832 IN SOUTH SIDE OF 6" POPLAR, 75° NAZ., 88.30'
NAIL AND TAG #28414 IN SOUTHEAST SIDE OF 4" POPLAR, 37° NAZ., 31.35'
NAIL AND TAG #18998 IN EAST SIDE OF UTILITY POLE, 202° NAZ., 32.32'
NAIL AND TAG #28414 IN SOUTH SIDE OF 10" ELM, 240° NAZ., 50.50'

Signed by Ronald L Enger Date NOVEMBER 2, 1995

Surveyor's Michigan License No. 28409

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/21/95 M

K-11 T2N R1W
PART A CONTINUED

2. A. JACKSON, COUNTY SURVEYOR, USED CORNER IN NOVEMBER 1866 RECORDED IN VOLUME 2, PAGE 303 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-1.

3. A. P. DRAKE USED CORNER IN DECEMBER 1882 RECORDED IN VOLUME 3, PAGE 191 OF COUNTY SURVEY RECORDS WITH NO MENTION OF MONUMENT OR WITNESSES.

4. THE PRIVATE RECORDS(DATE UNKNOWN) OF LAVERNE HENDRYX LS #3276 (NOW IN THE POSSESSION OF ACCOLADE SURVEYING) CALL FOR CORNER AS A SET #4 BAR FROM PAST SURVEYS.

5. F. WHITE, PS #12034, RECORDED CORNER IN MARCH 1977 IN LIBER 4 OF CORNERS, PAGE 6 AS A FOUND IRON AND CAP #3276 2' SOUTH OF CENTERLINE PAVEMENT WITH THE FOLLOWING WITNESSES:
NAIL AND TAG 36" OAK N83E 278.65'
IRON AND CAP #3276 SOUTH 33.00'

6. GEORGE YOUNG, PS #17640, USED CORNER IN AN ACT 132 SURVEY IN JULY 1985 RECORDED IN LIBER 4, PAGE 1113 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-4.

7. R. LESTER, PS 18998, USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 6 PAGE 114 AS A BAR & CAP IN MONUMENT BOX
FOUND BAR & CAP #17640, 05° AZ, 33.0'
FOUND BAR & CAP #3276, 185° AZ, 32.8'
SET NAIL & TAG IN E. SIDE UTIL. POLE, 203° AZ, 32.4'
SET NAIL & TAG IN S. SIDE 20" BUTTERNUT, 88° AZ 247.6'

7. R. HELSEL, PS 18994, USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 7, PAGE 388 IN JUNE 1994 AS A FOUND BAR AND CAP #3276 IN MONUMENT BOX WITH THE FOLLOWING WITNESSES:
NAIL AND TAG 28414 EAST SIDE 4" POPLAR N35°E 31.41'
NAIL AND TAG 28414 NORTH SIDE 12" ELM S55°W 50.54'
NAIL AND TAG 18998 EAST SIDE UTILITY POLE S15°W 32.18'
NAIL AND TAG 25832 SOUTH SIDE 10" POPLAR N65°E 88.24'

950003849 Liber8 Page549

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
INGHAM (County)
VEVAY TOWNSHIP

Located In: Corner Code ##

1. Public Land Survey — T 2N R 1W — L-9
2. Property Controlling — S ___ T ___ R ___
   in Section — S ___ T ___ R ___
3. Miscellaneous — S ___ T ___ R ___
   Property in Sec. — S ___ T ___ R ___
4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

STATE OF MICHIGAN
RONALD L. ENGER
LAND SURVEYOR
NO. 28409
LICENSED LAND SURVEYOR

FILED
11/28/1995 09:37:07
REGISTER OF DEEDS
PAULA JOHNSON
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

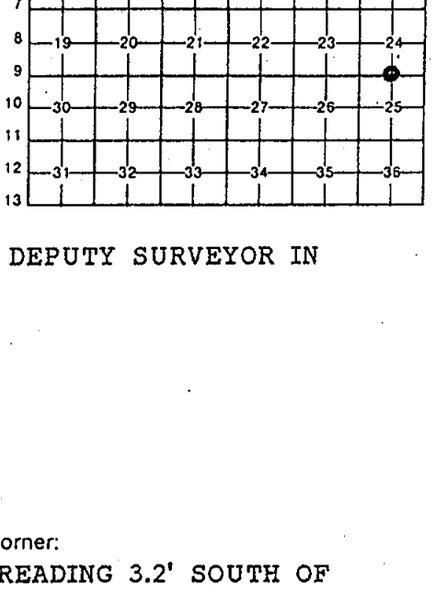

I, RONALD L. ENGER, in a field survey on OCTOBER 18, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. POST SET IN ORIGINAL GOVERNMENT SURVEY BY HERVEY PARKE, DEPUTY SURVEYOR IN FEBRUARY, 1826 AND TWO BEARING TREES RECORDED:
W. OAK 24" N59E 27 LKS
B. ASH 14" S67W 22-1/2 LKS

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED AT APPARENT LOCATION OF CORNER AND GOT MAGNETIC READING 3.2' SOUTH OF CENTERLINE OF ROLFE ROAD ON FENCE LINES NORTH AND SOUTH. EXCAVATED 1.5' X 1' HOLE AROUND READING AND FOUND WHAT WE INITIALLY THOUGHT WAS A BOAT SPIKE BUT TURNED OUT TO BE A 1/2" REBAR, 8" LONG. EXPANDED HOLE TO 3' X 3' X 4' DEEP. DID NOT GET THROUGH ROAD FILL AND FOUND NO OTHER EVIDENCE OF CORNER. ACCEPTED 1/2" BAR AS PERPETUATION OF CORNER AND SET STANDARD MARKER FOR PA 345 REMONUMENTATION IN INGHAM COUNTY IN ITS PLACE.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-9 T2N R1W
3/4" SMOOTH STEEL BAR AND CAP IMPRINTED "PA 345 PS 28409" IN MONUMENT BOX 3' SOUTH OF CENTERLINE OF ROLFE ROAD .
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN WEST SIDE OF 15" OAK, 330° NAZ., 81.35'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN WEST SIDE OF 22" OAK, 4° NAZ., 46.75'
NAIL AND TAG #21565 IN SOUTH SIDE OF 39" OAK, 68° NAZ., 72.78'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN WEST SIDE OF 33" WILLOW, 176° NAZ., 37.45'
1/2" BAR AND CAP #3276, 4° NAZ., 33.00'
1/2" BAR AND CAP #21565, 184° NAZ., 33.00'

Signed by Ronald L Enger — Date NOVEMBER 1, 1995

Surveyor's Michigan License No. 28409

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/21/95 M

L-9 T2N R1W
PART A CONTINUED

2. ANSON JACKSON, COUNTY SURVEYOR, USED CORNER IN JULY 1839 RECORDED IN VOLUME 1, PAGE 36 WITH THE FOLLOWING WITNESSES:
BEECH 24" N59E 27 LKS
ASH 14" S67W 22-1/2 LKS

3. A. P. DRAKE, COUNTY SURVEYOR, USED CORNER IN DECEMBER 1882 RECORDED IN VOLUME 3, PAGE 191 AS A POST WITH THE FOLLOWING WITNESS:
W.O. 20" S1/4E 2 LKS.

4. THE PRIVATE RECORDS OF LAVERNE HENDRYX, NOW IN THE POSSESSION OF ACCOLADE SURVEYING, CALL FOR THE CORNER AS A #4 BAR IN AN UNRECORDED SURVEY DATED DEC. 6, 1975.
15" SWAMP OAK NNW 46.75'
28" SWAMP OAK ENE 73.35'
18" WILLOW SSE 37.6'
#4 IRON N. 33.0'

5. M. DYER, PS #21565 RECORDED CORNER IN JANUARY 1976 IN LIBER 3 OF CORNERS, PAGE 516, AS A FOUND 1/2" BOAT SPIKE 3.2' SOUTH OF CENTERLINE OF ROLFE ROAD ON FENCE LINE NORTH-SOUTH WITH THE FOLLOWING WITNESSES:
1/2" BAR AND CAP #3276 NORTH 33.00'
NAIL AND TAG EAST SIDE OF 15" OAK, NORTH 46.84'
NAIL AND TAG WEST SIDE OF 18" WILLOW, SOUTH 37.68'
NAIL AND TAG SOUTH SIDE OF 24" OAK, ENE 72.89'

6. M. DYER USED CORNER IN JANUARY 1976 IN A SURVEY RECORDED IN LIBER 2 OF SURVEYS, PAGE 604, WITH THE SAME MONUMENTS AND WITNESSES AS PART A-4.

7. G. YOUNG, PS #17640, USED CORNER IN MAY 1976 IN A SURVEY RECORDED IN LIBER 2 OF SURVEYS, PAGE 714, WITH THE FOLLOWING WITNESSES:
BOAT SPIKE
N & W IN 24" OAK, N45E, 72.87', (FOUND OCTOBER 1995)
N & W IN 15" OAK, NORTH 46.80', (FOUND OCTOBER 1995)
N & W IN 15" OAK(ACTUALLY A WILLOW), S05°E, 37.68', (FOUND OCTOBER 1995)

8. R. LESTER, PS 18998, USED CORNER IN NOVEMBER AND DECEMBER 1977 IN A SURVEY RECORDED IN LIBER 3 OF SURVEYS, PAGES 196 AND 284, WITH THE SAME MONUMENTS AND WITNESSES AS IN PART A-4.

9. A. WILLIAMS, PS 21275 USED CORNER IN JANUARY 1985 AND RECORDED IN LIBER 4 OF SURVEYS, PAGE 1010 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-6.

10. G. YOUNG USED CORNER IN JULY 1989 AND RECORDED IN LIBER 5 OF SURVEYS, PAGE 1088 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-6.

11. M. MAHIEU, PS #28414 USED CORNER IN NOVEMBER 1990 AND RECORDED IN LIBER 7 OF CORNERS, PAGE 203 WITH THE FOLLOWING WITNESSES:
1/4" BOAT SPIKE
NAIL AND TAG NORTH SIDE OF U.P., S80E, 136.92', FOUND OCTOBER 1995
NAIL AND TAG SOUTH SIDE OF 32" OAK, N60E, 72.74', FOUND OCTOBER 1995
NAIL AND TAG EAST SIDE OF 8" ELM N10E, 37.76'
NAIL AND TAG, NORTHEAST SIDE OF 6" B.E., N55W, 49.15'

12. M. MAHIEU USED CORNER IN AUGUST 1991 AND RECORDED IN LIBER 6 OF SURVEYS, PAGE 745 WITH THE SAME MONUMENT AND WITNESSES AS PART A-7.

950005171 Liber8 Page588

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM (County)
VEVAY TOWNSHIP

	Located In:	Corner Code ##
1. Public Land Survey	T 2N R 1W	L-11
	T ____ R ____	
	T ____ R ____	
	T ____ R ____	
2. Property Controlling	S ____ T ____ R ____	
in Section	S ____ T ____ R ____	
3. Miscellaneous	S ____ T ____ R ____	
Property in Sec.	S ____ T ____ R ____	

STATE OF MICHIGAN
RONALD L. ENGER
LAND SURVEYOR
NO. 28409
LICENSED LAND SURVEYOR

FILED
12/06/1995 08:38:34
REGISTER OF DEEDS
PAULA JOHNSON
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, RONALD L. ENGER, in a field survey on OCTOBER 16, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. POST SET IN ORIGINAL GOVERNMENT SURVEY BY HERVEY PARKE, DEPUTY SURVEYOR IN FEBRUARY 1826 AND TWO BEARING TREES RECORDED:
ELM 11" S79E 225-1/2 LKS
ASPEN 6" N81E 221 LKS

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED AT APPARENT LOCATION OF CORNER AND FOUND 1/2" BAR 1.5' NORTH OF CENTERLINE OF BARNES ROAD ON FENCELINE NORTH AND SOUTH. EXCAVATED 2' X 2' HOLE 2' DEEP AND FOUND POINTED STONE IN HOLE IN SECOND BITUMINOUS SURFACE 0.85 SOUTHWEST OF 1/2" BAR. ACCEPTED STONE AS PERPETUATION OF CORNER AND SET STANDARD MARKER FOR PA 345 REMONUMENTATION IN INGHAM COUNTY ON TOP OF IT AND SET MONUMENT BOX. AFTER REFLECTING ON THE SITUATION AND CONSULTATION WITH PEER GROUP AND MAYNARD DYER DECIDED THAT 1/2" BAR WAS IN CLOSE ENOUGH PROXIMITY TO STONE TO ACCEPT AS OCCUPYING PERPETUATED LOCATION OF CORNER. MOVED STANDARD MONUMENT AND MONUMENT BOX TO LOCATION OF 1/2" BAR.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-11 T2N R1W
3/4" DIAMETER X 24" LONG SMOOTH STEEL BAR AND CAP IMPRINTED "PA 345 PA 28409" IN MONUMENT BOX 1.0' NORTH OF CENTERLINE OF BARNES ROAD ON FENCELINE NORTH AND SOUTH.
NAIL AND TAG 18998 IN TOP OF CORNER FENCE POST 3° NAZ., 36.14'
NAIL AND TAG 18998 IN TOP OF FENCE POST 13° NAZ., 36.17'
NAIL AND TAG 18998 IN TOP OF RAILROAD TIE FENCE POST 180° NAZ., 40.52'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN WEST SIDE OF 17" OAK, 156° NAZ., 79.93'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN WEST SIDE OF 9" OAK, 169° NAZ., 80.98'

Signed by Ronald L Enger 28409 Date DECEMBER 5, 1995

Surveyor's Michigan License No. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/21/95 M

L-11 T2N R1W
PART A CONTINUED

2. A. JACKSON, COUNTY SURVEYOR, USED CORNER IN NOVEMBER 1866 RECORDED IN VOLUME 2, PAGE 303 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-1.

3. A. P. DRAKE, COUNTY SURVEYOR, USED CORNER IN OCTOBER 1882 RECORDED IN VOLUME 3, PAGE 191 OF COUNTY SURVEY RECORDS AS POST IN CENTER OF HIGHWAY.

4. E. A. CALKINS, COUNTY SURVEYOR, USED CORNER IN DECEMBER 1899 IN A SURVEY RECORDED IN VOLUME 5, PAGE 6 WITH THE FOLLOWING WITNESSES:
POST IN SECTION OF TILE SURROUNDED BY STONE AND CROCKERY
ELM 5" S44°E 58 (38.3')
ELM 8" N52-1/2W 62 (40.9')

5. MAYNARD DYER, PS 21565, RECORDED CORNER IN JANUARY 1976 IN LIBER 3, PAGE 517 AND USED IN AN ACT 132 SURVEY IN DECEMBER 1975 RECORDED IN LIBER 2, PAGE 606 AS SET 1/2" BAR AND CAP 2' NORTH OF CENTERLINE OF BARNES ROAD ON FENCE LINE NORTH AND SOUTH WITH THE FOLLOWING WITNESSES:
NAIL AND TAG IN NORTH SIDE 15" OAK S80°E 246.90'
NAIL AND TAG IN EAST SIDE OF 18" OAK S15°E 79.64'

6. R. LESTER, PS 18998, USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 6, PAGE 708 IN APRIL 1991 AS A 1/2" BAR WITH THE FOLLOWING WITNESSES:
NAIL AND TAG IN TOP OF RAILROAD TIE FENCE POST 181° NAZ., 40.5'
NAIL AND TAG IN TOP OF RAILROAD TIE FENCE POST 113° NAZ., 117.2'
NAIL AND TAG IN TOP OF FENCE POST 3° NAZ., 36.1'
NAIL AND TAG IN TOP OF FENCE POST 13° NAZ., 36.1'

7. R. HELSEL, PS 18994, USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 7, PAGE 388 IN JUNE 1994 AS A FOUND 1/2" BAR WITH THE FOLLOWING WITNESSES:
NAIL AND TAG #18998 TOP WOOD FENCE POST NORTH 36.21'
NAIL AND TAG #18998 TOP WOOD FENCE POST N10°E 36.11'
NAIL AND TAG #18998 RAILROAD TIE FENCE POST S03°E 40.49'
NAIL AND TAG #18998 NORTH SIDE 12" POPLAR S75°E 79.15'

950003852 Liber8 Page555

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM (County) Located In:

VEVAY TOWNSHIP

		Corner Code ##
1. Public Land Survey	T 2N R 1W	M-9
	T ___ R ___	
	T ___ R ___	
	T ___ R ___	
2. Property Controlling	S ___ T ___ R ___	
in Section	S ___ T ___ R ___	
3. Miscellaneous	S ___ T ___ R ___	
Property in Sec.	S ___ T ___ R ___	

FILED
11/28/1995 09:37:11
REGISTER OF DEEDS
PAULA JOHNSON
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

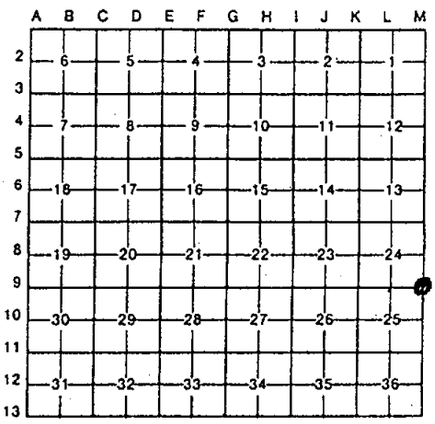

I, RONALD L. ENGER in a field survey on OCTOBER 16, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. POST SET IN ORIGINAL GOVERNMENT SURVEY BY JOSEPH WAMPLER, DEPUTY SURVEYOR ON FEBRUARY 7, 1824 AND TWO BEARING TREES RECORDED:
TAM 11" N45-1/2W 39 LKS
TAM 5" S48W 32 LKS

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED AT APPARENT LOCATION OF CORNER (FOUND APPARENT LOCATION OF CORNER BY FLAGGING EXTENSIONS OF FENCE LINES INTO SWAMP FROM NORTH AND WEST) AND FOUND 1/2" BAR AND CAP #21565 ON EXTENSION OF FENCE LINES. ACCEPTED 1/2" BAR AND CAP AS PERPETUATION OF CORNER BECAUSE OF AGREEMENT WITH ANCIENT OCCUPATION AND SET 36" X 1" GALVANIZED PIPE WITH PA 345 CAP IN ITS PLACE.

STATE OF MICHIGAN
RONALD L. ENGER
LAND SURVEYOR
NO. 28409
LICENSED LAND SURVEYOR

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-9 T2N R1W
1" DIAMETER X 36" LONG GALVANIZED PIPE WITH CAP IMPRINTED "PA 345 PS 28409"
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN WEST SIDE OF 6" MAPLE, 157° NAZ., 18.95'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN WEST SIDE OF 20" MAPLE, 214° NAZ., 37.28'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN NORTH SIDE OF 14" MAPLE, 247° NAZ., 34.66'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN NORTH SIDE OF 21" MAPLE, 306° NAZ., 28.21'

Signed by Ronald L Enger Date NOVEMBER 1, 1995

Surveyor's Michigan License No. 28409

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/21/95 M

M-9 T2N R1W
PART A CONTINUED

2. A. JACKSON, COUNTY SURVEYOR, USED CORNER IN JULY 1839 IN A SURVEY RECORDED IN VOLUME 1, PAGE 36 WITH THE SAME MONUMENTS AND WITNESSES AS IN PART A-1.

3. MAYNARD DYER, PS 21565 RECORDED CORNER IN JANUARY 1976 IN LIBER 3 OF CORNERS, PAGE 516 AND USED CORNER IN SURVEYS IN DECEMBER 1975 RECORDED IN LIBER 2 OF SURVEYS, PAGES 604-606 WITH THE FOLLOWING WITNESSES:
SET 1/2" BAR AND CAP AT INTERSECTION OF FENCES NORTH-SOUTH AND WEST
NAIL AND TAG NORTH SIDE OF 10" BIRCH, EAST-SOUTHEAST, 20.01'
NAIL AND TAG WEST SIDE OF 6" MAPLE, NORTH-NORTHEAST, 18.86'
NAIL AND TAG SOUTH SIDE OF 15" MAPLE, NORTHWEST, 27.92'

4. G. YOUNG, PS 17640 USED CORNER IN A SURVEY IN MAY 1976, RECORDED IN LIBER 2 OF SURVEYS, PAGE 714 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-3.

5. R. LESTER, PS 18998 USED CORNER IN SURVEYS IN NOVEMBER AND DECEMBER 1977 RECORDED IN LIBER 3 OF SURVEYS, PAGES 196 AND 284 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-3.

6. A. WILLIAMS, PS 21275 USED CORNER IN AN ACT 132 SURVEY IN JANUARY 1985, RECORDED IN LIBER 4, PAGE 1010 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-3.

950003853 Liber8 Page557

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM (County)

VEVAY TOWNSHIP

	Located In:	Corner Code =#
1. Public Land Survey	T 2N R 1W	M-10
	T ___ R ___	
	T ___ R ___	
	T ___ R ___	
2. Property Controlling	S ___ T ___ R ___	
in Section	S ___ T ___ R ___	
3. Miscellaneous	S ___ T ___ R ___	
Property in Sec.	S ___ T ___ R ___	

FILED
11/28/1995 09:37:12
REGISTER OF DEEDS
PAULA JOHNSON
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

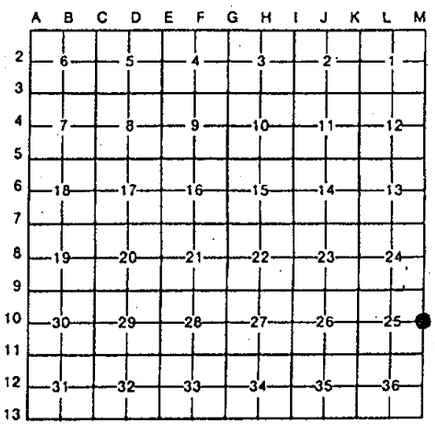

I, RONALD L. ENGER on a field survey on OCTOBER 18, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. POST SET IN ORIGINAL GOVERNMENT SURVEY BY JOSEPH WAMPLER, DEPUTY SURVEYOR ON FEBRUARY 7, 1824 AND TWO BEARING TREES RECORDED:
ASH 16" N35W 23-1/2 LKS
BIRCH 9" S45W 32-1/2 LKS

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED AT APPARENT LOCATION OF CORNER AND FOUND 1/2" BAR AND CAP #21565 IN SWAMP NEXT TO 4" X 4" TREATED WOOD POST. M. DYER'S ELM WITNESS TO EAST IS DEAD. ELM WITNESS TO NORTH IS GONE. FENCE 46' NORTH IS GONE. ACCEPTED 1/2" BAR AND CAP AS PERPETUATION OF CORNER AND REPLACED WITH STANDARD MARKER FOR PA 345 REMONUMENTATION IN INGHAM COUNTY.

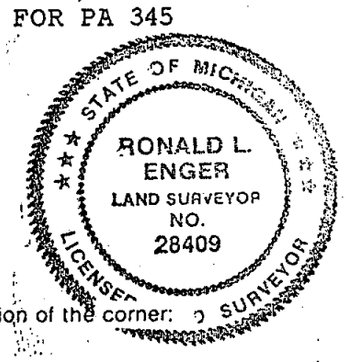

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-10 T2N R1W
3/4" DIAMETER X 24" LONG SMOOTH STEEL BAR AND CAP IMPRINTED "PA 345 PS 28409" 1' WEST OF 4" X 4" TREATED WOOD POST 6' HIGH.
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN WEST SIDE OF 8" CHERRY, 15° NAZ., 48.75'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN SOUTH SIDE OF 16" MAPLE, 316° NAZ., 59.68'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN WEST SIDE OF 4" X 4" TREATED WOOD POST, 05° NAZ., 46.80'
SET 20D GALVANIZED SPIKE AND TAG PS 28409 IN EAST SIDE OF 8" POPLAR, 08° NAZ., 84.21'

Signed by Ronald L Enger Date NOVEMBER 2, 1995

Surveyor's Michigan License No. 28409

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/27/95 M

M-10 T2N R1W
PART A CONTINUED

2. ANSON JACKSON, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOLUME 1, PAGE 48 OF COUNTY SURVEY RECORDS IN FEBRUARY 1843 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-1.

3. MAYNARD DYER, PS 21565, RECORDED CORNER IN LIBER 3 OF CORNERS, PAGE 515 IN JANUARY 1976 AND USED IN SURVEYS RECORDED IN LIBER 2 OF SURVEYS, PAGES 604-606 IN DECEMBER 1975. SET 1/2" BAR AND CAP AT THE INTERSECTION OF THE EAST LINE OF SECTION 25 AND THE EAST-WEST 1/4 LINE AS FOUND MONUMENTED.
NAIL AND TAG SOUTH SIDE OF 8" ELM, EAST 12.83'
NAIL AND TAG EAST SIDE OF 8" ELM, NORTH 37.12'
OLD EAST-WEST FENCE, NORTH 46'
DYER MEASURED SOUTH 1317.31' TO 1/16 CORNER AND SOUTH 2628.40' TO M-11.

4. A. WILLIAMS, PS 21275, USED CORNER IN AN ACT 132 SURVEY IN JANUARY 1985 AND RECORDED IN LIBER 4, PAGE 1010 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-3.

5. M. MAHIEU, PS 28414, USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 5, PAGE 987 IN FEBRUARY 1989 WITH THE SAME MONUMENTS AND WITNESSES AS PART A-3.

950003854 Liber8 Page559

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM (County)

VEVAY TOWNSHIP

Located In: Corner Code =#

1. Public Land Survey T 2N R 1W M-11
   T ____ R ____
   T ____ R ____
   T ____ R ____
2. Property Controlling S ____ T ____ R ____
   in Section S ____ T ____ R ____
3. Miscellaneous S ____ T ____ R ____
   Property in Sec. S ____ T ____ R ____
4. Lot No. ____, Recorded Plat ____
5. Private Claims ____

STATE OF MICHIGAN
RONALD L. ENGER
LAND SURVEYOR
NO. 28409
LICENSED LAND SURVEYOR

FILED
11/28/1995 09:37:14
REGISTER OF DEEDS
PAULA JOHNSON
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

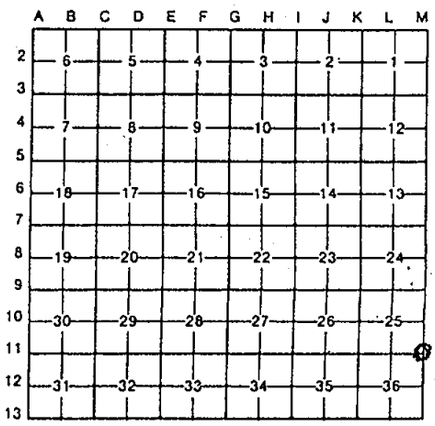

I, RONALD L. ENGER, in a field survey on OCTOBER 18, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. POST SET IN ORIGINAL GOVERNMENT SURVEY BY JOSEPH WAMPLER, DEPUTY SURVEYOR ON FEBRUARY 7, 1884 AND TWO BEARING TREES RECORDED:
ASH 16" S7W 60 LKS
ASH 6" N13W 68 LKS

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED AT APPARENT LOCATION OF CORNER AND FOUND 1/2" BAR AND MUTILATED CAP IN MONUMENT BOX AT CENTERLINE OF INTERSECTION OF BARNES AND KELLY ROADS. PULLED IRON AND EXCAVATED BOTTOM OF BOX WITH POST HOLE DIGGERS. AT DEPTH OF 18" HIT SECOND BITUMINOUS SURFACE WITH STONE STICKING OUT OF IT IN NORTHWEST SIDE OF BOX. ACCEPTED STONE AS PERPETUATION OF CORNER AND SET STANDARD MARKER FOR PA 345 REMONUMENTATION IN INGHAM COUNTY IN PLACE OF 1/2" BAR NEXT TO STONE. ASSUMED THAT BAR WAS CLOSE ENOUGH TO STONE TO ACCEPT IT AS MONUMENT FOR CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-11 T2N R1W
3/4" DIAMETER X 24" LONG SMOOTH STEEL BAR AND CAP IMPRINTED "PA 345 PS 28409" IN MONUMENT BOX ON CENTERLINES OF BARNES AND KELLY ROADS.
NAIL AND TAG #18998 IN WEST SIDE OF 15" TWIN OAK, 140° NAZ., 63.90'
NAIL AND TAG #18994 IN WEST SIDE OF WOOD GUARD POST, 152° NAZ., 47.48'
SET 20D GALVANIZED SPIKE AND TAG #28409 IN EAST SIDE OF 36" OAK, 188° NAZ., 236.71'
PUNCH MARK IN EAST END OF 18" CMP, 10° NAZ., 218.50'
PUNCH MARK IN WEST END OF 18" CMP, 358° NAZ., 219.84'

Signed by Ronald L Enger Date NOVEMBER 2, 1995

Surveyor's Michigan License No. 28409

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/21/95 mc

M-11 T2N R1W
PART A CONTINUED

2. A. P. DRAKE, COUNTY SURVEYOR, USED CORNER IN DECEMBER 1882 IN A SURVEY RECORDED IN VOLUME 3, PAGE 191 WITH THE FOLLOWING WITNESSES:
POST
B. ASH 36" S19W 76 (50.2')
B. ASH 30" N57W 112 (73.9')

3. MAYNARD DYER, PS 21565, RECORDED CORNER IN JANUARY 1976 IN LIBER 4, PAGE 517 AND USED IT IN AN ACT 132 SURVEY IN DECEMBER 1975 RECORDED IN LIBER 2, PAGE 606 AS A SET 1/2" BAR AND CAP AT INTERSECTION OF SECTION LINE ROADS WITH THE FOLLOWING WITNESSES:
BOAT SPIKE IN NORTH SIDE 40" OAK, S60°W 139.53'
NAIL AND TAG NORTH SIDE 18" OAK, S30°W 135.32'
NAIL AND TAG EAST SIDE 6" OAK N30°W 62.87'

4. R. LESTER, PS 18998, USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 6, PAGE 708 IN APRIL 1991 WITH THE FOLLOWING WITNESSES:
1/2" BAR IN MONUMENT BOX
NAIL AND TAG NORTHWEST SIDE 30" OAK STUMP 211° NAZ., 135.2'
NAIL AND TAG NORTH SIDE 40" OAK 241° NAZ., 138.4'
NAIL AND TAG WEST SIDE 15" OAK 140° NAZ., 63.9'
NAIL AND TAG EAST SIDE 15" ASH 353° NAZ., 130.7'

5. R. HELSEL, PS 18994, USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 7, PAGE 378 IN OCTOBER 1994 AS A FOUND 1/2" IRON IN MONUMENT BOX WITH THE FOLLOWING WITNESSES:
NAIL AND TAG 18994 WEST SIDE WOOD POST S30°E 47.55'
NAIL AND TAG 18994 WEST SIDE WOOD POST N60°E 57.66'
NAIL AND TAG 18994 NORTHWEST SIDE RAILROAD TIE POST S20°W 89.49'
NAIL AND TAG 18994 EAST SIDE UTILITY POLE S45°W 97.78'