Paula Johnson-
INGHAM COUNTY
REGISTER OF DEEDS
OFFICIAL SEAL

L[illegible] P-354
CRNR 17.00 2005-016724

2005-016724
Page: 1 of 2
04/01/2005 08:31P

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in VEVAY TOWNSHIP

INGHAM (County)	Located In:	Corner Code #
1. Public Land Survey	T 2N R 1W	E-11
	T___ R___	
	T___ R___	
	T___ R___	
2. Property Controlling	S___ T___ R___	
in Section	S___ T___ R___	
3. Miscellaneous	S___ T___ R___	
Property in Section	S___ T___ R___	

P.A. 345 INGHAM COUNTY
PEER APPROVED 3/22/2005 RL

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____

5. Private Claims _____

I, RON HELSEL , in A field survey on MARCH 16 , 20 05 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by A decree of A Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by A Decree of A Court of Law; established, re-established, monumented, recovered, found as expressed below:

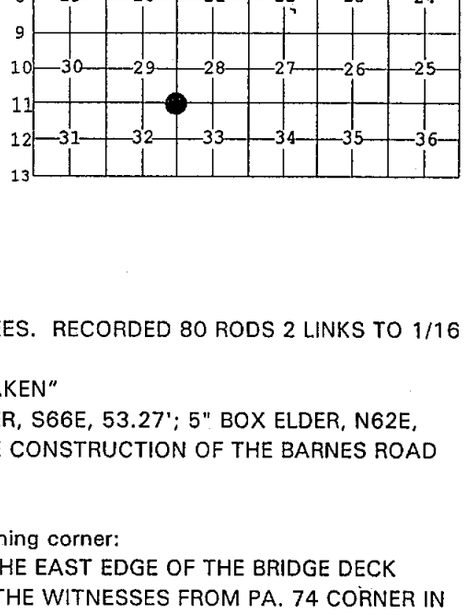

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
ORIGINAL MONUMENT: POST SET BY H. PARKE, US DEPUTY SURVEYOR, MAR., 1826. SET 40 CHAINS. BEECH 12", N44W, 2 LINKS; IRONWOOD 10", N78E, 22-1/2 LINKS. MARGIN NOTE, DATE & SOURCE UNKNOWN, APPLE DOUBLE, S.E. PART 8", N37E, 147-1/2 LINKS.
1) VOL. 1, PAGE 32, DEC. 4, 1840, A. JACKSON C.S.. CITED ORIGINAL BEARING TREES. RECORDED 160 RODS 4 LINKS TO F-11.
2) VOL. 1, PAGE 33, DEC. 5, 1840, A. JACKSON C.S.. CITED ORIGINAL BEARING TREES. RECORDED 80 RODS 2 LINKS TO 1/16 CORNER TO EAST & 79 RODS 24 LINKS TO 1/16 CORNER TO NORTH.
3) VOL. 3, PAGE 70, APRIL 17, 1873, T. J. BROWN C.S.. " A POST, NO BEARINGS TAKEN"
4) NOTHSTINE'S NOTES, DATE UNKNOWN. 3/4" X 1/4" X10" IRON PIN: 6" BOX ELDER, S66E, 53.27'; 5" BOX ELDER, N62E, 79.14'; 18" LOCUST, S28E, 52.60' (I BELIEVE THESE WITNESSES WERE PRIOR TO THE CONSTRUCTION OF THE BARNES ROAD BRIDGE.)

(CONTINUED ON BACK SIDE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND A 5/8" X 24" COPPER WELD ROD IN A MONUMENT BOX 39.2 FEET EAST OF THE EAST EDGE OF THE BRIDGE DECK OVER US 127. FOUND SEVERAL WITNESSES FROM THE P.A. 132 SURVEYS AND ALL THE WITNESSES FROM PA. 74 CORNER IN ITEM 13 ABOVE. AREA IN A ±25 FOOT FILL FOR THE BRIDGE APPROACH RAMP. ACCEPTED THIS POSITION AS THE BEST AVAILABLE FOR THE PERPETUATION OF THE CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
3/4" X 24" FORM PIN AND ALUMINUM DISK STAMPED P.A. 345, P.S. NO. 18994 IN A MONUMENT BOX, IN THE CENTERLINE OF BARNES ROAD 39. 2 FEET EAST OF THE EAST EDGE OF BRIDGE DECK OVER US 127.
FOUND NORTHERLY BOLT OF STEEL GUARD RAIL AT EAST CONCRETE RAIL POST OF BRIDGE, N63°W, 42.68 FEET
FOUND SOUTHERLY BOLT OF STEEL GUARD RAIL AT EAST CONCRETE RAIL POST OF BRIDGE, S70°W, 42.66 FEET
FOUND NAIL & TAG #30090, EAST/SIDE 6" X 10" WOOD RAIL POST, N35°W, 24.65 FEET
FOUND NAIL & TAG #30090, WEST/SIDE 6" X 10" WOOD RAIL POST, S03°E, 21.16 FEET
FOUND NAIL & TAG #39096 (J. RAUSER), ON TOP OF 6" X 10" WOOD RAIL POST, N36°E, 26.97 FEET
FOUND NAIL & TAG #25832 (L. BRYAN), ON TOP OF 6" X 10" WOOD RAIL POST, S18°E, 23.38 FEET

STATE OF MICHIGAN
RON HELSEL
LAND SURVEYOR
No. 18994
REGISTERED LAND SURVEYOR

Signed by Ron Helsel Date 3-23-2005

Surveyor's Michigan License No. 18994

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

E-11 VEVAY TOWNSHIP, T2N, R1W CONTINUED

5) M-DOT HIGHWAY PLANS OF US 127 CALLS FOR THE CORNER TO BE 67.16' EAST OF THE SURVEY CENTERLINE OF US 127 & 92.17' EAST OF THE CENTERLINE OF THE NORTH BOUND LANE.

6) INGHAM CO. ROAD COMM. GRID MAP (1969), CALLS FOR A MONUMENT BOX
S.W. BRIDGE COR. WSW, 41.18'
END BRIDGE WEST, 38.80'
N.W. BRIDGE CORNER, WNW, 41.19' (SHOULD OF BEEN NORTHEAST BRIDGE CORNER)

7) P.A. 74 CORNER LIBER 3, PAGE 211, AUG. 26, 1974, R. LESTER P.S. 18998. "FOUND 1/2" BAR IN MONUMENT BOX AS CALLED FOR IN MDSH RECORDS."
"I" BEAM GUARD POST, NORTH, 18.24' (I BEAM REPLACED, RAIL POSTS NOW WOOD)
P.K. NAIL IN ASPHALT, WNW, 40.09'
P.K. NAIL IN ASPHALT, WSW, 39.44'

8) P.A. 132 SURVEY, LIBER 2, PAGES 78-79, AUG. 26, 1974, R. LESTER. MONUMENT & WITNESSES SAME AS ABOVE.

9) P.A. 132 SURVEY, LIBER 5, PAGES 1017-1019, MAR. 10, 1989, D. LOHR P.S. 30090. MONUMENT & WITNESSES SAME AS ITEM 7 ABOVE. RECORDED 2635.95 FEET TO D-11 & 2655.84 FEET TO E-10.

10) P.A. 132 SURVEY, LIBER 6, PAGES 120-121, APRIL 20, 1990, L. BRYAN P.S. 25832. MONUMENT & WITNESSES SAME AS ITEM 7 ABOVE. RECORDED 2635.87 FEET TO D-11.

11) P.A. 132 SURVEY, LIBER 6, PAGES 277-278, JULY 31, 1990, D. LOHR. RECORDED 2642.42 FEET TO F-11 AND 2655.84 FEET TO E-10.
"FOUND 1/2" IRON IN MONUMENT BOX."
FD. NAIL & TAG WOOD GUARD POST, NORTH, 21.77'
FD. NAIL & TAG WOOD GUARD POST, S10°E, 23.42'
SET NAIL & TAG WOOD GUARD POST, SOUTH, 21.18'
SET NAIL & TAG WOOD GUARD POST, N30°W, 24.62'

2005-016724
Page: 2 of 2
04/01/2005 08:31P

12) P.A. 132 SURVEY, LIBER 7, PAGE1141 & 1142, APRIL 12, 1993, R. HELSEL P.S. 18994. "FOUND RE-BAR IN MONUMENT BOX." CITED LIBER 3 OF CORNERS, PAGE 37, ONLY.

13) P.A. 74 CORNER, LIBER 9, PAGE 327, SEPT. 1, 1998, G. BONNO P.S. 32332. "FOUND 16MM (5/8") ROD IN MONUMENT BOX."
WEST, 11.95 M (39.2") EAST END OF BRIDGE DECK AT CENTERLINE BARNES ROAD.
N30E 8.208 M (26.93') SET PK AND TAG #39096 (J. RAUSER)
S20E 7.135M (23.41') FOUND NAIL AND TAG #25832 IN TOP OF WOOD GUARD RAIL POST
N70W 13.009M (42.68') TOP CENTER OF N'LY BOLT HOLDING IRON RAIL TO CONCRETE RAIL
S70W 13.009M (42.68') TOP CENTER OF S'LY BOLT HOLDING IRON RAIL TO CONCRETE RAIL
WEST 803.392M (2635.80') D-11
EAST 805.362M (2642.26') F-11

14) P.A. 132 SURVEY LIBER 8, PAGES 1147, JUNE 19, 2003, M. MAHIEU P.S. 28414. "FOUND 5/8" ROD IN MON. BOX." RECORDED 2635.82 FEET TO D-11
FOUND NAIL & TAG #39096 TOP WOOD GUARD RAIL POST, N30°E, 26.93'
FOUND NAIL & TAG #25832 TOP WOOD GUARD RAIL POST, S20°E, 23.41'
TOP CENTER N'LY BOLT FOR RAILING, N70°W, 42.68'
TOP CENTER S'LY BOLT FOR RAILING, S70°W, 42.68'

15) P.A. 132 SURVEY, LIBER 8, PAGES 1171, JULY 29, 2003, R. LESTER. RECORDED 2635.82 FEET TO D-11. " BAR IN MONUMENT BOX, LIBER 9, PAGE 326. WITNESSES OF RECORD."
EAST END OF BRIDGE DECK AT CENTERLINE OF BARNES ROAD, WEST, 39.20'
P.K. NAIL & TAG #39096, TOP OF WOOD POST, N30°E, 26.93'
NAIL & TAG #25832 TOP WOOD POST, S20°E, 23.41'
TOP CENTER OF NLY BOLT HOLDING IRON RAIL TO CONCRETE RAIL, N70°W, 42.68'

16) P.A. 132 SURVEY, LIBER 8, PAGE 11182, AUG. 13, 2003, R. LESTER. RECORDED 2635.82 FEET TO D-11. MONUMENT AND WITNESSES SAME AS ITEM 15 ABOVE..

Paula Johnson-
INGHAM COUNTY
REGISTER OF DEEDS
OFFICIAL SEAL

L-11 P-358
CRNR 14.00 2005-016726

2005-016726
Page: 1 of 1
04/01/2005 08:31P

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in VEVAY TOWNSHIP

INGHAM (County) Located In: Corner Code #

1. Public Land Survey T 2N R 1W E-12
   T___ R___
   T___ R___
   T___ R___
2. Property Controlling S___ T___ R___
   in Section S___ T___ R___
3. Miscellaneous S___ T___ R___
   Property in Section S___ T___ R___

P.A. 345 INGHAM COUNTY
PEER APPROVED 3/22/2005

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

I, RON HELSEL , in A field survey on FEB. 26 , 20 05 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by A decree of A Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by A Decree of A Court of Law; established, re-established, monumented, recovered, found as expressed below:

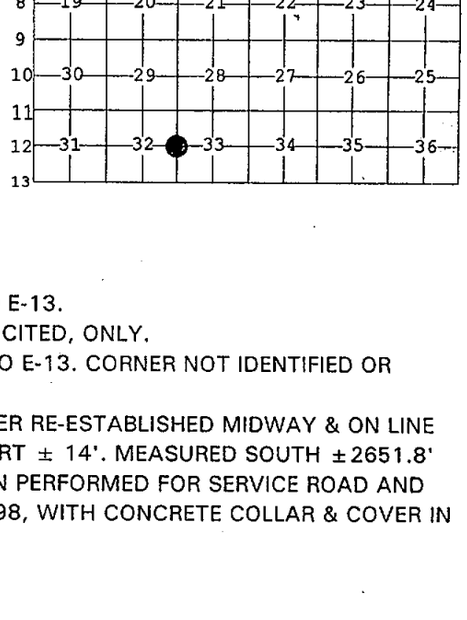

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
ORIGINAL MONUMENT: POST SET BY H. PARKE, DEPUTY SURVEYOR, MAR. 1826. WILLOW 8", S2W, 78 LINKS; B. ASH 5", N10E, 107 LINKS
1) VOL. 1, PAGE 32, DEC. 4, 1840, A. JACKSON C.S., HE CITED THE ORIGINAL BEARING TREES. RECORDED 158 RODS 48 LINKS TO F-12
2) VOL. 1, PAGE 37, DEC. 17, 1841, A. JACKSON C. S. HE CITED ORIGINAL BEARING TREES. RECORDED 159 RODS 17 LINKS TO D-12 AND 160 RODS 5 LINKS TO E-13.
3) VOL. 2, PAGE 94, NO DATE GIVEN, A. JACKSON C. S.. ORIGINAL BEARING TREES CITED, ONLY.
4) FOLDER 1, PAGE 18, APRIL 9, 1866, W. H. RAYNOR C.S. RECORDED 160 RODS TO E-13. CORNER NOT IDENTIFIED OR WITNESSED.
5) P.A. 74 CORNER, LIBER 6, PAGE 95, AUG. 29, 1980, R. LESTER P.S. 18998. "CORNER RE-ESTABLISHED MIDWAY & ON LINE BETWEEN E-11 AND E-13, 10' WEST CENTERLINE OF HULL ROAD & SOUTH OF CULVERT ± 14'. MEASURED SOUTH ±2651.8' TO E-13 & NORTH TO E-11 2651.8'. NO EXCAVATION DONE TO PAST CONSTRUCTION PERFORMED FOR SERVICE ROAD AND CULVERT. SET 4' X 36" CONCRETE MONUMENT WITH 1/2" X 38" REROD & CAP#18998, WITH CONCRETE COLLAR & COVER IN LOCATION OF RE-ESTABLISHED CORNER DESCRIBED ABOVE.
NORTHEAST CORNER OF CONCRETE ABUTMENT FOR CULVERT, ENE, 29.57'
SOUTHEAST CORNER OF CONCRETE ABUTMENT FOR CULVERT, EAST, 27.67'
HIGH POINT ON TOP CENTERLINE 18" CMP, NNW, 20.78'
FOUND 5/8" BAR IN CENTERLINE OF HULL ROAD, NORTHEAST, 14.71'
B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
DEEMED THE ORIGINAL CORNER LOST TO HIGHWAY CONSTRUCTION AND ACCEPTED THE POSITION AS DETERMINED BY SURVEYOR LESTER IN ITEM 5 ABOVE. FOUND THE CONCRETE MONUMENT AND COLLAR 9.5 FEET WEST OF THE CENTERLINE OF HULL ROAD. EXCAVATED AND CUT OFF THE TOP 4" OF THE 1/2" IRON RE-ROD AND CONCRETE MONUMENT AND REMOVED THE CONCRETE COLLAR. SET A STANDARD INGHAM COUNTY DISK ON TOP AND PLACED A STEEL MONUMENT BOX.
C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
32" CONCRETE MONUMENT AND 1/2" RE-ROD IN A MONUMENT BOX WITH AN ALUMINUM INGHAM COUNTY DISK STAMPED P.A. 345, P.S. 18994, LOCATED 9.5 FEET WEST OF THE CENTERLINE OF HULL ROAD.
FOUND A MAG. NAIL AT THE TOP WEST END OF AN 18" CMP, N35°W, 22.85 FEET
FOUND A MAG. NAIL AT THE TOP EAST END OF AN 18" CMP, B85°E, 32.34 FEET
FOUND KEBS NAIL & TAG ON EAST POST OF BARNES ROAD EXIT SIGN, S46°E, 58.62 FEET
CENTERLINE OF A SANITARY MANHOLE, S70°E, 40.65 FEET

STATE OF MICHIGAN
RON HELSEL
LAND SURVEYOR
No. 18994
REGISTERED LAND SURVEYOR

Signed by Ron Helsel Date 3-23-2005

Surveyor'S Michigan License No. 18994

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

Paula Johnson-
INGHAM COUNTY
REGISTER OF DEEDS
OFFICIAL SEAL

L-11 P-356
CRNR 17.00 2005-016725

2005-016725
Page: 1 of 2
04/01/2005 08:31P

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in VEVAY TOWNSHIP

INGHAM (County) Located In: Corner Code #

1. Public Land Survey	T 2N R 1W	E-13
	T___ R___	
	T___ R___	
	T___ R___	
2. Property Controlling	S___ T___ R___	
in Section	S___ T___ R___	
3. Miscellaneous	S___ T___ R___	
Property in Section	S___ T___ R___	

P.A. 345 INGHAM COUNTY
PEER APPROVED 3/22/2005

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____

5. Private Claims _____

I, RON HELSEL , in A field survey on FEB. 26 , 20 05 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by A decree of A Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by A Decree of A Court of Law; established, re-established, monumented, recovered, found as expressed below:

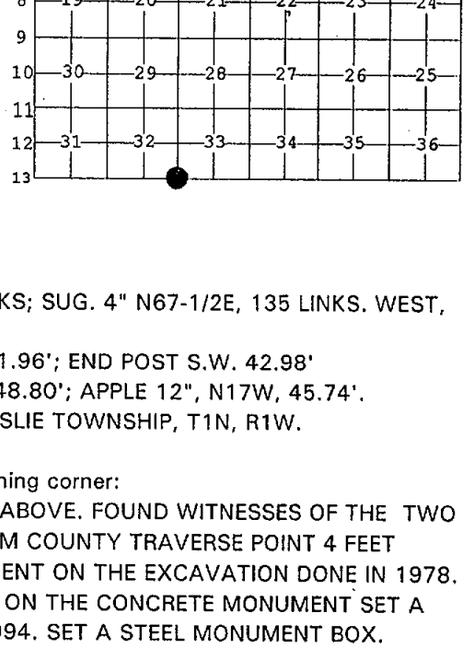

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
ORIGINAL MONUMENT: POST SET BY J. MULLET DEPUTY SURVEYOR, MAY 6, 1825. BLACK OAK 16", N63E, 19 LINKS; ELM 10", N79W, 36 LINKS.
1) VOL. 1, PAGE 37, DEC. 17, 1841, A. JACKSON, C. S .FOUND ORIGINAL BEARING TREES. RECORDED 160 RODS 5 LINKS TO E-12.
2) FROM INGHAM COUNTY CETA FILE: FOLDER 1 PAGE 18, APRIL 9, 1866, W. H. RAYNOR, C. S. CORNER MONUMENT NOT IDENTIFIED. SUG. 4" N67-1/2E, 102-1/2 LINKS; SUG. 4" N67-1/2E, 135 LINKS. WEST, 1.91 CHAINS TO E-1 LESLIE TOWNSHIP, T1N, R1W.
3) I.C.R.C. GRID MAP CALLS FOR A 1" PIPE, 14" ELM, NNW, 95.27'; 13" ELM, S. 101.96'; END POST S.W. 42.98'
4) NOTHSTINE'S NOTES: BOAT SPIKE: APPLE 16", S66E, 53.27'; APPLE 14", N30E, 48.80'; APPLE 12", N17W, 45.74'.
5) M-DOT MAP FOR US-27, FILE 33-R-3, PAGE 13 GIVES A TIE OF 126.73' TO E-1, LESLIE TOWNSHIP, T1N, R1W.

(CONTINUED ON BACK SIDE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND THE CONCRETE MONUMENT AS DESCRIBED BY SURVEYOR LESTER IN ITEM 7 ABOVE. FOUND WITNESSES OF THE TWO WOOD POSTS AND THE STUMP OF THE MAPLE. ASH GONE. ALSO FOUND THE INGHAM COUNTY TRAVERSE POINT 4 FEET WEST OF THE WEST EDGE OF HULL ROAD. ACCEPTED THE POSITION OF THE MONUMENT ON THE EXCAVATION DONE IN 1978. EXCAVATED AND FOUND A CONCRETE COLLAR. REMOVED COLLAR AND THE TOP 4" ON THE CONCRETE MONUMENT SET A STANDARD INGHAM COUNTY MONUMENT DISK ON TOP STAMPED P.A. 345, P.S. 18994. SET A STEEL MONUMENT BOX. MEASURED WEST 2640.55 FEET TO D-13 AND WEST 124.10 FEET TO E-1, T1N, R1W, LESLIE TOWNSHIP. (GLO 126.06 FEET)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
AN ALUMINUM DISK STAMPED P.A. 345, P.S. NO. 18994 IN MONUMENT BOX 1.5 FEET NORTH OF CENTERLINE OF PLAINS ROAD AND 59 FEET ± EAST OF THE CENTERLINE OF HULL ROAD.
FOUND NAIL & TAG #28414, EAST/SIDE NEW POWER POLE, AZ. 345°, 60.48 FEET
FOUND KEBS NAIL & TAG SOUTHWEST/SIDE WOOD ANCHOR POST, AZ. 316°, 39.15 FEET
U.S. GEOLOGICAL SURVEY MONUMENT IN 4-1/2" MONUMENT BOX, AZ. 314°, 57.26 FEET
FOUND MDSH NAIL & TAG NORTHWEST/SIDE WOOD ANCHOR POST, AZ. 235°, 42.10 FEET
CETA TRAVERSE POINT, WEST, 73.62 FEET

STATE OF MICHIGAN
RON HELSEL
LAND SURVEYOR
No. 18994
REGISTERED LAND SURVEYOR

Signed by Ron Helsel Date 3-23-2005

Surveyor'S Michigan License No. 18994

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

E-13, T2N, R1W, VEVAY TOWNSHIP CONTINUED

6) FROM CETA DOSSIER, FIELD FORM, DATED JULY 14, 1978. "FOUND A 1" PIPE. FOUND SMALL PIECE OF IRON 1.1 X 0.15' THICK TOP & 1/4" BOTTOM. FOUND BROKEN PIECE OF SAME WITH PIECE OF WOOD LEANING AGAINST IT. (LARGE PIECE WAS ALMOST DIRECTLY UNDER 1" PIPE) REPLACED WITH CONCRETE MONUMENT AND WITNESSED AS FOLLOWS:"
SET NAIL & TAG N/S 10" ELM S80E, 191.08'
SET NAIL & TAG N/S 8" ELM CLUSTER S85E (NO DISTANCE GIVEN)
SET NAIL & TAG E/S 4" ELM, S05E, 27.58'
FOUND P.K. NAIL E/S P.P., N35W, 60.32'
FOUND NAIL & TAG E/S 18" MAPLE, N55W, 112.63'
GAVE A TIE TO A TRAVERSE POINT OF WEST, 73.52'

7) P.A. 74 CORNER, LIBER 5, PAGE 74, NOV. 30, 1978, R. LESTER P.S. 18998. IN SECTION A OF THIS DOCUMENT, IT ERRONEOUSLY STATES THAT ORIGINAL POST WAS SET BY JOSEPH WAMPLER IN FEB.-MARCH, 1826. (THE ORIGINAL GOVERNMENT SURVEY OF THE SOUTH LINE OF VEVAY TOWNSHIP WAS CONDUCTED BY JOHN MULLET IN MAY OF 1825.)
"EXCAVATED A HOLE 4' X 4' TO AN AVERAGE DEPTH OF 1' ON THE CENTERLINE OF PLAINS ROAD EAST, AND ± 59' EAST OF THE CENTERLINE OF HULL ROAD. FOUND A 1" PIPE ON THE CENTERLINE OF PLAINS ROAD EAST. FOUND A LARGE PIECE OF IRON (1.1' X 0.15' X 1") WITH SMALLER BROKEN PIECE BELOW IT AND A PIECE OF WOOD LEANING AGAINST SMALL IRON PIECE, ± 2.2' NORTH OF THE CENTERLINE OF PLAINS ROAD EAST AND ± 59.5 FEET EAST OF THE CENTERLINE OF HULL ROAD. MEASURED EAST TO F-13 ± 2640'; AND WEST TO D-13 2630' IN CLOSE ACCORD WITH G.L.O. DISTANCES. ACCEPTED LARGE PIECE OF IRON WITH SMALLER BROKEN PIECE AND PIECE OF WOOD LEANING AGAINST IRON AS CORNER. EXCAVATION DONE BY INGHAM COUNTY SURVEY AND REMONUMENTATION PROJECT CREW. SET 4" X 36" CONCRETE MONUMENT WITH 1/2" X 38" REROD AND CAP #18998, AND CONCRETE SLEEVE AT LOCATION OF LARGE AND SMALL IRON WITH PIECE OF WOOD DESCRIBED ABOVE."
NAIL & TAG #18998, NORTH SIDE 4" ASH, SSE, 27.56'
FOUND NAIL & TAG #11370, NORTHWEST SIDE WOOD CORNER POST, NORTHWEST, 39.62'
FOUND POLARIS SURVEY MARKER, WEST SIDE OF 14" MAPLE, NORTHWEST, 112.60'
FOUND MSHD NAIL & TAG NORTHWEST SIDE WOOD CORNER POST, NORTHWEST, 42.15'

8) P.A. 132 SURVEY, LIBER 9, PAGE 2, JAN. 13, 2004, P. NORDER P. S. 44288. THIS WAS A SURVEY IN THE NORTHEAST 1/4 OF SECTION 5, T1N, T1W, LESLIE TOWNSHIP. E-13 WAS NOT IDENTIFIED OR WITNESSED. RECORDED A DISTANCE OF 2640.52 FEET TO D-13 AND 124.06 FEET TO E-1 OF LESLIE TOWNSHIP. CALLED FOR THE AMENDED CORNER OF E-1 TO BE 0.47 FEET NORTH OF RECORDED E-1.

2005-016725
Page: 2 of 2
04/01/2005 08:31P

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in VEVAY TOWNSHIP

INGHAM (County) Located In: Corner Code #

1. Public Land Survey T 2N R 1W F-11
   T___ R___
   T___ R___
   T___ R___
2. Property Controlling S___ T___ R___
   in Section S___ T___ R___
3. Miscellaneous S___ T___ R___
   Property in Section S___ T___ R___

B:12 P:257 8/7/06 8:55 AM Pages: 2
2006-040214 LAND CORNERS Receipt #14857
Paula Johnson, Ingham County, Michigan

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

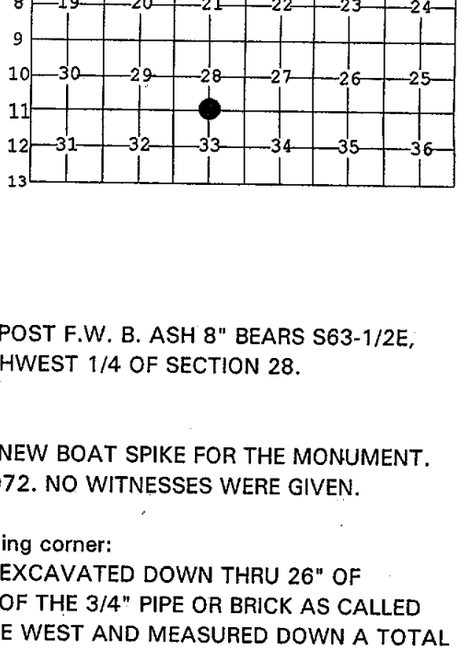

I, RON HELSEL , in A field survey on MAY 22 , 20 06 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by A decree of A Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by A Decree of A Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
ORIGINAL MONUMENT: POST SET BY HERVEY PARKE, U.S. DEPUTY SURVEYOR, MAR. 1826. SET POST AT AVER. DIST 39.84 CHAINS (2629.44').
W. ASH 10", N12-1/2 W, 6 LINKS; BEECH 12", S12E, 34 LINKS
1) VOL. 1, PAGE 123, A. JACKSON CO. SURVEYOR, JUNE 15, 1843. HE RECORDED ORIGINAL WITNESSES. MEAS. 156 RODS 34 LINKS (2598.42') TO G-11 & 161 RODS (2656.50')TO F-12.
2) VOL. 2, PAGE 94, T.J. BROWN CO. SURVEYOR, APRIL 17, 1873. HE CALLED FOR A POST F.W. B. ASH 8" BEARS S63-1/2E, 143-3/4 LINKS. RECORDED 19.97 CHAINS TO THE SOUTH 1/16 CORNER OF THE SOUTHWEST 1/4 OF SECTION 28.
3) I.C.R.C. GRID MAP 3/4" IRON, BRICK (M.S.H.D. 1955)
29" ELM, N.W. 98.02'; 27" OAK, S.S.E. 41.72': 26" ASH, E.S.E. 87.30
4) NOTHSTINE NOTES RECORDS THE SAME WITNESSES AS ABOVE BUT REFERS TO A NEW BOAT SPIKE FOR THE MONUMENT.
5) CONSUMERS POWER GRID MAP: "FOUND MON. BOX" G. FAUSER P.S. 18657, 10/1972. NO WITNESSES WERE GIVEN.

(CONTINUED ON BACK SIDE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND 1/2" X 24" IRON RE-ROD 0.6' SOUTH OF THE CENTERLINE OF BARNES ROAD. EXCAVATED DOWN THRU 26" OF GRAVEL AND ANOTHER 12" OF CLAY ROAD BED BUT DID NOT FIND ANY INDICATION OF THE 3/4" PIPE OR BRICK AS CALLED FOR IN ITEM 3 ABOVE. ALSO EXCAVATED AT A FOUND 1/2" IRON BAR 50 FEET TO THE WEST AND MEASURED DOWN A TOTAL OF 38" WELL INTO THE OLD CLAY ROAD BED. THE IRON TO THE WEST REPRESENTS THE WEST LINE OF A 50 FOOT WIDE CONSUMERS POWER EASEMENT. LOCATION OF THE 1/2" RE-ROD FOUND IT VERY NEARLY AT THE MID POINT BETWEEN E-11 & G-11 AND ON LINE WITH AN EXISTING FENCE TO THE NORTH. ACCEPTED ITS POSITION AS THE BEST AVAILABLE AND REPLACED IT WITH A STANDARD INGHAM COUNTY MONUMENT AND SET A MONUMENT BOX.
MEASURED EAST, 2642.80' TO G-11 & SOUTH, 2655.88' TO F-12.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
3/4" X 24" FORM PIN AND ALUMINUM DISK STAMPED P.A. 345, P.S. NO. 18994 IN STEEL MONUMENT BOX.
1/2" IRON BAR WEST, 50.00 FEET
FOUND NAIL & TAG #25832 (L. BRYAN) & SET A MAG. NAIL & INGHAM COUNTY WITNESS TAG ABOVE, N43°W, 56.92 FEET
FOUND NAIL & TAG #25832 NORTHWEST/SIDE POWER POLE, N76°E, 115.74 FEET
FOUND NAIL & TAG #25832 NORTH/SIDE 34" WHITE OAK, S67°E, 86.56 FEET
FOUND NAIL & WHITE SHINER, NORTHEAST/SIDE 44" WHITE OAK, S38°E, 39.19 FEET
FOUND NAIL & TAG #25832 EAST/SIDE 7" WHITE OAK, S07°E, 27.93 FEET

STATE OF MICHIGAN
RON HELSEL
LAND SURVEYOR
No. 18994
REGISTERED LAND SURVEYOR

Signed by Ron Helsel Date 7-26-06

Surveyor's Michigan License No. 18994

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

P.A. 345 INGHAM COUNTY
PEER APPROVED 6/20/2006 M

F-11 VEVAY TOWNSHIP, T2N, R1W CONTINUED.

6) P.A. 74 CORNER, LIBER 1, PAGE 631, JULY 3, 1972, & P.A. 132 SURVEY LIBER 1, PAGES 351-352, J. BUDZIK P.S. 18982. "FOUND IRON ROD ON NORTH LINE SECTION ON WEST LINE OF CONSUMERS POWER RIGHT OF WAY. SET 5/8" IRON ROD ON NORTH LINE 50.00 FEET EAST OF CONSUMERS IRON." RECORDED 2655.59' TO F-12 & 1329.85' TO THE N 1/16 CORNER OF THE NORTHEAST 1/4 OF SECTION 34.
IRON ROD WEST, 50.00 FEET
POLE N45°W, 56.71 FEET
30" OAK S45°E, 39.81
FENCE POST NORTH 35.81

7) P.A. 132 SURVEY, LIBER 1, PAGES 1055-1056, JAN. 3, 1974, R. LESTER P.S. 18998. RECORDED 1329.83 FEET TO THE SOUTH 1/16 CORNER OF THE SOUTHEAST 1/4 OF SECTION 28. MONUMENT & WITNESSES SAME AS ITEM 6 ABOVE.

8) P.A. 132 SURVEY, LIBER 2, PAGE 1209-1211, AUG. 16, 1977, W.Q. SMITH P.S. 6523 RECORDED 2642.99 FEET TO G-11 & 2655.59 FEET TO F-12. MONUMENT & WITNESSES SAME AS ITEM 6 ABOVE.

9) P.A. 132 SURVEY, LIBER 4, PAGE 230, FEB. 27, 1981, F. WHITE P.S. 12034. RECORDED 2642.82 FEET TO G-11. MONUMENT NOT DESCRIBED OR WITNESSED.

10) P.A. 132 SURVEY, LIBER 6, PAGES 277-278, JULY 31, 1990, D. LOHR P.S. 30090.RECORDED 2642.42 FEET TO E-11 AND 2658.42 FEET TO F-10. "FOUND 1/2" IRON".
FD. N& P. POLE, N45W, 56.90'
FD. NAIL & TAG WD. POST NORTH, 35.70'
FD. NAIL & TAG 30" OAK, S45E, 39.33'
SET NAIL & TAG WD. POST SOUTH, 28.60'

11) P.A. 132 SURVEY, LIBER 6, PAGES1141-1142, APRIL 12, 1993, R. HELSEL P.S. 18994. "FOUND 1/2" IRON BAR".
FD. NAIL & TAG E/SIDE WOOD ANCHOR POST, NORTH, 35.74'
FD. NAIL & TAG NORTHEAST/SIDE 30" OAK, S.E., 39.95'
FD. NAIL & TAG SOUTHWEST/SIDE POWER POLE, NORTHWEST, 56.90'
NORTHWEST CORNER ANGLE IRON GATE POST, S20°W, 46.83'

12) P.A. 132 SURVEY, LIBER 7, PAGES 1038-1041, MAR. 7, 1997, R. ENGER P.S. 28409. RECORDED 2643.31 FEET TO E-11. "FOUND 1/2" BAR CENTERLINE BARNES ROAD."
IRON ROD WEST, 50.00'
POLE N45°W, 56.71'
30 OAK, S45°E, 39.81'
FENCE POST NORTH, 35.81'

13) P.A. 74 CORNER, LIBER 9, PAGE 327, SEPT. 1, 1998, G. BONNO P.S. 32332. SECTION "A" 1964 MSHD PLANS, US-127 BARNES ROAD INTERCHANGE, STATE PROJECT #33031C, C7, OBJECT NOT LISTED, MEASURED WEST, 2591.58' TO E-11.
"FOUND 1/2" ROD, ACCEPTED THE POSITION AS THE BEST AVAILABLE EVIDENCE OF THE CORNER."
N45W, 56.86' FOUND NAIL & TAG 25832 (L. BRYAN) IN SOUTHWEST FC POWER POLE
S10E, 27.96' FOUND NAIL & TAG #28414 IN NORTHEAST FC 6" W. OAK
S45E, 39.21' FOUND NAIL & WHITE TAG IN NORTHEAST FC 33" OAK
S55W, 59.47' FOUND ROD WITH CAP #28409
WEST, 50.03' FOUND 1/2" ROD IN CENTERLINE OF ROAD
S60W, 24.68' FOUND ROD WITH TRAV PT CAP
WEST, 2642.26' E-11

14) P.A. 132 SURVEYS, LIBER 8, PAGES 338-339, & LIBER 8, PAGES 343-345, NOV. 02, 1998, M. MAHIEU P.S. 28414. RECORDED 2662.05 FEET TO F-10. "FOUND 1/2" IRON BAR."
NAIL & TAG 28414 S. SIDE 8" OAK, S10°E, 27.98'
NAIL & TAG 28414 N. SIDE 36" ASH, S45°E, 86.45'
FD NAIL & TAG S. SIDE 36" OAK, S45°E, 39.23'
NAIL & TAG 25832 SW. SIDE POWER POLE, N55°W, 56.90'

15) P.A. 132 SURVEYS, LIBER 8, PAGE 787, AND LIBER 8, PAGE 793, DEC. 28, 2000, M.MAHIEU. RECORDED 2642.86 FEET TO G-11 & 2662.05 FEET TO F-10. MONUMENT AND WITNESSES SAME AS ITEM 14 ABOVE.

16) P.A. 132 SURVEY, LIBER 8, PAGE 1099, MAR. 19, 2003, M. MAHIEU. RECORDED 2642.86 FEET TO G-11 & 2662.05 FEET TO F-10. MONUMENT & WITNESSES SAME AS ITEM 14 ABOVE.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in VEVAY TOWNSHIP

INGHAM (County) Located In: Corner Code #

1. Public Land Survey T 2N R 1W F-12
   T____ R____
   T____ R____
   T____ R____
2. Property Controlling S____ T____ R____
   in Section S____ T____ R____
3. Miscellaneous S____ T____ R____
   Property in Section S____ T____ R____

B:12 P:258 8/7/06 8:55 AM Pages: 2
2006-040215 LAND CORNERS Receipt #14857
Paula Johnson, Ingham County, Michigan

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

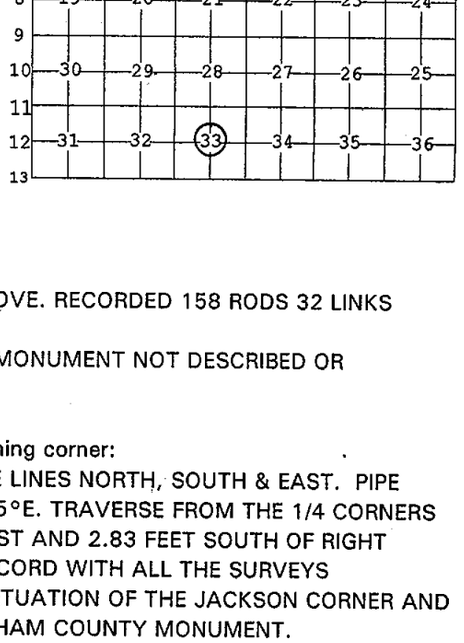

I, RON HELSEL , in A field survey on JUNE 26 , 20 06 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by A decree of A Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by A Decree of A Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
CORNER NOT SET IN ORIGINAL GOVERNMENT SURVEY
1) VOL. 1, PAGE 32, DEC. 4, 1840, A. JACKSON COUNTY SURVEYOR. MONUMENT NOT DESCRIBED. BEECH 10" EAST 18 LINKS; BEECH 12" S12W, 22-1/2 LINKS. RECORDED 158 RODS 48 LINKS WEST (2638.68') TO E-12 & 161 RODS NORTH (2656.5') TO F-11.
2) VOL. 1, PAGE 123, JUNE 15, 1843, A. JACKSON. WITNESSES SAME AS ITEM 1 ABOVE. RECORDED 158 RODS 32 LINKS (2628.12') EAST TO G-12 & 161 RODS (2656.5') NORTH TO F-11.
3) P.A. 132 SURVEY, LIBER 1, PAGES 351-352, JULY 3, 1972, J. BUDZIK P.S. 18982. MONUMENT NOT DESCRIBED OR WITNESSED. RECORDED 2655.59' TO F-11.

(CONTINUED ON BACK SIDE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND A 3/4" PIPE ON THE SOUTH SIDE OF A 10" WOOD ANCHOR POST WITH FENCE LINES NORTH, SOUTH & EAST. PIPE WAS IN A CIRCLE OF FIELD STONES. ALSO FOUND ANOTHER 3/4" PIPE 3.26 FEET, N45°E. TRAVERSE FROM THE 1/4 CORNERS FOUND THE PIPE LOCATED ON THE SOUTH SIDE OF THE ANCHOR POST 1.33 FEET EAST AND 2.83 FEET SOUTH OF RIGHT LINES BETWEEN THE 1/4 CORNERS. THIS LOCATION WAS FOUND TO BE IN CLOSE ACCORD WITH ALL THE SURVEYS REFERENCED IN ITEMS 3, 4, 5 & 6. ACCEPTED THE POSITION OF THE PIPE AS A PERPETUATION OF THE JACKSON CORNER AND IGNORED THE PIPE TO THE NORTHEAST. REPLACED THE PIPE WITH A STANDARD INGHAM COUNTY MONUMENT.
C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
3/4" X 24" FORM PIN AND ALUMINUM DISK STAMPED P.A. 345, P.S. NO. 18994 ON THE SOUTH SIDE OF A 10" WOOD ANCHOR POST.
MEASURED: NORTH, 2655.88' TO F-11; EAST, 2640.91' TO G-12; SOUTH, 2650.54' TO F-13; WEST, 2643.86' TO E-12
FOUND NAIL & TAG 25832 (L. BRYAN) NORTHWEST/SIDE POWER POLE, S50°W, 41.03 FEET
SET MAG. NAIL & INGHAM COUNTY WITNESS TAG NORTHEAST/SIDE 10" ASPEN, S32°E, 11.96 FEET
SET MAG. NAIL & INGHAM COUNTY WITNESS TAG NORTH/SIDE 20" BASSWOOD, N85°E, 16.85 FEET
SET MAG. NAIL &INGHAM COUNTY WITNESS TAG EAST/SIDE R.R. TIE POST, NORTH, 8.15 FEET

STATE OF MICHIGAN
RON HELSEL
LAND SURVEYOR
No. 18994
REGISTERED LAND SURVEYOR

P.A. 345 INGHAM COUNTY
PEER APPROVED 7/25/2006

Signed by Ron Helsel Date 7-26-06

Surveyor's Michigan License No. 18994

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

F-12 VEVAY TOWNSHIP, T2N, R1W CONTINUED

4) P.A. 74 CORNER, LIBER 3, PAGE 582, & P.A. 132 SURVEY LIBER 2, PAGE 776, JUNE 30, 1976, R. HELSEL P.S. 18994 " SECTION A: "USED PIPE SET BY CLYDE K. STEPHENS IN 1969. SECTION B: "FOUND PIPE AT P.I. OF FENCES AS SHOWN ON PREVIOUS STEPHENS" SURVEY." SECTION C: FOUND 1/2" PIPE."
N30°E, 16.61', NAIL & TAG IN 6" CHERRY TREE
S45°W, 41.35', NAIL & TAG IN POWER POLE
SURVEY RECORDED 2650.45 FEET SOUTH TO F-13 & EAST 2640.97 FEET TO G-12

5)P.A. 132 SURVEY, LIBER 2, PAGES 1209-1211, AUG. 16, 1977, WENLY SMITH P.S. 6523. MONUMENT NOT DESCRIBED OR WITNESSED. RECORDED 2655.59 FEET TO F-11 & 2640.97 FEET TO G-12.

6) P.A. 132 SURVEY, LIBER 5, PAGES 258-259, JULY 15, 1987, M. FOUTY P.S. 18989. MONUMENT & WITNESSES SAME AS ITEM 3 ABOVE. RECORDED 2641.39 FEET TO G-12 & 2650. 48 FEET TO F-13.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in VEVAY TOWNSHIP

INGHAM (County) Located In: Corner Code #

1. Public Land Survey		T 2N R 1W	F-13
		T___ R___	___
		T___ R___	___
		T___ R___	___
2. Property Controlling	S___	T___ R___	___
in Section	S___	T___ R___	___
3. Miscellaneous	S___	T___ R___	___
Property in Section	S___	T___ R___	___

2005-052919 Pages: 2 B:12 P:148
LAND CORNERS Receipt #2152
Mon Oct 03 10:25:53 EDT 2005
Paula Johnson, Ingham County, Michigan

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____

5. Private Claims _____

I, RON HELSEL , in A field survey on SEPT. 8 , 20 05 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by A decree of A Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by A Decree of A Court of Law; established, re-established, monumented, recovered, found as expressed below:

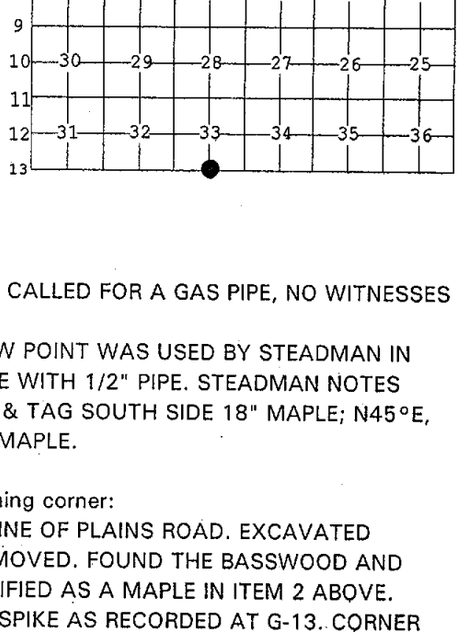

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
ORIGINAL MONUMENT: POST SET BY J. MULLETT, DEPUTY SURVEYOR, 1825.
SET POST 40 CHAINS WEST. SYCAMORE 6", N74E, 31 LINKS; BEECH 18", N39W, 34 LINKS.
DID NOT FIND ANY COUNTY SURVEYOR OR ROAD COMM. RECORDS CONCERNING THIS CORNER.
1) P.A. 132 SURVEY, LIBER 1, PAGE 129, NOV. 24, 1971, L. HENDRYX P.S. 3276. HE CALLED FOR A GAS PIPE, NO WITNESSES WERE GIVEN.
2) P.A. 74 CORNER LIBER 3, PAGE 582, JUNE 30, 1976, R. HELSEL P.S. 18994. "PLOW POINT WAS USED BY STEADMAN IN 1972, HE FOUND BRICK, CROC. AND BROKEN CHINA AROUND IT, RAISED TO SURFACE WITH 1/2" PIPE. STEADMAN NOTES ANOTHER PIPE WAS FOUND 3.1 FEET SOUTH OF PLOW POINT." N85°W, 90.55', NAIL & TAG SOUTH SIDE 18" MAPLE; N45°E, 35.94' NAIL & TAG WEST SIDE 15" ASH; N65°E, 61.94', NAIL & TAG WEST SIDE 15" MAPLE.

(CONTINUED ON BACK SIDE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND A 1/2" BY 18" PIPE 10" BELOW ROAD GRADE 3 FEET NORTH OF THE CENTERLINE OF PLAINS ROAD. EXCAVATED FURTHER AND FOUND PIECES OF BRICK BELOW THE PIPE. PLOW POINT HAD BEEN REMOVED. FOUND THE BASSWOOD AND MAPLE AS WITNESSED BY STEADMAN STILL STANDING. THE BASSWOOD WAS IDENTIFIED AS A MAPLE IN ITEM 2 ABOVE. TRAVERSED AND MEASURED WEST 2642.43' TO E-13 AND EAST 2649.18' TO A R.R. SPIKE AS RECORDED AT G-13. CORNER MARKER 0.82 FEET NORTH OF A LINE BETWEEN E-13 AND G-13. ACCEPTED THE FINDINGS OF SURVEYOR STEADMAN AND REPLACED THE PIPE WITH A STANDARD INGHAM COUNTY MONUMENT.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
3/4" X 24" FORM PIN AND ALUMINUM DISK STAMPED P.A. 345, P.S. NO. 18994, 3 FEET NORTH OF THE CENTERLINE OF PLAINS ROAD & ON A FENCE LINE TO THE NORTH.
SET NAIL & TAG 18994 WEST/SIDE 28" BASSWOOD, N52°E, 35.83 FEET
FOUND NAIL & TAG #28414 (M. MAHIEU) SOUTH/SIDE 30" MAPLE, N75°E, 61.63 FEET
SET NAIL & TAG 18994 NORTH/SIDE POWER POLE, S67°E, 117.19 FEET
FOUND NAIL & TAG 28414 SOUTH/SIDE 28" MAPLE, N75°W, 90.48 FEET
FACE OF 6" DIA. STEEL GATE POST, N20°W, 32.84 FEET
INGHAM COUNTY MONUMENT F-1, T1N, R1W, WEST, 121.89 FEET

STATE OF MICHIGAN
RON HELSEL
LAND SURVEYOR
No. 18994
REGISTERED LAND SURVEYOR

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/20/2005 RL

Signed by Ron Helsel Date Sept. 22 2005

Surveyor'S Michigan License No. 18994

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

F-13 VEVAY TOWNSHIP, T2N, R1W CONTINUED

3) P.A. 74 CORNER, LIBER 5, PAGE 26, FIELD DATED OCT. 2, 1972 AND RECORDED OCT. 18, 1978, R. STEADMAN P.S. 11370.
" THIS CERTIFICATE IS FILED TO CLARIFY A REFERENCE GIVEN ON LAND CORNER RECORDATION CERTIFICATE #969. (THIS IS P.A. 74, LIBER 3, PAGE 582 ABOVE) DUG HOLE IN PLAINS ROAD OPPOSITE FENCE LINE NORTH, AND ABOUT 15" DEEP, FOUND A PLOW POINT WITH WHOLE BRICKS, BROKEN CROCKERY AND CHINA AROUND IT. ALSO FOUND A 5/8" IRON ROD 3.1 FT. SOUTH IN CENTER OF ROAD. RAISED LOCATION OF PLOW POINT TO SURFACE WITH 1/2" IRON PIPE."
24" MAPLE, N.W. 91.17 FT.
POWER POLE SOUTH 32.12 FT.
14" BASSWOOD N.E. 35.83 FT.
QUARTER CORNER FOR T1N, R1W (SET 1/2" IRON PIPE) WEST 121.66 FT. (P.A. 74 CORNER, LIBER 5, PAGE 27 FOR T1N, R1W OF SAME FIELD DATE AND RECORDING DATE BY SURVEYOR STEADMAN. "FOUND PLOW POINT; RAISED WITH 1/2" IRON PIPE FOR QUARTER CORNER EAST, 121.66 FT."

4) P.A. 132 SURVEY, LIBER 2, PAGE 776, JUNE 30, 1976, F. WHITE P.S. 12034. RECORDED 2650.45 FEET TO F-12. "FOUND 5/8" IRON BAR" WITNESSES SAME AS ITEM 2 ABOVE.

5) P.A. 132 SURVEY, LIBER 5, PAGES 258-259, JULY 15, 1987, M. FOUTY P.S. 18989. RECORDED 2650.48 FEET TO F-12 AND 2649.04 ' TO G-13. 'FOUND 1/2" IRON PIPE." WITNESSES SAME AS ITEM 3 ABOVE.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in VEVAY TOWNSHIP

INGHAM (County) Located In: Corner Code #

1. Public Land Survey T 2N R 1W G-11
   T___ R___ ___
   T___ R___ ___
   T___ R___ ___
2. Property Controlling S___ T___ R___ ___
   in Section S___ T___ R___ ___
3. Miscellaneous S___ T___ R___ ___
   Property in Section S___ T___ R___ ___

2005-052918 Pages: 2 B:12 P:147
LAND CORNERS Receipt #2152
Mon Oct 03 10:25:53 EDT 2005
Paula Johnson, Ingham County, Michigan

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

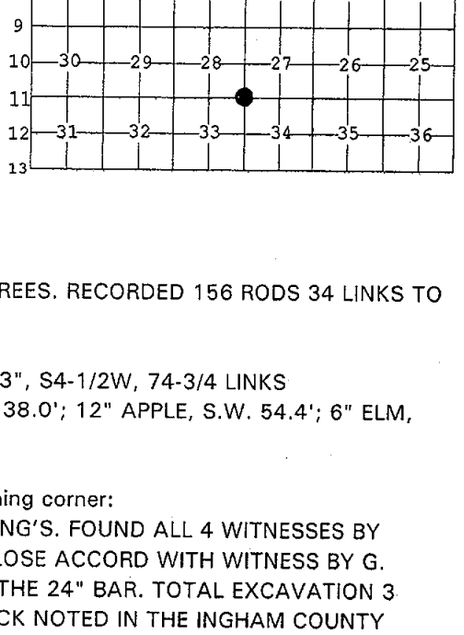

I, RON HELSEL , in A field survey on SEPT. 6 , 20 05 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by A decree of A Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by A Decree of A Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
ORIGINAL MONUMENT: POST SET BY HERVEY PARKE, U.S. DEPUTY SURVEYOR, MAR. 1826. SET POST 40 CHAINS. BEECH 14", S53-1/2W, 27 LINKS; BEECH 6", N82E, 19 LINKS. SET H-11 AT 39.96 CHAINS & F-11 AT 39.84 CHAINS.
MARGIN NOTE ON INGHAM COUNTY COPY OF GLO NOTES CALLED FOR STONE, BRICK F.W. THORN 3", S4-1/2W, 74-3/4 LINKS.
1) VOL. 1, PAGE 123, JUNE 15, 1843, A. JACKSON C.S. CITED ORIGINAL BEARING TREES. RECORDED 156 RODS 34 LINKS TO F-11 (2596.44')
2) VOL. 1, PAGE 163, MAY 26, 1844, A. JACKSON CITED ORIGINAL BEARING TREES.
3) VOL. 3, PAGE 70, APRIL 17, 1873, T.J. BROWN C.S. CITED A STONE F.W. THORN 3", S4-1/2W, 74-3/4 LINKS
4) INGHAM COUNTY ROAD GRID MAP CALLED FOR STONE & BRICK 12" MAPLE, S.E. 38.0'; 12" APPLE, S.W. 54.4'; 6" ELM, N.W. 57.9'

(CONTINUED ON BACK SIDE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND A 1/2" BY 24" RE-ROD WITH AN ORANGE CAP WHICH I BELIEVE TO BE G. YOUNG'S. FOUND ALL 4 WITNESSES BY SURVEYOR MAHIEU IN ITEMS 10, 11 & 12 ABOVE. FOUND A MAPLE TREE, N.W., IN CLOSE ACCORD WITH WITNESS BY G. YOUNG IN ITEM 6 ABOVE. EXCAVATED AND FOUND A 1/2" BY 18" IRON BAR BELOW THE 24" BAR. TOTAL EXCAVATION 3 FEET BELOW ROAD SURFACE. I DID NOT FIND ANY EVIDENCE OF THE STONE AND BRICK NOTED IN THE INGHAM COUNTY ROAD COMMISSION GRID MAP. I BELIEVE THE 1/2" BARS ARE THE PERPETUATED MARKERS OF THE STONE AND EXCEPTED THIS POSITION. REPLACED THE BARS WITH A STANDARD INGHAM COUNTY MONUMENT.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
3/4" X 24" FORM PIN AND ALUMINUM DISK STAMPED P.A. 345, P.S. NO. 18994 IN A MONUMENT BOX IN THE CENTERLINE OF BARNES ROAD OPPOSITE A FENCE ANCHOR POST TO THE NORTH.
FOUND NAIL & TAG 28414 SOUTH/SIDE 28" MAPLE, AZ. 299°, 142.85 FEET
FOUND NAIL & TAG 17640 SOUTH/SIDE 24" MAPLE, AZ. 287°, 136.49 FEET
FOUND NAIL & TAG 17640 EAST/SIDE 5" DIA. WOOD POST, S20°W, 32.41 FEET
SET NAIL & TAG 18994 WEST/SIDE 5" WOOD ANCHOR POST, NORTH, 33.30 FEET
SET NAIL & TAG 18994 EAST/SIDE 13" MAPLE, AZ. 332°, 181.37 FEET

STATE OF MICHIGAN
RON HELSEL
LAND SURVEYOR
No. 18994
REGISTERED LAND SURVEYOR

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/20/2005 JM

Signed by Ron Helsel Date Sept. 22, 2005

Surveyor'S Michigan License No. 18994

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

G-11 VEVAY, T2N, R1W, CONTINUED

5) P.A. 74 CORNER, LIBER 1, PAGE 631, AND P.A. 132 SURVEY, LIBER 1, PAGE 351-352 BOTH RECORDED JULY 3, 1972, J. BUDZIK P.S. 18982. "FOUND 3/4" BOAT SPIKE IN CENTERLINE ROAD." IRON FENCE POST NORTH, 25.91'
IRON FENCE POST SOUTH, 10° WEST, 38.31'. NO LINEAL TIES WERE GIVEN TO THE WEST.

6) P.A. 132 SURVEY, LIBER 2, PAGE 820, JULY 15, 1976, G. YOUNG P.S. 17640. " SET 1/2" RE-ROD WITH CAP ACCORDING TO RECORDS, RECORDED IN LIBER 1, PAGE 632 (631)."
CENTER LINE 18" MAPLE, N60°W, 143.2'
NAIL IN 6" TWIN ASH, N02°E,37.80'
CORNER OF ANGLE IRON FENCE POST, S10°W, 37.91'

7) P.A. 132 SURVEY, LIBER 2, PAGES 1209-2111, AUG. 16, 1977, WENLEY Q. SMITH P.S. 6523. HE CALLED FOR THE SAME MONUMENT & WITNESSES AS IN ITEM 5 ABOVE. RECORDED 2661.35 FEET TO G-12 AND 2642.99 FEET TO F-11.

8) P.A. 132 SURVEY, LIBER 4, PAGE 230, FEB. 27, 1980, F. WHITE P.S. 12034. CORNER NOT IDENTIFIED OR WITNESSED. RECORDED 2642.82 FEET TO F-11.

9) P.A. 132 SURVEY, LIBER 5, PAGES 242-244, JULY 13, 1987, R. LESTER P.S. 18998. RECORDED 5309.06 FEET TO G-9. CORNER MONUMENT NOT IDENTIFIED."
NAIL & SHINER WEST SIDE WOOD CORNER POST, NORTH, 24.7'
BENT IRON POST, SSW, 38.4'
IRON BAR S40°E, 33.54'
FENCE LINE NORTH AND SOUTH

10) P.A. 132 SURVEY, LIBER 8, PAGE 657, DEC. 6, 1999, M. MAHIEU P.S. 28414. RECORDED 2684.86 FEET TO F-11. "FOUND 1/2" BAR."
FOUND NAIL & TAG #17640 E. SIDE WOOD POST, S20°W, 32.40'
FOUND NAIL & TAG W. SIDE WOOD POST, N10°E,, 33.31'
FOUND NAIL & TAG #17640 S. SIDE 24" MAPLE, N75°W, 136.48'
SET NAIL & TAG #28414 S. SIDE 24" MAPLE, N60°W,, 142.84'

11) P.A. 132 SURVEY, LIBER 8, PAGE 787, & P.A. 132 SURVEY, LIBER 8, PAGE 793, DEC. 28, 2000, M. MAHIEU. CORNER MONUMENT AND WITNESSES AND DISTANCE TO F-11, SAME AS ITEM 10 ABOVE.

12) P.A. 132 SURVEY, LIBER 8, PAGE 1099, MAR. 19, 2003, M. MAHIEU. CORNER MONUMENT, WITNESSES AND TIE TO F-11 SAME AS ITEM 10 ABOVE.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in VEVAY TOWNSHIP

INGHAM (County) | Located In: | Corner Code #

1. Public Land Survey — T 2N R 1W — G-12
   T____ R____
   T____ R____
   T____ R____
2. Property Controlling — S____ T____ R____
   in Section — S____ T____ R____
3. Miscellaneous — S____ T____ R____
   Property in Section — S____ T____ R____

B:12 P:259 8/7/06 8:55 AM Pages: 2
2006-040216 LAND CORNERS Receipt #14857
Paula Johnson, Ingham County, Michigan

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

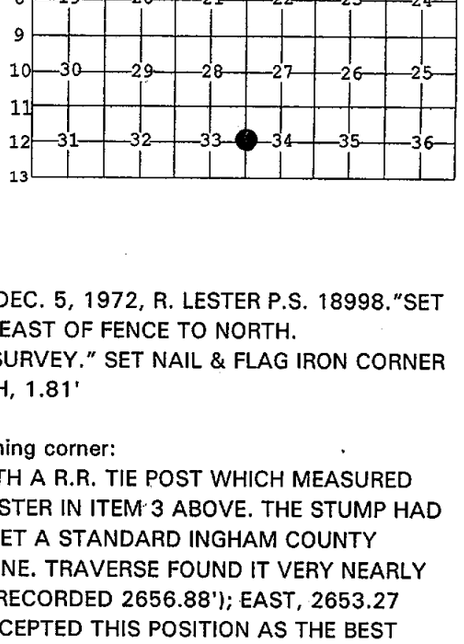

I, RON HELSEL , in A field survey on JUNE 23 , 20 06 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by A decree of A Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by A Decree of A Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
ORIGINAL MONUMENT: POST SET BY HERVEY PARKE, U.S. DEPUTY SURVEYOR, MAR. 1826; BEECH 16", N28E, 35 LINKS; BEECH 12", S48W, 11-1/2 LINKS.
1) VOL. 1, PAGE 123, JUNE 15, 1843, A. JACKSON CO. SURVEYOR. CITED ORIGINAL POST & WITNESSES. RECORDED 158 RODS 32 LINKS (2628.12')TO F-12.
2) I.C.R.C. GRID MAP CALLED FOR A R.R. IRON. NO WITNESSES WERE GIVEN.
3) P.A. 74 CORNER LIBER 2, PAGE 263 & P.A. 132 SURVEY LIBER 1, PAGES 518-519, DEC. 5, 1972, R. LESTER P.S. 18998."SET 1/2" BAR AT FENCE INTERSECTION OF EAST-WEST FENCE & FENCE TO SOUTH, 14.1' EAST OF FENCE TO NORTH. MEASUREMENT NORTH & SOUTH IN CLOSE ACCORD WITH ORIGINAL GOVERNMENT SURVEY." SET NAIL & FLAG IRON CORNER POST SET IN CONCRETE, WEST, 14.1'; SET NAIL & FLG EAST SIDE 30" STUMP, SOUTH, 1.81'

(CONTINUED ON BACK SIDE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND OLD ROTTEN WOOD ANCHOR POST ON GROUND. IT HAD BEEN REPLACED WITH A R.R. TIE POST WHICH MEASURED 14.1 FEET EAST TO ITS CENTER FROM THE STEEL POST DESCRIBED BY SURVEYOR LESTER IN ITEM 3 ABOVE. THE STUMP HAD BEEN REMOVED AND MANY FIELD STONES WERE PLACED AROUND THE NEW POST. SET A STANDARD INGHAM COUNTY MONUMENT AT THE NORTHWEST CORNER OF THE POST IN THE EAST-WEST FENCE LINE. TRAVERSE FOUND IT VERY NEARLY ON LINE BETWEEN G-11 & G-13. MEASURED SOUTH, 2656.80 FEET TO G-13 (LESTER RECORDED 2656.88'); EAST, 2653.27 FEET TO H-12 (LESTER RECORDED 2653.67') AND NORTH, 2657.54 FEET TO G-11. ACCEPTED THIS POSITION AS THE BEST AVAILABLE EVIDENCE FOR THE PERPETUATION OF THE CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
3/4" X 24" FORM PIN AND ALUMINUM DISK STAMPED P.A. 345, P.S. NO. 18994 AT NORTHWEST CORNER OF R.R. TIE ANCHOR POST. FENCES EAST, WEST & SOUTH. FENCE TO NORTH 23.7 FEET WEST.
SET MAG. NAIL & INGHAM CO. WITNESS TAG WEST/SIDE 10" PIGNUT, SOUTH, 29.10 FEET
SET MAG. NAIL & INGHAM CO. WITNESS TAG EAST/SIDE 10" PIGNUT, N16°W, 16.14 FEET
SET MAG. NAIL & INGHAM CO. WITNESS TAG WEST/SIDE 12" CHERRY, N32°W, 15.56 FEET
FACE OF ANGLE IRON ANCHOR POST AT GROUND LEVEL, WEST, 13.70 FEET

STATE OF MICHIGAN
RON HELSEL
LAND SURVEYOR
No. 18994
REGISTERED LAND SURVEYOR

P.A. 345 INGHAM COUNTY
PEER APPROVED 7/25/2006

Signed by Ron Helsel Date 7-26-06

Surveyor's Michigan License No. 18994

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

G-12 VEVAY TOWNSHIP, T2N, R1W CONTINUED

4) P.A. 132 SURVEY, LIBER 2, PAGES1209-211, AUG. 16, 1977, W.Q. SMITH P.S. 6528. RECORDED 2640.97 FEET TO F-12 & 2661.35 FEET TO G-11. CITED SAME WITNESSES AS ITEM 3 ABOVE.

5) P.A. 132 SURVEY, LIBER 2, PAGES735-737, JUNE 10, 1976, R. LESTER. RECORDED 2653.67' TO H-12 & 2656.88' TO G-13. MONUMENT & WITNESSES SAME AS ITEM 3 ABOVE.

6) P.A. 132 SURVEY, LIBER 5, PAGES 258-259, JULY 15, 1987, M. FOUTY P.S. 18989. RECORDED 2656.81 FEET TO G-13 & 2641.39 FEET TO F-12. CITED SAME MONUMENT & WITNESSES AS ITEM 3 ABOVE.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in VEVAY TOWNSHIP

INGHAM (County) | Located In: | Corner Code #

1. Public Land Survey — T 2N R 1W — G-13
   T ____ R ____
   T ____ R ____
   T ____ R ____
2. Property Controlling — S ____ T ____ R ____
   in Section — S ____ T ____ R ____
3. Miscellaneous — S ____ T ____ R ____
   Property in Section — S ____ T ____ R ____

B:12 P:247 7/17/06 8:34 AM Pages: 2
2006-036311 LAND CORNERS Receipt #13786
Paula Johnson, Ingham County, Michigan

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, RON HELSEL, in A field survey on MAY 22, 20 06 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by A decree of A Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by A Decree of A Court of Law; established, re-established, monumented, recovered, found as expressed below:

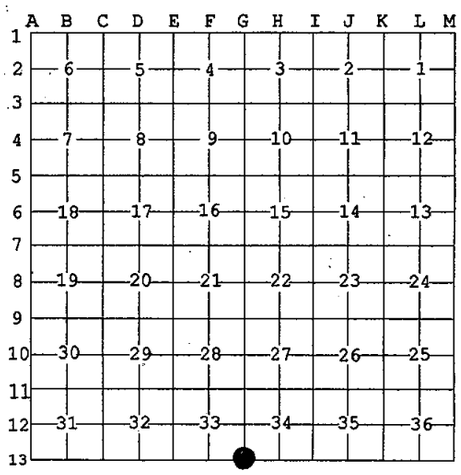

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
ORIGINAL MONUMENT: POST SET BY JOHN MULLETT, U.S. DEPUTY SURVEYOR, 1825. SET 40 CHAINS FROM H-13. BEECH 8", N64-1/2E, 30 LINKS; BEECH 14", N29W, 34 LINKS.
1) NOTES GLEANED FROM THE INGHAM CO. CETA FILE. W.H. RAYNOR, CO. SURVEYOR, 1904, MONUMENT NOT DESCRIBED. HE CALLED FOR SUGAR 18", N11-3/4E, 77 LINKS; BEECH 8", N64-1/2E, 30 LINKS; BEECH 14", N29W, 34 LINKS.

P.A. 345 INGHAM COUNTY
PEER APPROVED 5/23/2006

2) P.A. 74 CORNER, LIBER 2, PAGE 63, AUG. 28, 1972, OSCAR BOSS P.S. 13574. "FOUND RAILROAD SPIKE" N72°45'40"W, 88.43 NAIL SOUTH SIDE 28" MAPLE; NORTH 58.19 NAIL S.W. SIDE 26" OAK; N78°25'40"E 118.74 NAIL SOUTH SIDE 10" HICKORY.
3) P.A.132 SURVEY, LIBER 1, PAGE 466, OCT. 26, 1972, O. BOSS. THIS WAS A SURVEY IN SECTION 4 OF LESLIE TOWNSHIP. MONUMENT & WITNESSES SAME AS ABOVE.

(CONTINUED ON BACK SIDE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND A R.R. SPIKE 6" BELOW THE SURFACE OF THE ASPHALT & 1 FOOT SOUTH OF THE CENTERLINE OF BARNES. EXCAVATED DOWN THRU GRAVEL 2.6 FEET & HIT THE TOP OF A POINTED STONE DIRECTLY UNDER THE R.R. SPIKE. CORNER ON LINE WITH A TREE ROW TO THE NORTH. MEASURED WEST, 2649.14 FEET TO F-13. (FOUTY 2649.04') ACCEPTED THE POSITION OF THE STONE & SPIKE AS THE PERPETUATED CORNER AND SET A STANDARD INGHAM COUNTY MONUMENT AT THIS POSITION.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
3/4" X 24" FORM PIN AND ALUMINUM DISK STAMPED P.A. 345; P.S. NO. 18994 IN A MONUMENT BOX 1 FOOT SOUTH OF THE CENTERLINE OF BARNES ROAD.
INGHAM COUNTY MONUMENT AT G-1, T21N, R1W, LESLIE TOWNSHIP, WEST, 118.90 FEET
SET MAG. NAIL & INGHAM COUNTY WITNESS TAG SOUTH/SIDE 20" HICKORY, N81°E, 118.95 FEET
FOUND NAIL & TAG 28414 EAST/SIDE 42" W. OAK, NORTH, 58.77 FEET
SET MAG. NAIL & INGHAM COUNTY WITNESS TAG SOUTH/SIDE 40" W. OAK, N69°W, 108.16 FEET
SET MAG. NAIL & INGHAM COUNTY WITNESS TAG NORTH/SIDE 14" MAPLE, S82°W, 84.20 FEET
FOUND NAIL & TAG 28414SOUTH/SIDE 18" W. OAK, N53°W, 42.33 FEET
FOUND NAIL & TAG 28414 SOUTH/SIDE 16" LOCUST, N65°E, 78.15 FEET

STATE OF MICHIGAN
RON HELSEL
LAND SURVEYOR
No. 18994
REGISTERED LAND SURVEYOR

Signed by Ron Helsel Date 6-18-06

Surveyor's Michigan License No. 18994

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

G-13 VEVAY TOWNSHIP, T12N, R1W, CONTINUED.

4) P.A. 132 SURVEY, LIBER 2, PAGES 735-737, JUNE 10, 1976, R. LESTER P.S. 18998. MONUMENT NOT DESCRIBED WITNESSES SAME AS ITEM 2 ABOVE. RECORDED 2656.88 FEET TO G-12 & 2650.58 FEET TO H-13.

5) P.A. 132 SURVEY, LIBER 5, PAGE 258, JULY 15, 1987, M. FOUTY P.S. 18989. MONUMENT & WITNESSES SAME AS ITEM 2 ABOVE. RECORDED 2649.04 FEET TO F-13 & 2656.81 FEET TO G-12.

6) P.A. 132 SURVEY, LIBER 9, PAGES 22-23, FEB. 17, 2004, M. MAHIEU P.S. 28414. "FOUND R.R. SPIKE" RECORDED 2650.89 FEET TO H-13.
NAIL & TAG #28414 S. SIDE 15" LOCUST, N67°E, 78.17'
NAIL & TAG #28414 E. SIDE 42" OAK, NORTH, 58.78'
NAIL & TAG #28414 S. SIDE 15" OAK, N60°W, 42.45'
NAIL & TAG #28414 N. SIDE 12" MAPLE, S60°W, 44.15'