

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 1N R 1E A-5

2. Property Controlling
In Section

S T R

3. Miscellaneous
Property in Sec.

S T R

B: 13 P: 191 11/26/2007 08:28 AM
2007-049515 LAND CORNERS Receipt #34841
Paula Johnson, Ingham County, Michigan

Pages: 2



Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Wendy S. Parsons, in a field survey on JUNE 13, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. JANUARY-FEBRUARY 1826 - GLO - WAMPLER - INTERSECTED MERIDIAN
8" MAPLE N15°E 45 LINKS (29.7')
5" BLACK OAK S35°E 27 LINKS (17.82')
A-5 TO C-5 = 34.12 CHAINS (2251.92')

2. MAY 21, 1843 - COUNTY SURVEYOR NOTES - A. JACKSON
20" WHITE OAK N19-1/2°E 50 LINKS (33')
18" WHITE OAK N10°W 9 LINKS (5.94')
A6 - A5 = 157 RODS, 32 LINKS (2611.62')
A6 - C6 = 135 RODS, 21 LINKS (2241.36')

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION OF CORNER. FOUND IRON BAR AND CAP #28409 (RON ENGER) 0.25' WEST OF THE LINE BETWEEN LESLIE CORNER M5 (AS FOUND AND RESET BY YOUNG, LIBER 6, PAGE 10) AND LESLIE CORNER M4 (AS SET BY LESTER, LIBER 2, PAGE 611). FOUND FENCE LINE AND ANOTHER ENGER IRON (CORNER SET AS PART OF ITEM A8 ABOVE) WERE FOUND TO BE ON LINE BETWEEN ENGER'S POSITION AT A5 AND CORNER C5 (AS REMONUMENTED BY PARSONS IN 2007). ACCEPTED ENGER'S NORTH-SOUTH POSITION OF CORNER A5 AND REPLACED IT WITH A 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" ON THE M4-M5 LINE.

MEASURED IN 2007 AS: A5 - A4 = 2626.72', A5 - M4 = NORTH 1858.81', A5 - M5 = SOUTH, 787.15', A5 - A6 = 2612.89', A5 - C5 = 2241.07'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

ACCEPTED ENGER'S NORTH-SOUTH POSITION OF CORNER A5 AND REPLACED IT WITH A 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" ON THE M4-M5 LINE.

S60°E, 17.25' FOUND NAIL & TAG #28409 (ENGEL), SOUTH SIDE, 16" CHERRY
S02°W, 25.48' SET REMON NAIL & TAG, WEST SIDE, 6" ASH
S35°W, 29.78' FOUND NAIL & TAG #28409 (ENGEL), NORTH SIDE, 16" COTTONWOOD
S80°W, 12.64' FOUND NAIL & TAG #28409 (ENGEL), SOUTH SIDE, 8" ASH

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2 " ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/25/2007

Signed by WSP B.

Date 11/5/2007

Surveyor's Michigan License No. 47969

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

BUNKER HILL
INGHAM COUNTY

A5

PART A CONTINUED

3. MAY 21, 1843 - COUNTY SURVEYOR NOTES-- A. JACKSON

CORNER IS NOT DESCRIBED

WITNESSES: MAPLE 8" N15°E, 45 LINKS (29.7')

BLACK OAK 5" S55°E 27 LINKS (17.82')

WHITE OAK 12" S75-1/2°W, 50-1/2 LINKS (33.33')

A5 - C5 = 135 RODS, 14 LINKS (2236.74')

A5 - A6 = 157 RODS, 32 LINKS (2611.62')

4. DECEMBER 26, 1846 - COUNTY SURVEYOR NOTES-- A. JACKSON

CORNER IS NOT DESCRIBED

WITNESS: BLACK OAK 5" S55°E, 27 LINKS (17.82')

A5 - C5 = 135 RODS (2227.5')

5. FEBRUARY 8, 1848 - COUNTY SURVEYOR NOTES-- T.J. BROWN (DEPUTY SURVEYOR)

CORNER IS NOT DESCRIBED

WITNESS: BLACK OAK 5" S55°E, 27 LINKS (17.82')

A5 - C5 = 33.75 CHAINS (2227.5')

A5 - A3 = 79.03 CHAINS (5215.98')

6. MAY 15, 1848 - COUNTY SURVEYOR NOTES-- A. JACKSON

CORNER IS NOT DESCRIBED

WITNESS: BLACK OAK 5" S55°E, 27 LINKS (17.82')

A5 - C5 = 33.75 CHAINS (2227.5')

A5 - A3 = 79.03 CHAINS (5215.98')

7. MAY 1888 - HAND WRITTEN NOTES IN GLO RECORDS

HICKORY 6" N01°E 120

HICKORY 5" N25-1/2°W 113

8. JULY 7, 2003 - FIELD NOTES SUPPLIED BY RON ENGER P.S. # 28409

SET 5/8" REBAR & CAP #28409 ON EXTENSION OF FENCE TO EAST ON LINE WITH
CORNERS M5 AND M4 T1NR1W

S62°E 17.26' NAIL & TAG #28409 IN SOUTH SIDE 15" CHERRY

S81°W 12.59' NAIL & TAG #28409 IN SOUTH SIDE 8" ELM

S47°W 29.71' NAIL & TAG #28409 IN MW SIDE 12" COTTONWOOD

EAST 4.51' TOP OF POINTED IN E SIDE ANCHOR POST HOLE

9. JULY 22, 2003 - UNRECORDED SURVEY - RON ENGER P.S. # 28409

SET 5/8" REBAR & CAP #28409

S62°E 17.26' NAIL & TAG #28409 IN SOUTH SIDE 15" CHERRY

S81°W 12.59' NAIL & TAG #28409 IN SOUTH SIDE 8" ELM

S47°W 29.71' NAIL & TAG #28409 IN MW SIDE 12" COTTONWOOD

EAST 4.51' TOP OF POINTED IN E SIDE ANCHOR POST HOLE

NO ADDITIONAL INFORMATION FOUND

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey

T 1N R 1E A-6

2. Property Controlling
In Section

S T R

3. Miscellaneous
Property in Sec.

S T R

B: 13 P: 185 11/06/2007 01:23 PM
2007-047411 LAND CORNERS Receipt #34179
Paula Johnson, Ingham County, Michigan

Pages: 1



Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Wendy S. Parsons, in a field survey on JUNE 11, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. NOT SET BY GLO

2. MAY 21, 1843 - COUNTY SURVEYOR NOTES - A. JACKSON

20" WHITE OAK N19-1/2°E 50 LINKS (33')

18" WHITE OAK N10°W 9 LINKS (5.94')

A6 - A5 = 157 RODS, 32 LINKS (2611.62')

A6 - C6 = 135 RODS, 21 LINKS = 2241.

3. UNDATED - SURVEY OF FREEMAN MASON DRAIN (LOCATED IN CETA FILES)
WEST 10.6 CHAINS (699.6')

4. JANUARY 1, 1972 INGHAM COUNTY ROAD COMMISSION - NO INFORMATION
FOUND

NO ADDITIONAL INFORMATION FOUND.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION FOR CORNER. NO EVIDENCE OF CORNER LOCATED. CALCULATED POSITION FOR BUNKER HILL CORNER A6 MIDWAY BETWEEN CORNERS A5 AND A7 ON THE LINE BETWEEN LESLIE CORNERS M5 (AS FOUND AND RESET BY YOUNG, LIBER 6, PAGE 10) AND M6 (AS SET BY ENGER, LIBER 7, PAGE 264). SAID POSITION IS 0.5' SOUTH OF A FENCE RUNNING TO THE EAST AND 16 FEET EAST OF A FENCE RUNNING TO THE SOUTH. ACCEPTED CALCULATED POSITION OF A6 AND SET A 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" SAID POINT IS IN A WOODED AREA.

MEASURED IN 2007 AS: A6 - A5 2612.89', A6 - M5 = NORTH 1825.74', A6 - M6 = SOUTH 828.36', A6 - A7 = 2612.89', A6 - C6 = 2243.84'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET A 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" MIDWAY BETWEEN CORNERS A5 AND A7 ON THE LINE BETWEEN LESLIE CORNERS M5 (AS FOUND AND RESET BY YOUNG, LIBER 6, PAGE 10) AND M6 (AS SET BY ENGER, LIBER 7, PAGE 264). SAID POINT IS 0.5' SOUTH OF A FENCE RUNNING TO THE EAST AND 16 FEET EAST OF A FENCE RUNNING TO THE SOUTH AND IN A WOODED AREA.

N45°E 17.90' SET REMON NAIL & TAG, NORTHWEST SIDE 12" COTTONWOOD
N45°W 19.30 SET REMON NAIL & TAG, SOUTH SIDE 35" OAK
S80°W 8.45' SET REMON NAIL & TAG, NORTH SIDE 12" COTTONWOOD
S05°E 36.95' SET REMON NAIL & TAG, NORTHEAST SIDE 14" OAK

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2" ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

Signed by W/SR PS.

Date 10/29/07

Surveyor's Michigan License No. 47969

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/25/2007 PL

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													



LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey

T 1N R 1E A-7

2. Property Controlling
In Section

S T R

3. Miscellaneous
Property in Sec.

S T R

B: 13 P: 186 11/06/2007 01:23 PM
2007-047412 LAND CORNERS Receipt #34179
Paula Johnson, Ingham County, Michigan

Pages: 2



Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Wendy S. Parsons, in a field survey on June 11, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

SEE PAGE 2

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEE PAGE 2

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REPLACED 1/2" PINCHED PIPE WITH 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" AS THE AMENDED CORNER. ALSO SET 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" 6.48' TO THE EAST ON THE LESLIE M6-M7 LINE AS THE STANDARD CORNER

AMENDED CORNER

REPLACED FOUND 1/2" PINCHED PIPE WITH 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769"

SOUTH 367' CENTERLINE OF KINNEVILLE ROAD
SOUTH 252' MAPLE TREE
N10°E 27.15' CENTER OF 3" STEEL ANCHOR POST
N80°E 67.49' FOUND NAIL & TAG #25832 NORTH SIDE 36" BOX ELDER
SOUTH 72.16' SET REMON NAIL & TAG TOP OF GUARD RAIL POST
S60°W 106.05' SET REMON NAIL & TAG NORTH SIDE TWIN 8" ASH
EAST 6.48' SET STANDARD REMONUMENTATION CORNER A7

STANDARD CORNER

SET 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" ON THE LESLIE M6-M7 LINE AS THE STANDARD CORNER

SOUTH 367' CENTERLINE OF KINNEVILLE ROAD
SOUTH 252' MAPLE TREE
N10°E 26.47' CENTER OF 3" STEEL ANCHOR POST
N80°E 61.52' FOUND NAIL & TAG #25832 NORTH SIDE 36" BOX ELDER
S5°W 72.40' SET REMON NAIL & TAG TOP OF GUARD RAIL POST
S60°W 111.56' SET REMON NAIL & TAG NORTH SIDE TWIN 8" ASH
WEST 6.48' SET AMENDED REMONUMENTATION CORNER A7

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2" ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

Signed by W.S.P.

Date 10/29/07

Surveyor's Michigan License No. 47969

INGHAM COUNTY
BUNKER HILL TOWNSHIP
T1N-R1E
A7
PAGE 2

A. Description of original monument and accessories and/or subsequent restoration:

1. JANUARY-FEBRUARY 1826 - GLO - WAMPLER - INTERSECTED MERIDIAN

SOUTH 13.00 CHAINS (858') TO CORNER

WHITE OAK 8" S20E 13½ LINKS (8.91')

BLACK OAK 11" N64E 8 LINKS (5.28')

A7 - C7 = 34.39 CHAINS (2269.74'), A7 - M7(LESLIE TWP) = SOUTH 13.00 CHAINS (858')

2. MAY 20, 1845 - COUNTY SURVEYOR RECORDS - A. JACKSON, COUNTY SURVEYOR, CORNER NOT DESCRIBED

WHITE OAK 16 N29E 100 LINKS (66')

WHITE OAK 30 N88°E 99 LINKS (65.34')

BLACK OAK 36 S13-1/2E 15 LINKS (9.9')

A7-A8 = 159 RODS, 12 LINKS (2631.42')

3. APRIL 29, 1971 - PA 74 - LIBER 1, PAGE 1 - CLYDE K. STEPHENS, L.L.S. #3829

A. ORIGINAL MONUMENT NOT FOUND

B. 3/4" IRON PIPE FOUND IN THE CENTERLINE OF THE EXISTING SECTION LINE ROAD (KENNEVILLE ROAD) THE IRON FOUND IS ON A PROJECTION OF AN OLD FARM FENCE TO THE NORTH

C. THE 3/4" IRON PIPE FOUND WAS LEFT IN POSITION WITH THE FOLLOWING WITNESSES:

3" IRON PIPE FENCE POST	NORTH	27'
STEPHENS ENGINEERING TAG IN A 24" BOX ELDER TREE	N66°31'E	66.97'
STEPHENS TAG IN 40" MAPLE TREE	S5°42'W	252'

4. APRIL 29, 1971 - PA 132 - LIBER 1, PAGE 1 - CLYDE K. STEPHENS, L.L.S. #3829

FOUND ¾" IRON PIPE

3" IRON PIPE FENCE POST	NORTH	27'
STEPHENS ENGINEERING TAG IN A 24" BOX ELDER TREE	N66°31'E	66.97'
STEPHENS TAG IN 40" MAPLE TREE	S5°42'W	252'

5. APRIL 26, 1978 - C.E.T.A. FILES - LARRY A. BRYAN, L.L.S. #25832

FOUND PIPE WEST OF CURVE IN KINNEVILLE AS RECORDED L1, PG.1

N10°E 27.03' TO CENTER 3" PIPE ANCHOR POST

N80°E 66.90' TO N & T SOUTH SIDE OF BOX ELDER

S05°W 252.02' TO STEPHENS ENGINEERING TAG EAST SIDE LARGE MAPLE

7. JUNE 12, 1980 - PA 132 - LIBER 4, PAGE 68 - RONALD W. KELLER, L.L.S. #20707

FOUND ¾" IRON PIPE

S11°W 40" MAPLE 252.00'

S45°E C/L KINNEVILLE RD. 82.00'

N80°E 24" BOX ELDER 66.97'

A7 - C7 = 2264.03', A7-A8 = 2664.72'

8. JUNE, 1980 - PA 74 - LIBER 6, PAGE 65 - RONALD W. KELLER, L.L.S. #20707

A. (NO INFORMATION LISTED)

B. WEST 1/4 POST: SET CAPPED IRON IN FENCE TO EAST.

C. NORTHWEST CORNER:

S11°W	40" MAPLE	252.00'
S45°E	CENTERLINE KINNEVILLE ROAD	82.00'
N80°E	24" BOX ELDER	66.97'

NO ADDITIONAL INFORMATION LOCATED.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION OF SECTION CORNER. FOUND 1/2" PINCHED PIPE 367 FEET NORTH OF THE CENTERLINE OF KINNEVILLE ROAD AND 27 FEET SOUTH TO THE SOUTH END OF A FENCE LINE RUNNING TO THE NORTH. FOUND 3 WITNESSES IN CLOSE ACCORD WITH THOSE SET BY STEPHEN'S IN 1971. THE DISTANCE MEASURED TO THE SOUTHEAST CORNER OF SECTION 18 (C7) IS CONSISTENT WITH THE GLO RECORDS AND KELLER'S 1980 SURVEY. EXCAVATED TO 3 FEET AND NO ADDITIONAL EVIDENCE WAS LOCATED. SAID 1/2" PIPE 6.48' WEST OF LINE BETWEEN LESLIE CORNERS M6 (AS SET BY ENGER, LIBER 7, PAGE 264) AND M7 (AS REMONUMENTED BY PARSONS IN 2007) REPLACED 1/2" PINCHED PIPE WITH 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" AS THE AMENDED CORNER. ALSO SET 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" 6.48' TO THE EAST ON THE LESLIE M6-M7 LINE AS THE STANDARD CORNER

AMENDED CORNER:

A7 - A6 = 2612.89', A7 - M6 = NORTH 1784.53', A7 - M7 = SOUTH 850.92', A7 - A8 = 2664.06, A7 - C7 = 2264.03', A7 (AMENDED) - A7 (STANDARD) = EAST 6.48'

STANDARD CORNER:

A7 - A6 = 2612.89', A7 - M6 = NORTH 1784.53', A7 - M7 = SOUTH 850.87', A7 - A8 = 2664.06, A7 - C7 = 2257.55', A7 (STANDARD) - A7 (AMENDED) = WEST 6.48'

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey T 1N R 1E C-5
T R
T R
T R
2. Property Controlling S T R
In Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

B:13 P:6 11/17/06 8:31 AM
2006-057983 LAND CORNERS Receipt #19658
Paula Johnson, Ingham County, Michigan

Pages: 2



Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Wendy S. Parsons, in a field survey on APRIL 24, 2006 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- JANUARY-FEBRUARY, 1826 - GLO - J. WAMPLER,
SET POST AT CORNER OF SECTION 7,8,17 & 18
12" WHITE OAK S75-1/2°W 50-1/2 LINKS (33.33')
13" WHITE OAK N71°E 53 LINKS (34.98')
C6 - C5 = 40 CHAINS (2640 FEET), C5 - C4 = 40 CHAINS (2640 FEET),
C5 - A5 = 34.12 CHAINS (2251.92 FEET)
- JANUARY 17, 1843 - COUNTY SURVEYOR NOTES - A. JACKSON
13" WHITE OAK N71°E 53 LINKS (34.98')
- MAY 21, 1843 - COUNTY SURVEYOR NOTES - A. JACKSON
13" WHITE OAK N71°E 53 LINKS (34.98')
24" BLACK OAK N82°W 32 LINKS (21.12')
C5 - A5 = 135 RODS 14 LINKS (2236.74') (ALSO SHOWN AS 33.89 CHAINS = 2236.74'), C5 - C6 = 158 RODS 30 LINKS (2626.8')



CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION FOR CORNER. FOUND BENT BOAT SPIKE IN MONUMENT BOX IN THE CENTERLINE OF MERIDIAN ROAD (ASPHALT). FOUND THREE WITNESSES, TWO OF WHICH ARE CONSISTENT WITH ENGER'S 1989 INFORMATION. MEASUREMENT TO C4 TO THE NORTH WAS CONSISTENT WITH WHITE'S 1972 SURVEY. EXCAVATED TO 3.0 FEET. NO ADDITIONAL INFORMATION WAS FOUND. REPLACED FOUND BOAT SPIKE WITH 3/4" X 24" SOLID BAR AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 IN EXISTING MONUMENT BOX IN ASPHALT PAVEMENT IN THE CENTERLINE OF MERIDIAN ROAD.
MEASURED IN 2006 AS C5 - C4 = 2642.40'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REPLACED FOUND BOAT SPIKE WITH 3/4" X 24" SOLID BAR AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 IN EXISTING MONUMENT BOX IN ASPHALT PAVEMENT IN THE CENTERLINE OF MERIDIAN ROAD.

WEST 32.85' FOUND NORTHWEST EDGE ANGLE IRON FENCE POST
N50°E 127.45' NORTHWEST CORNER BRICK CHURCH
N15°E 155.65' FOUND TOP CENTER 4-1/2" DIAMETER FENCE POST
S19°W 87.65' REMON NAIL & TAG ON SOUTHEAST SIDE 14" ELM
S16°E 135.00' SOUTHWEST EDGE ANGLE IRON FENCE POST

P.A. 345 INGHAM COUNTY
PEER APPROVED 5/23/2006 *me*

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2" ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

Signed by *[Signature]*

Date 11/06/06

Surveyor's Michigan License No. 47969

INGHAM COUNTY
BUNKER HILL
T1N-R1E
C5

4. DECEMBER 21, 1846 - COUNTY SURVEYOR NOTES - A. JACKSON
SAME AS GLO NOTES
C5 - A5 = 135 RODS (2227.5')

5. DECEMBER 26, 1846 - COUNTY SURVEYOR NOTES - A. JACKSON
SAME AS GLO NOTES
C5 - A5 = 33.75 CHAINS (2227.5'), C5 - C4 = 30.75 CHAINS (2029.50')

6. FEBRUARY 8, 1848 - COUNTY SURVEYOR NOTES - THOMAS J. BROWN, DEPUTY COUNTY
SURVEYOR
C5 - A5 = 135 RODS (2227.5')

7. MAY 15, 1848 - COUNTY SURVEYOR NOTES - A. JACKSON
SAME AS A6 ABOVE

8. MAY 10, 1888 - COUNTY SURVEYOR NOTES - (HANDWRITTEN IN GLO NOTES)
1" SUGAR MAPLE S47°W 45-1/2 (30.03')
1" SUGAR MAPLE N51°W 43 (28.38')

9. JANUARY 1, 1972 - INGHAM COUNTY ROAD COMMISSION GRID MAP
STONE CROCKERY
NW CORNER CHURCH SHED WALL 54.4'
SW COR. CHURCH 126.3'

10. CETA FILES - NO INFORMATION FOUND

11. DEC. 18, 1972 - PA 132 - LIBER 1, PAGE 614 - FRED WHITE, PS #12034
20" CHERRY, N65°00'E, 25.87'
20" MAPLE - EAST 56.40'
ANCHOR POST - WEST 27.33'
C4 - C5 = 3248.6' (PROBABLE TYPO - SHOULD READ 2642.08')

12. DEC. 19, 1972 - PA 74 - LIBER 2, PAGE 345 - 614 - FRED WHITE, PS #12034
A. ORIGINAL CORNER & WITNESSES OBLITERATED
B. FOUND BOAT SPIKE PRESUMED TO HAVE BEEN SET BY ICRC
C. BOAT SPIKE
20" CHERRY, N65°00'E, 25.87'
20" MAPLE - EAST 56.40'
ANCHOR POST - WEST 27.33'

13. OCTOBER 18, 1989 - PA 132 SURVEY - LIBER 6, PAGE 447 - RON ENGER, PS #28409
FOUND BOAT SPIKE
FD. NAIL & TAG #12034 N. SIDE 22" CHERRY, N80°E, 26.1'
METAL ANGLE IRON FENCE CORNER POST, WEST, 32.79'
SET 16d DUPLEX NAIL & SHINER E. SIDE 26" WALNUT, S20°E, 152.60'
CL. 30"+ TREE WITH SPLIT TRUNK (NOT A MAPLE), EAST 56.6'
NW CORNER BRICK CHURCH, N50°E, 127.5'
TOP CENTER 4-1/2" DIA. STEEL PIPE FENCE POST, N15°E, 155.8'
C5 - C4 = 2642.44'

14. MAY 6, 1992 - PA 132 SURVEY - LIBER 6, PAGE 1138 - RON HELSEL, PS #18994
REFERS TO LIBER 2, PAGE 347
N&T 12034 20" CHERRY N65°E, 25.81'
N&T 12034 20" MAPLE EAST 56.40'
NE/COR ST. ANG. PST WEST, 32.80'
N&T N/SD WD FNC. PST S60°W 38.28'
C5 - C4 = 2642.55'

15. AUGUST 12, 1993 - PA 132 SURVEY - LIBER 7, PAGE 66 - RON ENGER, PS #28409
BOAT SPIKE
FD. NAIL & TAG #12034 N. SIDE 22" CHERRY, N80°E, 26.1'
METAL ANGLE IRON FENCE CORNER POST, WEST, 32.79'
SET 16d DUPLEX NAIL & SHINER E. SIDE 26" WALNUT, S20°E, 152.60'
CL. 30"+ TREE WITH SPLIT TRUNK (NOT A MAPLE), EAST 56.6'
NW CORNER BRICK CHURCH, N50°E, 127.5'
TOP CENTER 4-1/2" DIA. STEEL PIPE FENCE POST, N15°E, 155.8'
C5 - C4 = 2642.44'

16. NO FURTHER EVIDENCE FOUND



LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey T 1N R 1E C-6
T R
T R
T R
2. Property Controlling S T R
In Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

B: 13 P: 188 11/06/2007 01:23 PM
2007-047414 LAND CORNERS Receipt #34179
Paula Johnson, Ingham County, Michigan

Pages: 2



Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Wendy S. Parsons, in a field survey on MAY 29, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:

1. GLO - SET QUARTER POST
WHITE OAK 16 N20-1/2°W 6 LINKS (3.96')
WHITE OAK 20 S58-1/2°E, 58-1/2 LINKS (38.61')
C6 - C5 = 40 CHAINS (2640')
C6 - C7 = 40 CHAINS (2640')

CONTINUED ON BACK

P.A. 345 INGHAM COUNTY

PEER APPROVED 6/19/2007 AL

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION FOR CORNER. ONLY FOUND ONE PREVIOUSLY NOTED WITNESS BUT DID FIND FENCES AS DESCRIBED IN ITEMS A5 & A6 ABOVE. LOCATED MULTIPLE CORNERS FROM BOSS SURVEY NOTED IN ITEM A6. USED THESE IRONS TO CALCULATE C6 POSITION. CALCULATED POSITION WAS IN CLOSE ACCORD TO FOUND FENCE POST TO WEST AND CORNER C7 TO THE SOUTH. THIS POSITION IS IN THE CENTERLINE OF MERIDIAN ROAD (ASPHALT) AND ON LINE WITH A FENCE LINE RUNNING TO THE WEST AND A FENCE LINE RUNNING TO THE EAST. EXCAVATED THROUGH A 4" LAYER OF ASPHALT AND ANOTHER 3" LAYER OF ASPHALT TO GRAVEL BED, EXCAVATED TO A TOTAL DEPTH OF 18" TO CLAY LAYER NO ADDITIONAL EVIDENCE WAS LOCATED. CALCULATED POSITION OF CORNER C6 IS 14.24' SOUTH AND 4.14' WEST OF THE MIDPOINT BETWEEN CORNERS C5 & C7. ACCEPTED CALCULATED POSITION OF CORNER C6 IN THE CENTERLINE OF MERIDIAN ROAD AND SET 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" IN MONUMENT BOX.

MEASURED IN 2007 AS: C6 - C5 = 2647.13', C6 - C7 = 2619.84', C6 - A6 = 2243.85'

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

ACCEPTED POSITION OF CORNER C6 AS CALCULATED FROM BOSS SURVEY (ITEM A6 ABOVE) IN THE CENTERLINE OF MERIDIAN ROAD AND SET 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" IN MONUMENT BOX.

S88°W, 32.78' FOUND PK NAIL, NORTH SIDE FENCE POST
S88°E, 36.09' FOUND NAIL & TAG (UNREADABLE), NORTH SIDE OF FENCE POST
S20°E, 151.55' FOUND NAIL & TAG #28409 (RON ENGER), WEST SIDE FENCE POST
S22°E, 126.36' FOUND NAIL & TAG #28409 (RON ENGER), WEST SIDE FENCE POST
S06°E, 341.52' FOUND IRON & CAP #13574 (OSCAR BOSS)
S03°E, 680.34' FOUND IRON & CAP #13574 (OSCAR BOSS)



Signed by W.S.P. PS.

Date 10/29/07

Surveyor's Michigan License No. 47969

BUNKER HILL
INGHAM COUNTY

C6

PART A CONTINUED

2. JANUARY 17, 1843 - COUNTY SURVEYOR NOTES - A. JACKSON
CORNER NOT DESCRIBED

WITNESSES: WHITE OAK 15" S15-3/4°W 24 LINKS (15.84')

3. MAY 21, 1843 - COUNTY SURVEYOR NOTES - A. JACKSON
CORNER NOT DESCRIBED

WITNESSES: WHITE OAK 15" S15-3/4°W 24 LINKS (15.84')

C6 - A6 = 135 RODS 21 LINKS (2241.36')

C6 - C5 = 158 RODS 30 LINKS (2626.8')

4. NOVEMBER 28, 1845 - COUNTY SURVEYOR NOTES - A. JACKSON
CORNER NOT DESCRIBED

WITNESSES: WHITE OAK 15" S15-3/4°W 24 LINKS (15.84')

C6 - D6 = 159 RODS 14 LINKS (2633.4')

5. AUGUST 8, 1972 (REC. SEPT 1, 1978) - PA 74 - LIBER 5, PAGE 6, OSCAR BOSS, PS #13574

A. UNKNOWN

B. 1/2" BOLT FD AT INTERSECTION OF ROAD AND FENCE TO EAST

C. FOUND 1/2" BOLT

S89°E 20.97' - PK NAIL FD S. SIDE TEL. POLE

S34°W 38.75' - NAIL E. SIDE 36" BOX ELDER STUMP

WEST 32.77' PK FD N. SIDE FENCE POST

6. SEPTEMBER 7, 1972 - PA 132 SURVEY, LIBER 1, PAGE 468 - OSCAR BOSS, PS #13574
FOUND 1/2" BOLT

S89°E 20.97' - PK NAIL FD S. SIDE TEL. POLE

S34°W 38.75' - NAIL E. SIDE 36" BOX ELDER STUMP

WEST 32.77' PK FD N. SIDE FENCE POST

C6 - D6 = 2640.96', C6 - C7 = 2619.57'

NO ADDITIONAL INFORMATION LOCATED.

FILED

LIBER 8 PAGE 305

Nov 22 11 47 AM '94

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
BUNKER HILL

For corners in

INGHAM

(County)

Located In:

Corner Code ##

REGISTER OF DEEDS

James J. Johnson

INGHAM COUNTY, MICH.

1. Public Land Survey	T <u>1N</u> R <u>1E</u>	<u>C-7</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Maurice H. Mahieu, in a field survey on October 10, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- Original GLO survey completed by Joseph Wampler between January 30 and February 6, 1826. Set a post at the corner of the section at a distance of 80 chains, witnessed by:
12" Maple N 77 1/2° E 27 1/2 links
18" Maple S 62° E 48 links
- Corner noted in field survey done by A. Jackson, County Surveyor, November 28, 1845 (L-1, P-79) same witnesses as in GLO survey.


(Over)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1" Iron Rod in Monument Box at intersection of centerline of Kinneville Road and extension centerline of Meridian Road, north. Found USGS marker witness as called for in A-5. All other witnesses gone. Removed rod and dug down in monument box. Found nothing. Excavated to 3 foot down and around and to west of monument box. Excavated west due to witness differences between Hickory in A-3 and witnesses in A-5 and A-6. Found nothing. Accepted position of 1" rod as location of corner based on excavation that did not produce any other evidence of a corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

3/4" Rod w/cap P.A. 345, P.S. #28414 Set in Location of 1" Rod in Monument Box
Nail and Tag West Side Utility Pole, N 04° E 159.21'
Nail and Tag West Side Guy Pole, N 04° W 159.54'
Nail and Tag North Side Fence Post, S 00° W 33.54'
NW Corner House #4010, S 30° E 85.75'

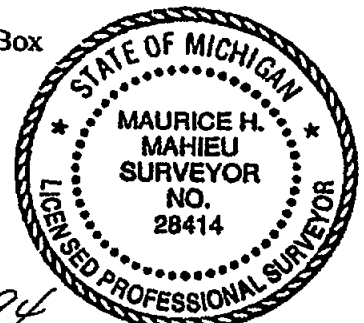

Signed by

Maurice H. Mahieu

Date

11-9-94

Surveyor's Michigan License No.

#28414

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1993

2703

P.A. 345 INGHAM COUNTY
PEER APPROVED 10/12/94 *u*

A. (Continued)

3. Ingham County Road Commission identified corner by an iron brick. Witnessed by:
16" Hickory 141.9' WNW
12" Hickory 66.0' ESE
4. Ingham County Grid Map dated January 1, 1972, calls for a 5/8" Round Iron (1971) witnessed by:
20" Hickory ESE 62.74', Corner Post S 24.23 feet, T.P. SSW 20.75'
5. Recorded Act 74 L.C.R.C. August 21, 1972, by Oscar Boss (L-5, P-6).
Found 3/4" rod at intersection of roads. Witnessed by:
P.K. Found North side 20" Hickory, S 76° E 62.71'
Center top USGS Marker, S 20° E 19.05'
Nail East side Telephone Pole, S 21° W 20.67'
6. Recorded Act 74 L.C.R.C. June 1980 by Ronald W. Keller, Land Surveyor (L-6, P-64).
Found 1" Iron Rod in centerline roads North, East, and West in line with fence going South.
Witnessed by:
Telephone Pole, S 21° W 20.62'
18" Hickory, S 74° E 62.73'
West leg of sign, N 02° E 29.61'