

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey T 1N R 1E A-7
T R
T R
T R
2. Property Controlling S T R
In Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

B: 13 P: 186 11/06/2007 01:23 PM
2007-047412 LAND CORNERS Receipt #34179
Paula Johnson, Ingham County, Michigan

Pages: 2



Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Wendy S. Parsons, in a field survey on June 11, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

SEE PAGE 2

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEE PAGE 2

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REPLACED 1/2" PINCHED PIPE WITH 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" AS THE AMENDED CORNER. ALSO SET 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" 6.48' TO THE EAST ON THE LESLIE M6-M7 LINE AS THE STANDARD CORNER

AMENDED CORNER

REPLACED FOUND 1/2" PINCHED PIPE WITH 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769"

SOUTH 367' CENTERLINE OF KINNEVILLE ROAD
SOUTH 252' MAPLE TREE
N10°E 27.15' CENTER OF 3" STEEL ANCHOR POST
N80°E 67.49' FOUND NAIL & TAG #25832 NORTH SIDE 36" BOX ELDER
SOUTH 72.16' SET REMON NAIL & TAG TOP OF GUARD RAIL POST
S60°W 106.05' SET REMON NAIL & TAG NORTH SIDE TWIN 8" ASH
EAST 6.48' SET STANDARD REMONUMENTATION CORNER A7

STANDARD CORNER

SET 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" ON THE LESLIE M6-M7 LINE AS THE STANDARD CORNER

SOUTH 367' CENTERLINE OF KINNEVILLE ROAD
SOUTH 252' MAPLE TREE
N10°E 26.47' CENTER OF 3" STEEL ANCHOR POST
N80°E 61.52' FOUND NAIL & TAG #25832 NORTH SIDE 36" BOX ELDER
S5°W 72.40' SET REMON NAIL & TAG TOP OF GUARD RAIL POST
S60°W 111.56' SET REMON NAIL & TAG NORTH SIDE TWIN 8" ASH
WEST 6.48' SET AMENDED REMONUMENTATION CORNER A7

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2 " ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

Signed by W.S.P.

Date 10/29/07

Surveyor's Michigan License No. 47969

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													



P.A. 345 INGHAM COUNTY
PEER APPROVED 9/25/2007 Pa

INGHAM COUNTY
BUNKER HILL TOWNSHIP
T1N-R1E
A7
PAGE 2

A. Description of original monument and accessories and/or subsequent restoration:

1. JANUARY-FEBRUARY 1826 - GLO - WAMPLER - INTERSECTED MERIDIAN

SOUTH 13.00 CHAINS (858') TO CORNER

WHITE OAK 8" S20E 13½ LINKS (8.91')

BLACK OAK 11" N64E 8 LINKS (5.28')

A7 - C7 = 34.39 CHAINS (2269.74'), A7 - M7(LESLIE TWP) = SOUTH 13.00 CHAINS (858')

2. MAY 20, 1845 - COUNTY SURVEYOR RECORDS - A. JACKSON, COUNTY SURVEYOR, CORNER NOT DESCRIBED

WHITE OAK 16 N29E 100 LINKS (66')

WHITE OAK 30 N88°E 99 LINKS (65.34')

BLACK OAK 36 S13-1/2E 15 LINKS (9.9')

A7-A8 = 159 RODS, 12 LINKS (2631.42')

3. APRIL 29, 1971 - PA 74 - LIBER 1, PAGE 1 - CLYDE K. STEPHENS, L.L.S. #3829

A. ORIGINAL MONUMENT NOT FOUND

B. 3/4" IRON PIPE FOUND IN THE CENTERLINE OF THE EXISTING SECTION LINE ROAD (KENNEVILLE ROAD) THE IRON FOUND IS ON A PROJECTION OF AN OLD FARM FENCE TO THE NORTH

C. THE 3/4" IRON PIPE FOUND WAS LEFT IN POSITION WITH THE FOLLOWING WITNESSES:

3" IRON PIPE FENCE POST	NORTH	27'
STEPHENS ENGINEERING TAG IN A 24" BOX ELDER TREE	N66°31'E	66.97'
STEPHENS TAG IN 40" MAPLE TREE	S5°42'W	252'

4. APRIL 29, 1971 - PA 132 - LIBER 1, PAGE 1 - CLYDE K. STEPHENS, L.L.S. #3829

FOUND ¾" IRON PIPE

3" IRON PIPE FENCE POST

STEPHENS ENGINEERING TAG IN A 24" BOX ELDER TREE	N66°31'E	66.97'
STEPHENS TAG IN 40" MAPLE TREE	S5°42'W	252'

5. APRIL 26, 1978 - C.E.T.A. FILES - LARRY A. BRYAN, L.L.S. #25832

FOUND PIPE WEST OF CURVE IN KINNEVILLE AS RECORDED L1, PG. 1

N10°E 27.03' TO CENTER 3" PIPE ANCHOR POST

N80°E 66.90' TO N & T SOUTH SIDE OF BOX ELDER

S05°W 252.02' TO STEPHENS ENGINEERING TAG EAST SIDE LARGE MAPLE

7. JUNE 12, 1980 - PA 132 - LIBER 4, PAGE 68 - RONALD W. KELLER, L.L.S. #20707

FOUND ¾" IRON PIPE

S11°W 40" MAPLE 252.00'

S45°E C/L KINNEVILLE RD. 82.00'

N80°E 24" BOX ELDER 66.97'

A7 - C7 = 2264.03', A7-A8 = 2664.72'

8. JUNE, 1980 - PA 74 - LIBER 6, PAGE 65 - RONALD W. KELLER, L.L.S. #20707

A. (NO INFORMATION LISTED)

B. WEST 1/4 POST: SET CAPPED IRON IN FENCE TO EAST.

C. NORTHWEST CORNER:

S11°W	40" MAPLE	252.00'
S45°E	CENTERLINE KINNEVILLE ROAD	82.00'
N80°E	24" BOX ELDER	66.97'

NO ADDITIONAL INFORMATION LOCATED.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION OF SECTION CORNER. FOUND 1/2" PINCHED PIPE 367 FEET NORTH OF THE CENTERLINE OF KINNEVILLE ROAD AND 27 FEET SOUTH TO THE SOUTH END OF A FENCE LINE RUNNING TO THE NORTH. FOUND 3 WITNESSES IN CLOSE ACCORD WITH THOSE SET BY STEPHEN'S IN 1971. THE DISTANCE MEASURED TO THE SOUTHEAST CORNER OF SECTION 18 (C7) IS CONSISTENT WITH THE GLO RECORDS AND KELLER'S 1980 SURVEY. EXCAVATED TO 3 FEET AND NO ADDITIONAL EVIDENCE WAS LOCATED. SAID 1/2" PIPE 6.48' WEST OF LINE BETWEEN LESLIE CORNERS M6 (AS SET BY ENGER, LIBER 7, PAGE 264) AND M7 (AS REMONUMENTED BY PARSONS IN 2007) REPLACED 1/2" PINCHED PIPE WITH 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" AS THE AMENDED CORNER. ALSO SET 3/4" X 24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 49769" 6.48' TO THE EAST ON THE LESLIE M6-M7 LINE AS THE STANDARD CORNER

AMENDED CORNER:

A7 - A6 = 2612.89', A7 - M6 = NORTH 1784.53', A7 - M7 = SOUTH 850.92', A7 - A8 = 2664.06, A7 - C7 = 2264.03', A7 (AMENDED) - A7 (STANDARD) = EAST 6.48'

STANDARD CORNER:

A7 - A6 = 2612.89', A7 - M6 = NORTH 1784.53', A7 - M7 = SOUTH 850.87', A7 - A8 = 2664.06, A7 - C7 = 2257.55', A7 (STANDARD) - A7 (AMENDED) = WEST 6.48'

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey

T 1N R 1E A-8

2. Property Controlling
In Section

S T R

3. Miscellaneous
Property in Sec.

S T R

B: 14 P: 40 11/26/2008 09:38 AM
2008-045286 LAND CORNERS Receipt #48351
Paula Johnson, Ingham County, Michigan

Pages: 2



Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Wendy S. Parsons, in a field survey on January 16, 2007 AND February 13, 2008 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

SEE SHEET 2

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEE SHEET 2

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REPLACED 1/2" REBAR WITH 3/4" X 24" FORM PIN AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 AS THE BUNKER HILL AMENDED CORNER FOR A8. ALSO SET 3/4" X 24" FORM PIN AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 FOR THE STANDARD CORNER 3.57' EAST ON INTERSECTION OF THE MERIDIAN LINE WITH THE A7(AMENDED) - C7 LINE.

PROPERTY CONTROLLING CORNER - A8

N41°E, 15.60' SET REMON NAIL & TAG, NORTHWEST SIDE 12" BOX ELDER
EAST 23.67' SET NAIL & TAG NORTH SIDE 10" OAK
S57°E 12.20', SET NAIL & TAG NORTHEAST SIDE 16" OAK
S12°E, 0.60' NORTH SIDE 6" CHERRY
EAST 1.35' NORTH-SOUTH FENCE
N88°E, 3.57' REMON CORNER - A8 (ON MERIDIAN)

CORNER - A8 (ON MERIDIAN)

N30°E, 13.43' SET REMON NAIL & TAG, NORTHWEST SIDE 12" BOX ELDER
EAST 20.10' SET NAIL & TAG NORTH SIDE 10" OAK
S45°E 9.43', SET NAIL & TAG NORTHEAST SIDE 16" OAK
S80°W, 3.50 FEET NORTH SIDE 6" CHERRY
WEST 2.22' NORTH-SOUTH FENCE
S88°W, 3.57' PROPERTY CONTROLLING CORNER - A8

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2" ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"



P.A. 345 INGHAM COUNTY

PEER APPROVED 3/19/2008

Signed by WSP

Date 11/21/08

Surveyor's Michigan License No. 47969

INGHAM COUNTY
BUNKER HILL
T1N-R1E
A8
PAGE 2

A. Description of original monument and accessories and/or subsequent restoration:

1. NOT SET BY GLO

2. NO INFORMATION IN COUNTY SURVEYOR NOTES

3. JUNE, 1980 - PA 74 - LIBER 6, PAGE 65 - RONALD W. KELLER, L.L.S. #20707

A. (NO INFORMATION PROVIDED)

B. SET CAPPED IRON IN FENCE TO EAST

C. WEST 1/4 POST:

S5°E	10" HICKORY	14.50'
S45°E	15" HICKORY	12.00'
N45°E	6" HICKORY	25.45'
S75°E	10" HICKORY	24.08'
*SOUTH FENCE CORNER POST		150.00'

*SEE ITEM A5 BELOW

4. JUNE 12, 1980 - PA 132 - LIBER 4, PAGE 68 - RONALD W. KELLER, L.L.S. #20707

SET CAPPED IRON IN FENCE EAST

S5°E	10" HICKORY	14.50'
S45°E	15" HICKORY	12.00'
N45°E	6" HICKORY	25.45'
S75°E	10" HICKORY	24.08'

*SOUTH 150.00 FEET - EAST 1/4 POST, SEC. 24 (LESLIE M8)

*SEE ITEM A5 BELOW

5. UNDATED CETA FILE - HAND WRITTEN NOTE ON COPY OF 1980 KELLER SURVEY (ITEM A4 ABOVE) - STATES THAT WITNESSES FOR M8 ARE WRONG AND THAT CORNER IS 660' SOUTH OF A8

NO ADDITIONAL INFORMATION FOUND.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION FOR CORNER. FOUND 1/2" REBAR 1.35' FEET WEST OF FENCE RUNNING TO THE NORTH & SOUTH. SAID POINT IS ON LINE WITH FENCE RUNNING TO THE EAST. EXCAVATED TO 3 FEET AND FOUND NO ADDITIONAL EVIDENCE OF CORNER. ALSO EXCAVATED AT FENCE INTERSECTION AND NO ADDITIONAL INFORMATION WAS FOUND. SAID 1/2" REBAR IS 3.57' WEST OF THE MERIDIAN LINE AS MEASURED FROM LESLIE CORNER M9 TO LESLIE CORNER M8. REPLACED 1/2" REBAR WITH 3/4" X 24" FORM PIN AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 AS THE BUNKER HILL AMENDED CORNER FOR A8. ALSO SET 3/4" X 24" FORM PIN AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 FOR THE STANDARD CORNER 3.57' EAST ON INTERSECTION OF THE MERIDIAN LINE WITH THE A7(AMENDED) - C7 LINE.

AT THE REQUEST OF THE PEER GROUP, RETURNED TO SITE ON FEBRUARY 13, 2008. SEARCHED AN AREA STARTING 70 FEET TO NORTH OF THE REMONUMENTED CORNER OF A8 AND EXTENDED SEARCH SOUTH 70 FEET SOUTH OF THE SAID POINT. FOUND NO ADDITIONAL EVIDENCE OF THE CORNER OR ADDITIONAL FENCE LINES IN THE SEARCH AREA ALSO SEARCHED FOR EVIDENCE OF OTHER FENCE LINES RUNNING TO THE EAST. NO ADDITIONAL EVIDENCE WAS FOUND.

PROPERTY CONTROLLING CORNER (PCC) A8-

PCC - A8 - A8 = EAST 3.57',
PCC - A8 - M8 = NORTH 1813.20',
PCC - A8 - A7 = 2664.06',
PCC - A8 - C8 = 2284.40',
PCC - A8 - M8 = SOUTH 831.25',
PCC - A8 - A9 = 2598.31'

CORNER A8

A8 - PCC - A8 = WEST 3.57',
A8 - M8 = NORTH 1813.14',
A8 - A7 = 2664.29',
A8 - C8 = 2280.83',
A8 - M8 = SOUTH 831.31',
A8 - A9 = 2598.25'

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey T 1N R 1E A-9
T R
T R
T R
T R
2. Property Controlling S T R
In Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

B: 13 P: 187 11/06/2007 01:23 PM
2007-047413 LAND CORNERS Receipt #34179
Paula Johnson, Ingham County, Michigan

Pages: 2



Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Wendy S. Parsons, in a field survey on September 21, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:

SEE SHEET 2

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEE SHEET 2

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
COMPUTED CORNER LOCATION FALLS AT THE EDGE OF A LARGE STRIP CUT FOR GAS UTILITY LINES AND FALLS IN A LARGE PILE OF LOGS (APPROX. 15-20 LOGS PILED 3-4 DEEP). SET 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 324 47969 -WITNESS" ON THE LESLIE M8 - M9 LINE 21.79 FEET SOUTH OF A9. ALSO SET 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 324 47969 -WITNESS" ON THE A9-C9 LINE, 40.00 FEET EAST OF A9.

WITNESS POINT - SOUTH

SET 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 324 47969 WITNESS" WAS SET 21.79 FEET SOUTH OF BUNKER HILL CORNER A9 ON LINE BETWEEN BUNKER HILL A9 & LESLIE M9.

NORTH 21.79' COMPUTED LOCATION FOR BUNKER HILL CORNER A9

N60°E 45.61' WITNESS POINT SOUTH

N05°W 36.96' SET REMON NAIL & TAG, EAST SIDE 18" ASH (SET 5.5' ABOVE GRADE TO ALLOW MEASUREMENTS OVER LOG PILE)

N12°E 32.80' SET REMON NAIL & TAG, SOUTHEAST SIDE 15" WILD CHERRY

N15°W 23.15' SET REMON NAIL & TAG, SOUTHWEST SIDE MULTIPLE POPLAR (SET 1.5' ABOVE GRADE TO ALLOW MEASUREMENTS OVER LOG PILE)

N20°W 43.20' SET REMON NAIL & TAG, SOUTHWEST SIDE 6" CHERRY (SET 3' ABOVE GRADE TO ALLOW MEASUREMENTS OVER LOG PILE)

N30°E 115.51' GAS LINE MARKER

WITNESS POINT - EAST

3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 324 47969 WITNESS" WAS SET 40.00 FEET EAST OF BUNKER HILL CORNER A9 ON THE BUNKER HILL A9-C9 LINE WEST 40.00' COMPUTED LOCATION FOR BUNKER HILL CORNER A9

S60°W 45.61' WITNESS POINT SOUTH

N70°W 47.10' SET REMON NAIL & TAG, EAST SIDE 18" ASH (SET 5.5' ABOVE GRADE TO ALLOW MEASUREMENTS OVER LOG PILE)

N75°W 34.74' SET REMON NAIL & TAG, SOUTHEAST SIDE 15" WILD CHERRY

N89°W 46.15' SET REMON NAIL & TAG, SOUTHWEST SIDE MULTIPLE POPLAR (SET 1.5' ABOVE GRADE TO ALLOW MEASUREMENTS OVER LOG PILE)

N70°W 58.11' SET REMON NAIL & TAG, SOUTHWEST SIDE 6" CHERRY (SET 3' ABOVE GRADE TO ALLOW MEASUREMENTS OVER LOG PILE)

N10°E 81.52' GAS LINE MARKER

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2" ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

Signed by Wendy S. Parsons

Date 10/29/07

Surveyor's Michigan License No. 47969

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/25/2007 W

REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

INGHAM COUNTY
BUNKER HILL
T1N-R1E
CORNER A9

A. Description of original monument and accessories and/or subsequent restoration:

1. JANUARY-FEBRUARY 1826 – GLO WAMPLER - INTERSECTED MERIDIAN OUT WEST SIDE MARSH
(NOTE: DISTANCE TO M9 IS NOT LISTED)

ASH 9" N....W 26 -1/2 LINKS (17.49')

ELM 9" N7W 13 LINKS (8.58')

A9 – C9 = 35.39 CHAINS (2335.74')

2. FEBRUARY 12-13, 1877 – COUNTY SURVEYOR NOTES BOOK 3, P.23 – A.P. DRAKE,
FOUND ONE OF THE BEARING TREES BLOWN OVER AND WHAT APPEARED TO BE THE REMAINS OF THE
OTHER AND LOCATED THE CORNER AS NEAR AS IT COULD BE FROM THE EVIDENCE

IRONWOOD 8" N64W 34 LINKS (22.44')

BLACK OAK 8" S74-3/4W 22-1/2 LINKS (14.85')

A10 - A9 = 39.85 CHAINS (2630.1')

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED MULTIPLE LOCATION FOR CORNER. FOUND NO EVIDENCE OF ORIGINAL GLO WITNESSES OR
COUNTY SURVEYOR WITNESSES. CALCULATED A POSITION MIDWAY BETWEEN ADJOINING
GOVERNMENT CORNERS SET BY GLO (BUNKER HILL CORNERS A7 AND A11) ON THE LINE BETWEEN
LESLIE CORNERS M8 & M9). CALCULATED POSITION IS 2627.67' NORTH OF BUNKER HILL CORNER A10 AS
REMONUMENTED IN 2006. THIS IS IN VERY CLOSE ACCORD WITH THE 1877 COUNTY SURVEYOR CALL OF
2630.1 AND IS ON LINE WITH A TREE ROW TO THE EAST. SAID POINT FALLS AT THE EDGE OF A LARGE
STRIP CUT FOR GAS UTILITY LINES AND FALLS IN A LARGE PILE OF LOGS (APPROX. 15-20 LOGS PILED 3-4
DEEP). SET 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED
"INGHAM COUNTY PA 345 47969 -WITNESS" ON THE LESLIE M8 – M9 LINE 21.79 FEET SOUTH OF A9. ALSO
SET 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED " INGHAM
COUNTY PA 345 47969 -WITNESS" ON THE A9-C9 LINE, 40.00 FEET EAST OF A9.

A9 (CALCULATED POSITION)

A9 - A7 = 5262.32'

A9 - A8 = 2598.31'

A9 – M8 (LESLIE) = NORTH 1760.00'

A9 – C9 = 2307.53'

A9 – M9 (LESLIE) = SOUTH 877.11'

A9- A10 = 2627.67'

A9 – A11 = 5262.32'

A9 – A9 WITNESS (SOUTH) = 21.79'

A9 – A9 WITNESS (EAST) = 40.00'

FILED

LIBER 8 PAGE 305

Nov 22 11 47 AM '94

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
BUNKER HILL

For corners in

INGHAM

(County)

Located In:

Corner Code =#

REGISTER OF DEEDS

James J. Johnson
 INGHAM COUNTY, MICH.

- | | | |
|------------------------------------|-------------------------|------------|
| 1. Public Land Survey | T <u>1N</u> R <u>1E</u> | <u>C-7</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous | S _____ T _____ R _____ | _____ |
| Property in Sec. | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Maurice H. Mahieu, in a field survey on October 10, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. Original GLO survey completed by Joseph Wampler between January 30 and February 6, 1826. Set a post at the corner of the section at a distance of 80 chains, witnessed by:
 12" Maple N 77 1/2° E 27 1/2 links
 18" Maple S 62° E 48 links

2. Corner noted in field survey done by A. Jackson, County Surveyor, November 28, 1845 (L-1, P-79) same witnesses as in GLO survey.


(Over)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1" Iron Rod in Monument Box at intersection of centerline of Kinneville Road and extension centerline of Meridian Road, north. Found USGS marker witness as called for in A-5. All other witnesses gone. Removed rod and dug down in monument box. Found nothing. Excavated to 3 foot down and around and to west of monument box. Excavated west due to witness differences between Hickory in A-3 and witnesses in A-5 and A-6. Found nothing. Accepted position of 1" rod as location of corner based on excavation that did not produce any other evidence of a corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

3/4" Rod w/cap P.A. 345, P.S. #28414 Set in Location of 1" Rod in Monument Box
 Nail and Tag West Side Utility Pole, N 04° E 159.21'
 Nail and Tag West Side Guy Pole, N 04° W 159.54'
 Nail and Tag North Side Fence Post, S 00° W 33.54'
 NW Corner House #4010, S 30° E 85.75'

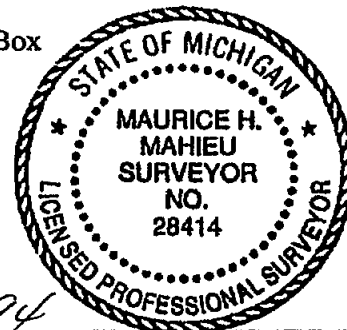

Signed by

Maurice H. Mahieu
 #28414

Date

11-9-94

Surveyor's Michigan License No.

#28414

 FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983

2703

 P.A. 345 INGHAM COUNTY
 PEER APPROVED 10/12/94 *MC*

A. (Continued)

3. Ingham County Road Commission identified corner by an iron brick. Witnessed by:
16" Hickory 141.9' WNW
12" Hickory 66.0' ESE
4. Ingham County Grid Map dated January 1, 1972, calls for a 5/8" Round Iron (1971) witnessed by:
20" Hickory ESE 62.74', Corner Post S 24.23 feet, T.P. SSW 20.75'
5. Recorded Act 74 L.C.R.C. August 21, 1972, by Oscar Boss (L-5, P-6).
Found 3/4" rod at intersection of roads. Witnessed by:
P.K. Found North side 20" Hickory, S 76° E 62.71'
Center top USGS Marker, S 20° E 19.05'
Nail East side Telephone Pole, S 21° W 20.67'
6. Recorded Act 74 L.C.R.C. June 1980 by Ronald W. Keller, Land Surveyor (L-6, P-64).
Found 1" Iron Rod in centerline roads North, East, and West in line with fence going South.
Witnessed by:
Telephone Pole, S 21° W 20.62'
18" Hickory, S 74° E 62.73'
West leg of sign, N 02° E 29.61'

FILED

LIBER 8 PAGE 307

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
BUNKER HILL

Nov 22 11 47 AM '94

For corners in

INGHAM
(County)

Located In:

Corner Code ==

REGISTER OF DEEDS

Paul J. Driscoll
INGHAM COUNTY, MICH.

1. Public Land Survey T 1N R 1E C-8
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

Maurice H. Mahieu

October 28

94

I, , in a field survey on , 19 , do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. Original GLO survey done by J. Wampler between Jan. 30 and Feb. 6, 1826. Set 1/2 mile post at a distance of 40 chains. Witnessed by:
16" W.O., N 50 1/2" E, 19 1/2 links
18" W.O., S 38 1/2 deg. E 29 links

(Over)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Discussion with property owner revealed that iron, rocks and fence lines were taken out to clear fence row. Owner owns all land surrounding corner. No previous information dating back to original GLO survey indicates the origin of any corner set or reason for the 1/2" rod found by R. Keller. This surveyor determined that this corner is lost. Set 3/4" x 24" iron rod with cap PA 345, P.S.# 28414 by single proportionate measurement between C-7 and C-9. Set rod 3 ft. below grade due to location of corner is in a open plowed field. Measured North 2629.37' to C-7; South 2629.37' to C-9, East 5265.29 to E-8.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" Iron Rod with cap "P.A. 345 #28414" Witnessed by:
C-7 NW Corner, Section 20, T1N, R1E, N 00 deg. 18' 47" E, 2629.37'
C-9 SW Corner, Sec. 20, T1N, R1E, S 00 deg. 18' 47" W, 2629.37'
D-8 Center of Section 20, T1N, R1E, S 89 deg. 54' 34" E, 2637.91'
BH1-15-17, 1/2" iron rod, N 80 deg. 41' 27" E, 1316.58'



Signed by Maurice H. Mahieu Date 11-14-94
Surveyor's Michigan License No. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/9/94 W

2704

A. (Continued)

2. LCRC Liber 6, Page 64, on June 3, 1980. Ronald W. Keller, PS #20707. Found 1/2" Re-bar in pile of rocks in line with fence East-West and 10", south of lane East-West witnessed by:
S 10" Elm 4.10"
N 87 deg. E Twin W.Cherry 61.88'
N 89 deg. W 20" Oak 95.77'
W 6" Fence Post 6.50'

Nov 22 11 47 AM '94

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

REGISTER OF DEEDS

INGHAM COUNTY, MICH.

For corners in

INGHAM
(County)

Located In:

Corner Code ~~##~~

- | | | |
|------------------------------------|---------------------------------|----------------|
| 1. Public Land Survey | T 1N R 1E | C-9 |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Maurice H. Mahieu, in a field survey on October 10, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. Original GLO Survey done by Joseph Wampler between January 30 and February 8, 1826. Post at corner of section at a distance of 80.00 chains, witnessed by:
20" W.O. S 22 deg. W 13 links
11" W.O. S 85 deg. W 23 links

2. Corner identified as a stone in a survey by A. P. Drake, County Surveyor, February 12 and 13, 1877 (V-3, P-125), Witnessed by:

6" Hickory N 86 deg. W 49 1/2 links

6" B. Walnut S 34 3/4 deg. W 71 1/4 links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(Over)

Found 1/2" rebar in Monument Box on centerline of Meridian Road. Checked witnesses of A-6 and they did not match with found rebar. Pulled dimension from Utility Pole, Hickory and Butternut of A-6. Dug in this location and found 1/2" iron rod encased in 4" dia. concrete as called for in A-6. Monument was 0.8' below road surface. Accepted monument as position of corner. The found 1/2" rebar was 0.6' West and 1.2' North of monument. Moved monument box to location of monument. Placed cap P.A. 345, P.S. #28414 on monument. Removed 1/2" bar and did not replace. This surveyor accepts the monument as the corner due to previous excavation and of occupation.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Left Monument w/cap #P.S. 28414 - P.A. 345 in place and witnessed by:

Nail and Tag #28414 South side 18" Butternut, S 85 deg. E 32.45'

Nail and Tag #28414 North side 24" Hickory, West 32.20'

Nail and Tag #28414 Northeast side 15" Walnut, S 15 deg. E 104.14'

Nail and Tag #28414 in East side Utility Pole, S 05 deg. E 209.90'

Signed by


Maurice H. Mahieu

Date

11-9-94

Surveyor's Michigan License No.

#28414

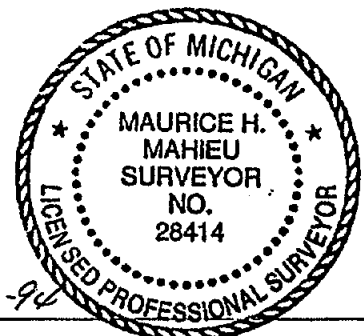

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

2705

P.A. 345 INGHAM COUNTY
PFR APPROVED 11/12/94 M

A. (Continued)

3. Corner referred to in a survey by E. A. Calkins, County Surveyor, November 15 and 16, 1901 (V-5, P-156).
4. Corner identified as a stone and crockery in the records of Consumer's Power Company, June 8, 1968. Witnessed by:
 - 12" Oak, NNW 51.8'
 - 10" Ash, SSW 59.1'
 - 18" Oak, East 116.1'
5. Corner identified a 1/2" x 24" iron in records of Ingham County Road Commission, revised Grid Map, 1972. Witnessed by:
 - 14" Hickory, East 43.45'
 - 30" Oak, West 32.11'
 - 18" Oak, Northwest 38.30'
6. Corner recorded and remonumented, Ronnie M. Lester, Land Surveyor, P.S. 18998, November 7, 1979 Survey (L-5, P-339). Corner was re-established by ICRP crew. Excavated a hole 10' x 10' to an average depth of 2.8' in the centerline of Meridian Road and in tree/fence line to East and West. Found pointed stone directly below found 1/2" bar. Accepted pointed stone for corner. Set 4" x 36" concrete monument with 1/2" x 38" rerod and cap #18998 with concrete collar and cover in location of pointed stone. Measured South 2,627' +/- to C-10. Witnessed by:
 - Nail and Tag #18998, South side 15" Butternut, ESE, 32.40'
 - Nail and Tag #18998, North side 24" Hickory, West, 32.07'
 - Nail and Tag #18998, East side 15" Ash, Southeast, 69.65'
 - Nail and Tag #18998, West side Power Pole, SSE, 210.53'