

32LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ingham  
(County)

Located In:

Corner Code #

BUNKER HILL TWP.

1. Public Land Survey

T 1N R 1E K-7  
T R  
T R  
T R

B: 13 P: 162 10/23/2007 03:29 PM  
2007-045714 LAND CORNERS Receipt #33555  
Paula Johnson, Ingham County, Michigan

Pages: 2



2. Property Controlling  
in Section

S T R  
S T R

3. Miscellaneous  
Property in Sec.

S T R  
S T R

4. Lot No. , Recorded Plat

5. Private Claims

Register of Deeds Stamp & File Number

I, ANTHONY BUMSTEAD, in a field survey on September 21, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1) Original corner set by Joseph Wampler, Deputy Surveyor in February 1826 at 80.00 chains "Set a post for the Corner of Secs 13, 14, 23&24" witnessed by:  
Iron 11 S. 11 links (7.26')  
Do 11 N33°E 26 links (17.16')
- 2) Volume 3 Page 140 of County Survey Records dated Nov. 3, 1857  
surveyor's name unreadable notes: Same witnesses as #1 above and "One tree out, set post"
- 3) Volume 3 Page 141 of County Survey Records dated April 14, 1879 by A. P. Drake notes:  
Ironwood 11 N33E 26 lks (17.16'), other tree gone set post
- 4) Volume 2 Pages 233 and 234 of County Survey Records dated April 29, 1890 by John McCreary notes:  
"Stone Double Hick. 10 S44°W 89 1/2"
- 5) Ingham County Road Commission Grid Map date unknown calls for "stone" witnessed by:  
10" hickory N.W. 100.6'  
8" elm N.E. 39.9'  
Anch. Post E. 24.0'

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

CONTINUED ON BACK

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
Found 3/4" pipe & cap number unreadable 1.5' West of North leg of directional arrow sign at about 10" deep. Pipe falls on approximate centerline extensions of DeCamp Road West and Friermuth Road South. Excavated further and at 18" found a ±8" rock at East base of pipe. All the remaining witnesses listed in Part "A" above check with the pipes location. I believe the rock is the perpetuation of McCreary's location, and replaced the pipe with a standard Ingham County Remonumentation bar and cap as noted below.  
Measured East to L-7) 2639.16' Measured South to K-8) 2624.04'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" solid bar with aluminum Ingham County Remonumentation Cap stamped "Ingham County PA 345 41095"  
Found nail & tag #28414 (Maurice H. Mahieu) North side 14" maple, S60°W, 86.00'  
Found nail & tag #28414 East side 16" maple, S45°W, 80.48'  
Found nail & tag #28414 East side 12" maple, S35°W, 97.40'  
Found nail & tag #28414 North side 10" maple, S70°W, 106.38'  
Centerline of riser box, S60°E, ±26'

Signed by

*Anthony Bumstead*

Surveyor's Michigan License No. 41095

P.A. 345 INGHAM COUNTY  
PEER APPROVED 9/25/2007

Date 9/26/07



**PART A CONTINUED: K-7, T1N R1E**

- 6) P.A. 74 Corner recorded in Liber 3 Page 323 on January 29, 1975 by George M. Young:  
Part A: "Original Monument not found"  
Part B: "Found Railroad spike set beside stone" witnessed by:  
PK nail in 8" cedar N10°E 49.68'  
PK nail in 8" cedar N20°E 44.70'  
16" Nail in P Pole N45°W 38.00'
- 7) P.A. 132 Surveys recorded in Liber 2 Page 268 on January 29, 1975 by George M. Young, P.S. No. 17640:  
Same monument & witnesses as No. 6 above
- 8) Traverse Point Witness Report from Ingham County Survey & Remonumentation Project dated 4-21-78 by M. Whipple:  
"Fd. R.R. spike according to Liber 3 Page 323 on physical C/Ls" witnessed by:  
N30°W 37.96' N&R on SW side P.P.  
S70°E 26.14' Top center Bell box  
N70°W 101.28' Set N&T on NE side 12" hickory
- 9) P.A. 132 Survey recorded in Liber 4 Page 430 on December 18, 1981 by Ronnie M. Lester, P.S. 18998:  
"Found RR Spike" Witnessed by:  
Nail & Ribbon in west side power pole, N45°W, 38.00'  
Nail & tag in west side 4" Elm, S50°E, 25.86'  
Center of top of telephone cable box, S60°E, 26.18'  
Centerline of Road sign post, S45°W 60.53'  
Survey shows distance North to K-6: 2650.60'
- 10) P.A. 74 Corner recorded in Liber 7 Page 116 on May 10, 1989 by Timothy Van Gieson:  
Part B: "Found Railroad spike. Set ¾" x 18" pipe in place of spike."  
60d in 8" Elm S36°E 25.98'  
SE Corner Garage S33°W 241.25'  
60d in power pole S68°W 258.75'  
60d in power pole N33°W 37.75'
- 11) P.A. 132 Survey recorded in Liber 5 Page 1055 on May 10, 1989 by Timothy VanGieson P.S. 24621:  
Witness & monument same as #10 above  
Survey shows distance East to L-7: 2639.11'
- 12) P.A. 132 Survey recorded in Liber 7 Page 45 on October 22, 1993 by Maurice Mahieu, P.C. #28414:  
"Found ¾" pipe with cap #24621" witnessed by:  
N & T #28414 W. Side Twin 8" Elm, S40°E, 20.28'  
N & T #28414 E. Side 6" Maple, SW 80.56'  
N & T #28414 E. Side 8" maple, SW 123.39'  
North leg directional arrow sign, east 1.24'  
Survey shows distance West to J-7: 2632.22'
- 13) P.A. 132 Surveys recorded in Liber 8 Page 100 on February 26, 1998 and Liber 8 page 167 on April 1, 1998 by Maurice Mahieu: "¾" pipe with cap #24621" witnesses identical to above #12 above.
- 14) P.A. 132 Survey recorded in Liber 8 Page 981 on April 24, 2002 by Maurice H. Mahieu, P.S. No. 28414:  
"Fnd ¾" pipe w/ yellow cap 1'± or - west of north leg of "arrow" sign" witnessed by:  
N & T #28414 N. Side 10" maple, S59°W, 85.88'  
N & T #28414 E. Side 12" maple, S39°W 80.29'  
N & T #28414 N. Side 6" maple, S69°W 106.25'  
N & T #28414 E. Side 12" maple, S27°W 97.18'
- 15) Unrecorded Enger Surveying & Engineering survey Job No. 33-1931 dated Feb. 28, 2007:  
"¾" pipe & cap 1'± west of north leg of arrow sign" witnessed by:  
Nail & tag #28414 N. side 10" maple, S59°W, 85.88'  
Nail & tag #28414 E. side 12" maple, S39°W, 80.29'  
Nail & tag #28414 E. side 12" maple, S27°W, 97.18'  
Nail & tag #28414 N. side 6" maple, S69°W, 106.25'  
Survey shows a distance East to L-7: 2639.31'  
Survey shows a distance South to K-8: 2624.06'

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ingham  
(County)

Located In: Corner Code #  
BUNKER HILL TWP.

B: 13 P: 163 10/23/2007 03:29 PM  
2007-045715 LAND CORNERS Receipt #33555  
Paula Johnson, Ingham County, Michigan

Pages: 2



1. Public Land Survey

T 1N R 1E K-8  
T R  
T R  
T R

2. Property Controlling  
in Section


S T R  
S T R

3. Miscellaneous  
Property in Sec.

S T R  
S T R

4. Lot No. , Recorded Plat

5. Private Claims

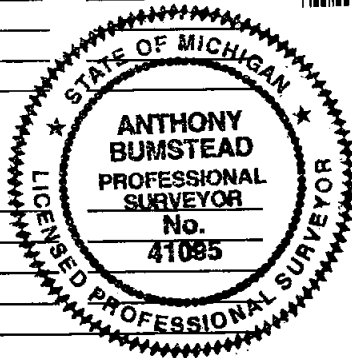

Register of Deeds Stamp & File Number

I, ANTHONY BUMSTEAD, in a field survey on September 24, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1) Original corner set by Joseph Wampler, Deputy Surveyor in February 1826 at 40.00 chains "Set ½ mile post" witnessed by:  
W.O. 8 S31°E 12 links (7.92')  
Do 7 S68°W 10 links (6.6')

2) Volume 3 Page 140 of County Survey Records dated Nov. 3, 1857 (surveyor's name unreadable) notes:  
Same witnesses as #1 above and "trees out set post"

3) Volume 3 Page 141 of County Survey Records dated April 14, 1879 by A. P. Drake notes:  
"Post in center of highway trees gone"

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found MAG nail 0.5' West of centerline of Freiermuth Road on fence line West, also found PK nail 5.5' South of MAG nail. Corner is in about 1.5 foot of fill area for road. Dug out MAG nail to North on fence line West, through 8" of asphalt, to a total depth of 3.5 feet. Found no additional evidence of corner. Based on the County Surveys listed in A-2 and A-3 above, I believe Enger's position opposite the fence is the correct location for K-8, and replaced the MAG nail with a standard Ingham County Remonumentation bar and cap.  
Measured North to K-7) 2624.04'  
Measured South to K-9) 2635.26'  
Measured East to L-8) 2637.11'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-8

Set 3/4" x 24" solid bar with aluminum Ingham County Remonumentation Cap stamped "Ingham County PA 345 41095" in a monument box  
Found nail & tag #28414 West side 36" hickory, N21°E, 70.41'  
Found nail & tag #28414 South side 36" hickory, S86°E, 28.33'  
Found nail & tag #28414 West side 30" oak, S37°E, 41.76'  
Found nail & tag #28414 South side 10" hickory, N80°W, 28.62'  
PK nail (Property Controlling Corner), South, 5.50'

Property Controlling Corner

(K-8 as recorded in Liber 3 Page 321)

Found PK nail 0.5' West of centerline

Found nail & tag #28414 West side 36" hickory, N19°E, 75.50'  
Found nail & tag #28414 South side 36" hickory, N85°E, 28.46'  
Found nail & tag #28414 West side 30" oak, S43°E, 37.50'  
Found nail & tag #28414 South side 10" hickory, N70°W, 30.16'  
Remon. bar & disk #41095 in monument box, North, 5.50'

Signed by Anthony Bumstead  
Surveyor's Michigan License No. 41095

P.A. 345 INGHAM COUNTY  
PEER APPROVED 09/25/2007

Date 10/10/07

**PART A CONTINUED: K-8, T1N R1E**

- 4) P.A. 74 Corner recorded in Liber 3 Page 321 on January 29, 1975 by George M. Young:  
Part A: "Original corner and accessories not found"  
Part B: "Set Railroad spike on line midway between K-9 and K-7" witnessed by:  
Nail in 30" oak N30°E 76.67'  
Nail in 24" hickory N85°E 29.06'  
Nail in 18" Oak S45°E 38.4'
- 5) P.A. 132 Surveys recorded in in Liber 2 Page 268 on January 29, 1975 and Liber 2 Page 1075 on April 29, 1977 by George M. Young, P.S. No. 17640:  
"Set railroad spike" witnesses are same as #4 above.
- 6) Traverse Point Witness Report from Ingham County Survey & Remonumentation Project dated 4-19-78 by M. Whipple:  
"Fd. R.R. spike according to Liber 3 Page 321 on physical C/L of Freiermuth Rd., 6'± South of physical C/L of fence line West & tree line East"" witnessed by:  
N85°E 29.07' Fd N&T on W. side 24" hickory  
S50°E 38.41' Fd n&T on N. side 18" oak  
N30°E 76.18' Set N&T on E. side 30" oak
- 7) P.A. 132 Survey recorded in Liber 7 Page 772 on February 23, 1996 by Maurice Mahieu, P.C. #28414:  
"Found railroad spike" witnessed by:  
N & T #28414 West side 28" oak, S45°E, 37.60'  
N & T #28414 South Side 28" hickory, N80°E 28.52'  
N & T #28414 west side 24" hickory, N20°E 75.66'  
N & T #28414 south side triple hickory, N68°W 30.21'
- 8) P.A. 132 Survey recorded in Liber 8 Page 981 on April 24, 2002 by Maurice H. Mahieu, P.S. No. 28414:  
"Fnd railroad spike c/l Freiermuth Rd opposite tree line to west" witnessed by:  
N & T #28414 West side 36" oak, S45°E, 37.61'  
N & T #28414 South Side 36" hickory, N84°E 28.58'  
N & T #28414 west side 36" hickory, N29°E 75.66'  
N & T #28414 south side triple hickory, N66°W 30.18'  
Survey shows distance North to K-7: 2629.64'  
Survey shows distance South to K-9: 2629.72'
- 9) Unrecorded Enger Surveying & Engineering survey Job No. 33-1931 dated Feb. 28, 2007:  
"Set mag nail 5.5' north of recorded corner on fence line to West" witnessed by:  
Nail & tag #28414 West side 36" hickory, N21°E, 70.39'  
Nail & tag #28414 South side 36" hickory, S86°E, 28.33'  
Nail & tag #28414 West side 30" oak, S37°E, 41.67'  
Nail & tag #28414 South side 10" hickory, N80°W, 28.62'  
Survey shows a distance South to K-9: 2635.29  
Survey shows a distance North to K-7: 2624.06'

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ingham  
(County)

Located In:

Corner Code #

BUNKER HILL TWP.

B: 13 P: 164 10/23/2007 03:29 PM  
2007-045716 LAND CORNERS Receipt #33555  
Paula Johnson, Ingham County, Michigan

Pages: 2



1. Public Land Survey

T 1N R 1EW K-9  
T R  
T R  
T R

2. Property Controlling  
in Section

S T R  
S T R

3. Miscellaneous  
Property in Sec.

S T R  
S T R

4. Lot No. , Recorded Plat

5. Private Claims

Register of Deeds Stamp & File Number

I, ANTHONY BUMSTEAD, in a field survey on September 21, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1) Original corner set by Joseph Wampler, Deputy Surveyor in February 1826 at 80.00 chains "Set a post for the Corner of Secs 23,24,25&26" witnessed by:  
W.O. 7 N34°E 12 links (7.92')  
Do 9 S60 ½°W 5 links (3.3')

2) Volume 3 Page 79 of County Survey Records dated July 8, 1855 by

A. Jackson notes: Same witnesses as #1 above and no monument noted

3) Volume 3 Page 172 of County Survey Records dated Feb. 9 1859 by T.J. Brown notes:

"A stone in ground top even with surface of ground" - no witnesses listed

4) Volume 3 Page 173 of County Survey Records surveyor and date not listed notes:

"A stone sunk even with the surface of the ground" - no witnesses listed

5) Ingham County Road Commission Grid Map date unknown calls for "square stone" witnessed by:

30" oak W. 12.1'

12" maple N.W. 141.4'

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found ¾" pipe and cap number unreadable in a monument box in the centerline of Freiermuth Road and 1'± North of centerline of Holland Road, with road being in about a two foot fill area. Excavated out pipe and at 2.6 feet hit the top of a rock that was too large to get out. The stone matches the witness to the 12" maple (now 36") of the Road Commission witnesses in #5 above. It also appears to match the remaining witnesses from the other surveys listed in Part A above. I believe the pipe and stone below it is the same as called for by T.J. Brown in A-3 above and replaced the pipe with a standard Ingham County Remonumentation bar and cap as noted below.

Measured East to L-9) 2634.92'

Measured North to K-8) 2635.26'

Measured South to K-10) 2635.72'

P.A. 345 INGHAM COUNTY  
PEER APPROVED 9/25/2007 PL

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" solid bar with aluminum Ingham County Remonumentation Cap stamped

"Ingham County PA 345 41095" in a monument box

Found nail & tag #28414 East side 36" maple, N25°W, 141.03'

Found nail & tag #28414 South side triple 10" oak, N80°W, 22.78'

Found Hughes nail & tag North side 22" hickory, S60°E, 71.97'

Found nail & tag #28414 North side 10" oak, S70°W, 21.81'

Set magnetic nail and 1 ½" aluminum tag stamped "INGHAM WITNESS PA 345" on:

East side 36" oak, S25°W, 132.06'

Signed by

*Anthony Bumstead*

Date

9/26/07

Surveyor's Michigan License No. 41095



**PART A CONTINUED: K-9, T1N R1E**

- 6) P.A. 74 Corner recorded in Liber 3 Page 321 on January 29, 1975 by George M. Young:  
Part A: "Original corner and accessories not found"  
Part B: "Found ¾" iron pipe" witnessed by:  
Nail in 20" oak S25°W 132.06'  
Nail in 15" hickory S45°E 71.57'  
Nail in 10" Oak N45°W 80.05'
- 7) P.A. 132 Surveys recorded in in Liber 2 Page 306 on February 26, 1975 and Liber 2 page 528 on November 6, 1975 by Oscar Boss, P.S. No. 13574:  
"Found ¾" pipe" witnessed by:  
N25°W 80.05' Nail found E/S 8" tree  
S15°W 132.03' Nail found E/S 18" tree  
S65°W 71.59' Nail found E/S 12" tree
- 8) P.A. 132 Survey recorded Liber 2 Page 1075 on April 29, 1977 by George M. Young, P.S. No. 17640:  
"Found ¾" iron" witnessed by:  
#16 Nail in power pole S45°W 74.59'  
#16 Nail in 15" hickory S70°E 71.55'  
#16 Nail in 10" oak N35°W 80.00'
- 9) P.A. 132 Survey recorded in Liber 3 Page 413 on July 11, 1978 by Austin Williams, P.C. #21275:  
Unidentified marker witnessed by:  
Nail in 15" Hickory S45°E 71.57'  
Nail in 20" oak S25°W 132.06'  
Nail in 10" Oak N45°W 80.05'  
Survey shows distance S. to K-11 as 5270.75'  
Survey shows distance E. to M-9 as 5264.90'
- 10) Traverse Point Witness Report from Ingham County Survey & Remonumentation Project dated 4-19-78 by M. Whipple:  
"Fd. ¾" pipe according to Liber 3 Page 321 on physical C/Ls" witnessed by:  
N45°W 80.03' Fd. #16 nail on E. side 10" oak  
S60°E 71.56' Fd. #16 nail & ribbon on N. side 12" hickory  
S25°W 132.03' Fd. #16 nail & ribbon on E. side 24" oak
- 11) P.A. 132 Survey recorded in Liber 8 Page 929 on October 22, 2001 by Maurice H. Mahieu, P.S. No. 28414:  
"Fnd ½" pipe" witnessed by:  
N & T #19834 (Darrell D. Hughes) N. Side 18" Hickory, S80°E, 71.95'  
N & T #19834 E. Side 10" oak, N10°W 36.60'  
N & T #19834 E. side 24" oak, S10°W 131.80'  
N & T #28414 N. side 10" oak, S80°W 21.81'  
Survey shows distance S. to K-10 as 2635.74'
- 12) P.A. 132 Survey recorded in Liber 8 Page 981 on October 22, 2001 by Maurice H. Mahieu, P.S. No. 28414:  
"Fnd ¾" iron rod at C/L intersection" witnessed by:  
N & T #19834 N. side 18" Hickory, S64°, 71.98'  
N & T #19834 NE. side twin 8" oak, N26°W 36.56'  
N & T #28414 S. side triple 8" oak, N69°W, 22.83'  
N & T #28414 N. side 10" oak, S64°W 21.85'  
Survey shows distance S. to k-10 as 2635.12'
- 13) Unrecorded Enger Surveying & Engineering survey Job No. 33-1931 dated Feb. 28, 2007:  
"1/2" pipe in mon box witnessed by:  
Nail & tag #28414 N. side 10" oak, S64°W, 21.85'  
Nail & tag #28414 S. side triple 8" oak, N69°W, 22.83'  
Nail & tag #19834 N. side 18" hickory, S64°E, 71.98'  
Nail & tag #19834 NE. side twin 8" oak, N26°W, 36.56'  
Survey shows a distance East to L-9: 2634.83'  
Survey shows a distance North to K-8: 2635.29'

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ingham Located In: Corner Code #  
(County)  
BUNKER HILL TWP.  
1. Public Land Survey T 1N R 1E L-7  
T R  
T R  
T R  
2. Property Controlling S T R  
in Section S T R  
3. Miscellaneous S T R  
Property in Sec. S T R  
4. Lot No. , Recorded Plat  
5. Private Claims

B: 13 P: 166 10/23/2007 03:29 PM  
2007-045718 LAND CORNERS Receipt #33555  
Paula Johnson, Ingham County, Michigan

Pages: 2



Register of Deeds Stamp & File Number

I, ANTHONY BUMSTEAD, in a field survey on September 21, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1) Original corner set by Joseph Wampler, Deputy Surveyor in February 1826 at 40.15 chains "Set 1/4 post at av. dist." witnessed by:  
Aspen 16 S87 1/2°W 6.70 links (4.42')  
no other

2) Volume 3 Page 141 of County Survey Records dated April 14, 1879 by  
A. P. Drake notes: "Post in marsh No Trees"

3) P.A. 74 Corner recorded in Liber 7 Page 117 on May 10, 1989 by Timothy VanGieson, P.S. No. 24621:

Part A: "Post, Government Notes: Aspen 16" S 87.5°W 6.7 chains"

Part B: "Set 3/4" x 48" pipe at pro-rated split between Southwest and southeast corners of section 13. (Iron falls on south edge of existing ditch)" witnessed by:  
60d in 12" maple N04°E 54.96'  
60d in clump 18" maples N90°E 116.15'  
60d in clump 2" maples S65°W 5.80'  
60d in 8" Elm N12°W 36.25'

CONTINUED ON BACK

P.A. 345 INGHAM COUNTY  
PEER APPROVED 9/25/2007  
*ru*

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 3/4" pipe and cap #24621 on South edge of East-West ditch on West edge of tree/woods line to North. Witnesses and distances to adjacent corners confirms that the surveys listed above have used this position. The 1879 Drake survey has the following distances: L-7 to N. 1/16 corner of NE 1/4 = 19.85 chains, N. 1/16 corner of NE 1/4 to M-7 = 19.85 chains, and K-7 to N. 1/16 corner of NW 1/4 = 19.86 chains. From this information, I believe VanGieson's method of placing corner at midpoint of line K-7 to M-7 is correct and therefore replaced his pipe with a standard Ingham County Remonumentation bar and cap as noted below.

Measured West to K-7) 2639.16'  
Measured East to M-7) 2639.45'  
Measured South to L-8) 2645.79'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" solid bar with aluminum Ingham County Remonumentation Cap stamped "Ingham County PA 345 41095"  
Found nail & tag #28414 West side 28" maple, N06°E, 54.74'  
Found nail & tag #28414 West side 20" maple, N16°E, 80.65'  
Found nail & tag #28414 West side 22" cherry, N30°E, 112.42'  
Set magnetic nail and 1 1/2" aluminum tag stamped "INGHAM WITNESS PA 345" on:  
East side 16" maple, N05°W, 77.67'

Signed by

*Anthony Bumstead*

Surveyor's Michigan License No. 41095

Date

9/26/07



**PART A CONTINUED: L-7, T1N R1E**

- 4) P.A. 132 Survey recorded in Liber 5 Page 1055 on May 10, 1989 by Timothy VanGieson P.S. 24621:  
"¾" x 48" pipe " witnesses identical to #3 above  
Survey shows distance West to K-7 as 2639.11 and distance East to M-7 as 2639.11
- 5) P.A. 132 Survey recorded in Liber 7 Page 1135 on May 27, 1997 by Ronald Enger P.S. 28409:  
"¾" pipe " witnesses identical to #3 above
- 6) P.A. 132 Survey recorded in Liber 8 Page 981 on April 24, 2002 by Maurice H. Mahieu, P.S. No. 28414:  
"Fnd ¾" iron pipe 1'+ or – south of south edge east- west drain and 10' + or – east of small north drain. Corner falls on west edge of woods, due south of major tree line in woods." witnessed by:  
N & T #28414 West side 28" maple, N6°E, 54.74'  
N & T #28414 West Side 18" elm, N16°E 80.65'  
N & T #28414 west side 21" cherry, N30°E 84.30'  
N & T #28414 west side 21" cherry, N44°E  
Survey shows distance W. to k-7 as 2639.18'
- 7) Unrecorded Enger Surveying & Engineering survey Job No. 33-1931 dated Feb. 28, 2007:  
No monument noted or witnessed but survey shows the following:  
Survey shows a distance East to M-7: 2639.44'  
Survey shows a distance West to K-7: 2639.31'  
Survey shows a distance South to L-8: 2645.80'



LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ingham  
(County)

Located In: Corner Code #  
BUNKER HILL TWP.

1. Public Land Survey

T 1N R 1E L-8  
T R  
T R  
T R

B: 13 P: 167 10/23/2007 03:29 PM  
2007-045719 LAND CORNERS Receipt #33555  
Paula Johnson, Ingham County, Michigan

Pages: 1



2. Property Controlling  
in Section

S T R  
S T R

3. Miscellaneous  
Property in Sec.

S T R  
S T R

4. Lot No. , Recorded Plat

5. Private Claims

Register of Deeds Stamp & File Number

I, ANTHONY BUMSTEAD, in a field survey on September 21, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1) Corner not set in Original Government Survey

2) Volume 3 Page 141 of County Survey Records dated April 14, 1879  
by A. P. Drake notes: no monument noted  
W. oak 18 N21 1/2°E 209 1/2 lks (138.27')

3) Unrecorded Enger Surveying & Engineering Job No. 33-1931

dated Feb. 28, 2007: "Set 5/8" bar & cap #28409 @ intersection 1 1/4 lines" witnessed by:

Nail & tag #25837 W. side 36" oak, N25°E, 395.92'

Nail & tag #25837 E. side 30" oak, N29°E, 390.75'

Nail & tag #25837 E. side 36" oak, N27°E, 440.27'

Nail & tag #25837 E. side 40" oak, N19°E, 423.85'

Survey shows a distance East to M-8: 2634.68'

Survey shows a distance West to K-8: 2636.94'

Survey shows a distance North to L-7: 2645.80'

Survey shows a distance South to L-9: 2649.72'

P.A. 345 INGHAM COUNTY  
PEER APPROVED 9/25/2007

*M*

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23			
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													



B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On June 11, 2007, found bar & cap #28409 in cultivated field, ±13' East of the centerline of a North-South drain. Found bar by shooting distances to Enger's four witnesses, which checked closely. There are no fences or occupation lines anywhere near the corner, only meandering drains. Also, the survey by A.P. Drake shows a distance to only one other identifiable corner from the center of Section, and the rest of the distances shown on his survey are not consistent with my measurements.

Therefore, as a lost corner, Enger's method of positioning his corner at the intersection of the 1/4 lines is a correct one.

Returned on September 20, to replace Enger's bar with a standard Ingham County Remonumentation bar and cap #41095.

The found Enger bar had been pulled out and reset on East side of drain at top of bank 8.26' N82°W of its previous location. I talked with Merlin Batdorff, property owner, and he said he pulled iron to get it out of field because it would get plowed out anyway. Left Enger bar as is and placed new bar at correct location, and buried in muck field 1' deep.

Measured North to L-7) 2645.79'

Measured East to M-8) 2634.42'

Measured South to L-9) 2649.73'

Measured West to K-8) 2637.11'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" solid bar with aluminum Ingham County Remonumentation Cap stamped "Ingham County PA 345 41095"

Found nail & tag #25837 W. side 36" oak, N25°E, 395.83'

Found nail & tag #25837 E. side 30" oak, N29°E, 390.69'

Found nail & tag #25837 E. side 36" oak, N27°E, 440.24'

Found nail & tag #25837 E. side 40" oak, N19°E, 423.80'

Found bar & cap #28409, N82°W, 8.26'

Signed by

*Anthony Bumstead*

Date

9/26/07

Surveyor's Michigan License No. 41095

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Ingham</u> (County)	Located In:	Corner Code #
	BUNKER HILL TWP.	
1. Public Land Survey	T <u>1N</u> R <u>1E</u> <u>L-9</u>	
	T <u>  </u> R <u>  </u>	
	T <u>  </u> R <u>  </u>	
	T <u>  </u> R <u>  </u>	
2. Property Controlling in Section	S <u>  </u> T <u>  </u> R <u>  </u>	
	S <u>  </u> T <u>  </u> R <u>  </u>	
3. Miscellaneous Property in Sec.	S <u>  </u> T <u>  </u> R <u>  </u>	
	S <u>  </u> T <u>  </u> R <u>  </u>	
4. Lot No. <u>  </u> , Recorded Plat <u>  </u>		
5. Private Claims <u>  </u>		

B: 13 P: 168 10/23/2007 03:29 PM Pages: 2  
2007-045720 LAND CORNERS Receipt #33555  
Paula Johnson, Ingham County, Michigan



Register of Deeds Stamp & File Number

I, ANTHONY BUMSTEAD, in a field survey on September 21, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1) Original corner set by Joseph Wampler, Deputy Surveyor in February 1826 at 39.89 chains "Set 1/4 post at av. dist." witnessed by:  
W.O. 22 N44°W 55 links (36.3')  
Do 32 N60°E 56 links (36.96')
- 2) Volume 3 Page 172 of County Survey Records dated Feb. 9 1859 by T.J. Brown:  
No monument noted or witnessed

CONTINUED ON BACK

P.A. 345 INGHAM COUNTY  
PEER APPROVED 9/25/2007

*Mc*

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" bar in concrete in a monument box ±6' North of centerline of Holland Road, ±15' West of centerline of field drive to the North. Extensive excavation performed in 1979 and 1980 by the Ingham County Survey and Remonumentation Program revealed a 7" iron machinery piece. I believe this iron, subsequently replaced with a concrete monument, represents the perpetuated location of L-9, and therefore glued an Ingham County Remonumentation disk on the bar as noted below.  
Measured West to K-9) 2634.92'  
Measured East to M-9) 2631.02'  
Measured North to L-8) 2649.73'  
Measured South to L-10) 2653.10'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" solid bar with aluminum Ingham County Remonumentation Cap stamped "Ingham County PA 345 41095" in a monument box  
Found nail & tag #18998 North side 16" hickory, S80°W, 92.30'  
Found nail & tag #18998 utility pole, N05°W, 90.80'  
Found Darrell Hughes P.S. #19834 nail & tag Southeast side fence post, N50°E, 32.95'  
Found Hughes nail & tag East side fence post, North, 16.60'  
Found nail & tag #28414 (Mahieu) North side 12" oak, S30°W, 41.02'  
Found nail & tag #28414 West side 12" hickory, S05°E, 36.77'  
Bar & cap #28409 (Enger), South, 33.00'



Signed by *Paula Johnson*

Date 9/26/07

Surveyor's Michigan License No. 41095

**PART A CONTINUED: L-9, T1N R1E**

3) P.A. 74 Corner recorded in Liber 6 Page 179 on June 1, 1981 by Ronnie Lester, P.S. No. 18998:

Part A: "Original government survey by J. Wampler, February 8, 1926.

Corner referred to in a survey by T.J. Brown, county surveyor, Feb. 10, 1859."

Part B: "Excavated 10' x 10' on occupation line south and centerline road east and west. Found no evidence of physical monumentation. Excavated 6' x 5' at computed location of corner. Found 7" Iron machinery piece at natural ground in excavation. Accepted this iron as perpetuated location of corner. Measured East 2631.20' Measured west 2634.69'. Corner falls 6' north of centerline of road approximately 7' east of fence line south. Excavation conducted by Ingham County Survey and Remonumentation crew."

Part C: "Set concrete monument and collar at location described above." witnessed by:

Nail & tag, #18998, North side 8" hickory NS80°W 92.30'

Nail & tag, #18998, North side 6" maple S45°W 67.58'

Nail & tag, #18998, Northeast side 6" poplar, S45°E, 64.22'

Nail & tag, #18998, telephone pole, North, 90.80'

5) Unrecorded Enger Surveying & Engineering survey Job No. 33-1931 dated Feb. 28, 2007:

No monument noted or witnessed but survey shows the following:

Survey shows a distance East to M-9: 2631.11'

Survey shows a distance West to K-9: 2634.83'

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ingham  
(County)

Located In:

Corner Code #

BUNKER HILL TWP.

1. Public Land Survey

T 1N R 1E M-7  
T     R      
T     R      
T     R    

B: 13 P: 170 10/23/2007 03:29 PM  
2007-045722 LAND CORNERS Receipt #33555  
Paula Johnson, Ingham County, Michigan

Pages: 2



2. Property Controlling  
in Section

S     T     R      
S     T     R    

3. Miscellaneous

S     T     R    

Property in Sec.

S     T     R    

4. Lot No.    , Recorded Plat    

5. Private Claims    

Register of Deeds Stamp & File Number

I, ANTHONY BUMSTEAD, in a field survey on September 21, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1) Original corner set by Joseph Wampler, Deputy Surveyor in February 1826 at 80.00 chains "Set post cor. Secs 13 & 14" witnessed by:  
B.O. 16 N10°W 217 links (143.22')  
No other bearing tree

2) Volume 3 Page 141 of County Survey Records dated April 14, 1879 by A. P. Drake notes:  
"Stone set for corner" with no witnesses given

3) Ingham County Road Commission Grid Map date unknown calls for "stone" with no witnesses

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 3/4" pipe and cap #24621 in a monument box 1' East of centerline of Parman Road in about 2'± of fill area for road. No fence or occupation found to the West. Excavated out bar and dug through 3 feet of gravel, then through 1 foot of black top soil. Nothing further was found below pipe. Extensive excavation was conducted in 1979 per Item A-4 above and nothing was found. Stone as called for in items A-2 and A-3 most likely tore out during road construction. I accept the method VanGieson used to reset a lost corner at the recorded for GLO falling distance 12 links South of A-7, T1N, R2E, and replaced his pipe with a standard Ingham County Remonumentation bar and cap.  
Measured West to L-7) 2639.45'  
Measured South to M-8) 2668.11'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" solid bar with aluminum Ingham County Remonumentation Cap stamped "Ingham County PA 345 41095" in a monument box  
Found nail & tag #28414 (Maurice Mahieu) South side 12" cherry, N63°E, 38.71'  
Found nail & tag #28414 North side 18" twin cherry, East, 52.46'  
Found nail & tag #18998 (Lester) below mag nail Southeast side power pole, S50°W, 47.25'  
Bar & cap #? in monument box (A-7, T1N, R2E), North, 7.92'

P.A. 345 INGHAM COUNTY  
PEER APPROVED 9/25/2007 re

Signed by

Anthony Bumstead

Date

9/26/07

Surveyor's Michigan License No. 41095



**PART A CONTINUED: M-7, T1N R1E**

- 4) Ingham County Survey & Remonumentation Project dated May & June 1979 performed excavation for M-7 and A-7, T1N R2E. A stone and pottery was found at A-7 and an LCRC was recorded for it by Ronnie Lester P.S. #18998 in Liber 5 Page 293. The excavation covered an area 11.6' South of found stone by 10' in East-West dimension by 2.5' in depth. No evidence of M-7 was found.
- 5) P.A. 74 Corner recorded in Liber 7 Page 119 on May 10, 1989 by Timothy VanGieson, P.S. No. 24621:  
Part A: "Post, Corner set during original Government survey. Did not obtain notes with original accessories."  
Part B: "Set 3/4" x 36" pipe 7.92 (12 links) South of southwest corner of Section 18, T1N, R2E, Stockbridge Township, Ingham County, Michigan. Said southwest corner was found in remonumentation survey. Corner recorded in Liber 5 page 293." witnessed by:  
60d in twin 18" Ash N28°E 83.84'  
60d in 10" cherry N63°E 39.28'  
60d in twin 10" cherry N89°E 52.71'  
60d in power pole S49°W 47.19'
- 6) P.A. 132 Survey recorded in Liber 5 Page 1055 on May 10, 1989 by Timothy VanGieson P.S. 24621:  
"3/4" x 36" pipe " witnesses identical to #5 above.  
Survey shows distance West to L-7: 2639.11
- 7) Unrecorded Enger Surveying & Engineering survey Job No. 33-1931 dated Feb. 28, 2007:  
No monument noted or witnessed but survey shows the following:  
Survey shows a distance South to M-8: 2668.08'  
Survey shows a distance West to L-7: 2639.44'

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ingham  
(County)

Located In:

Corner Code #

BUNKER HILL TWP.

1. Public Land Survey

T 1N R 1E M-8  
T R  
T R  
T R

B: 13 P: 171 10/23/2007 03:29 PM  
2007-045723 LAND CORNERS Receipt #33555  
Paula Johnson, Ingham County, Michigan

Pages: 1



2. Property Controlling  
in Section

S T R  
S T R

3. Miscellaneous  
Property in Sec.

S T R  
S T R

4. Lot No. , Recorded Plat

5. Private Claims

Register of Deeds Stamp & File Number

I, ANTHONY BUMSTEAD, in a field survey on September 24, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1) Original corner set by Joseph Wampler, Deputy Surveyor in February 1826 at 40.00 chains "Set 1/4 post on edge of prairie" witnessed by:

Aspen 13 S 66°W 6 1/2 links  
Hickory 8 N51 1/2°W 42 links

2) Volume 3 Page 141 of County Survey Records dated April 14, 1879

by A. P. Drake notes: no monument noted and witnesses same as #1 above

3) Unrecorded Enger Surveying & Engineering survey Job No. 33-1931 dated Feb. 28, 2007:

"Set mag nail 1/2 way on standard line" witnessed by:

Nail & tag #25837 NW. utility pole, N49°E, 119.06'  
Nail & tag #25837 NW. side 18" ash, S57°W, 65.19'  
Nail & tag #28414 SW. side 18" walnut, N50°W, 35.82'  
60D spike SW side utility pole, S34°E, 103.80'  
Survey shows a distance West to L-8: 2634.48'  
Survey shows a distance North to M-7: 2668.08'  
Survey shows a distance South to M-9: 2668.07'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found mag nail at witnesses called for by Enger 1 foot East of centerline of Parman Road. The Drake survey shows distances along four section lines, but my measurements were not consistent to come up with any kind of chain proportioning. There is no occupation to the West of the nail. Excavated below nail, through 10" of two layers of asphalt, through 2.5 feet of gravel, and 6" into black dirt. Found nothing below nail. Accepted corner as lost and Engers' method of resetting corner midpoint on line and replaced the nail with a standard Ingham County Remonumentation bar and cap and set a monument box over it.

Measured North to M-7) 2668.11' Measured South to M-9) 2668.01' Measured West to L-8) 2634.42'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" solid bar with aluminum Ingham County Remonumentation Cap stamped "Ingham County PA 345 41095" in a monument box

Found nail & tag #25837 Northwest side utility pole, N49°E, 119.06'

Found nail & tag #28414 (Maurice Mahieu) South side 18" ash, S57°W, 65.09'

Found nail & tag #28414 Southwest side 20" walnut, N50°W, 35.75'

Found 60D spike Southwest side utility pole, S34°E, 103.86'

Found 5/8" bar in monument box, South, 15.34'

Signed by

Date

9/26/07

Surveyor's Michigan License No. 41095



FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1995

P.A. 345 INGHAM COUNTY  
PEER APPROVED 9/25/2007 m

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ingham  
(County)

Located In:

Corner Code #

1. Public Land Survey

BUNKER HILL TWP.  
T 1N R 1E M-9  
T    R     
T    R     
T    R   

B: 13 P: 172 10/23/2007 03:29 PM  
2007-045724 LAND CORNERS Receipt #33555  
Paula Johnson, Ingham County, Michigan

Pages: 2



2. Property Controlling  
in Section

S    T    R     
S    T    R   

3. Miscellaneous  
Property in Sec.

S    T    R     
S    T    R   

4. Lot No.   , Recorded Plat   

5. Private Claims   

Register of Deeds Stamp & File Number

I, ANTHONY BUMSTEAD, in a field survey on September 21, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1) Original corner set by Joseph Wampler, Deputy Surveyor in February 1826 at 80.00 chains "Set post cor. Secs. 24 & 25" witnessed by:  
B.O. 16 S72°W 23 links (15.18')  
W.O. 8 N36°W 2 1/4 links (1.48')

2) P.A. 74 Corner recorded in Liber 1 Page 639 on July 18, 1972 by Ronnie Lester, P.S. No. 18998:  
Part A: "Original monument and accessories obliterated."

Part B: "Set 1/2" bar of centerline of Holland Rd. & Parman Rd. Original measurement West in close accord with measured distance west. Prorated measurements north and south." witnessed by:  
nail & tag East side power pole, NW, 75.78'  
nail & tag Northside 12" maple, SW 69.59'  
nail & tag West side fence post, SE, 46.74'

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" bar in monument box in the centerline of Parman Road, ±2' North of centerline of Holland Road, in about a four foot fill area of road intersection. All remaining witnesses from above surveys check with location of 1/2" bar. Accepted 1/2" bar and replaced the bar with a standard Ingham County Remonumentation bar and cap as noted below.  
Measured West to L-9) 2631.02'  
Measured North to M-8) 2668.01'  
Measured South to M-10) 2680.92"

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" solid bar with aluminum Ingham County Remonumentation Cap stamped "Ingham County PA 345 41095" in a monument box

Set magnetic nail and 1 1/2" aluminum tag stamped "INGHAM WITNESS PA 345" on:  
North side 24" walnut, S75°W, 143.43'  
West side 12" cherry, S40°E, 46.90'  
North side 24" maple, S40°W, 69.21'

Found nail & tag #28414 North side twin 10" cherry, S75°E, 37.66'

P.A. 345 INGHAM COUNTY  
PEER APPROVED 9/25/2007 M

Signed by

Date

9/26/07

Surveyor's Michigan License No. 41095



**PART A CONTINUED: M-9, T1N R1E**

- 3) P.A. 132 Survey recorded in Liber 1 Page 364 on July 18, 1972 by Ronnie M. Lester, P.S. 18998:  
"Set 1/2" bar" Witnesses identical to #2 above.  
Survey shows a distance South to M-11: 5323.91'
- 4) P.A. 74 Corner recorded in Liber 3 Page 115 on April 25, 1974 by Oscar Boss, P.S. #13574 for A-9, T1N R2E:  
Boss set iron at fence line and witnessed to M-9, T1N R1E: "North 35.54' 5/8" iron"
- 5) P.A. 132 Survey recorded in Liber 2 Page 260 on Jan 20, 1975 by James Halfacre, P.S. 7864:  
Found Iron, no witnesses given.
- 6) Traverse Point Witness Report from Ingham County Survey & Remonumentation Project dated 4-21-78 by M. Whipple:  
"Fd. 1/2" bar in mon. box according to Liber 1 Page 639, on physical C/Ls of Holland & Parman Rds, 32'± North of tree line East" witnessed by:  
N30°W 75.92' Set N&T on top center of cut PP  
N85°E 37.68' Set N&T on S.side 8" elm  
S30°E 84.84' Set N&T on W. side 6" fence post
- 7) P.A. 132 Survey recorded in Liber 3 Page 413 on July 11, 1978 by Austin Williams, P.C. #21275:  
Unidentified marker witnessed by:  
Nail & tag E/S p.p. NW 75.78'  
Nail & tag N/S 12" maple SW 69.59'  
Nail & tag W/S fence post SE 46.74'
- 8) P.A. 132 Survey recorded in Liber 8 Page 791 on December 28, 2000 by Maurice Mahieu, P.C. #28414:  
"1/2" iron rod at Parman and Holland roads" witnessed by:  
N & T #28414 N. Side 18" maple, S40°W, 69.00'  
N & T #28414 N. Side Twin 10" Cherry, S75°E, 37.66'  
N & T #28414 W. Side 10" Cherry, S40°E, 46.85'  
N & T #28414 N. Side wood post, S25°E, 62.91'  
Survey shows a distance South to M-11: 5325.11'
- 9) Unrecorded Enger Surveying & Engineering survey Job No. 33-1931 dated Feb. 28, 2007:  
No monument noted or witnessed but survey shows the following:  
Survey shows a distance North to M-8: 2668.07'  
Survey shows a distance West to L-9: 2631.11'