


TY, PR	JUNE 21, 1994		
WITNESSES	E-9	BUNKER HILL TWP.	
SOUTHWEST CORNER, SECTION 21, T1N, E1E,			
BUNKER HILL TWP, MICHIGAN CO., MICH			
FOUND 1" X 24" IRON ROD AT APPARENT			
INTERSECTION OF NORTH, SOUTH, EAST,			
AND WEST FENCE LINES. AREA IS			
LOW AND WET. EVIDENCE OF			
FENCES IN NORTH, SOUTH, EAST, AND			
WEST WAS FOUND. CORNER FALLS			
22' ± WEST OF INTERSECTION OF			
NORTH RUNNING DRAIN AND 6' ± SOUTH			
OF EAST RUNNING DRAIN. FOUND ALL			
FOR OF 1 ROD. CESTER'S WITNESSES			
RECORDED IN LIBER 7, PAGE 186			
ON JULY 24, 1990. ALL 4 OF			
WITNESSES HAVE BLAZE MARK IN			
TREE.			
LEFT 1" X 24" IRON ROD IN PLACE			
AND REWITNESSED WITH ROD CESTER'S			
BLAZE MARKS NAILS AND TAGS			
DROVE 2" X 8" METAL PIPE AT SE			
SIDE OF CORNER.			

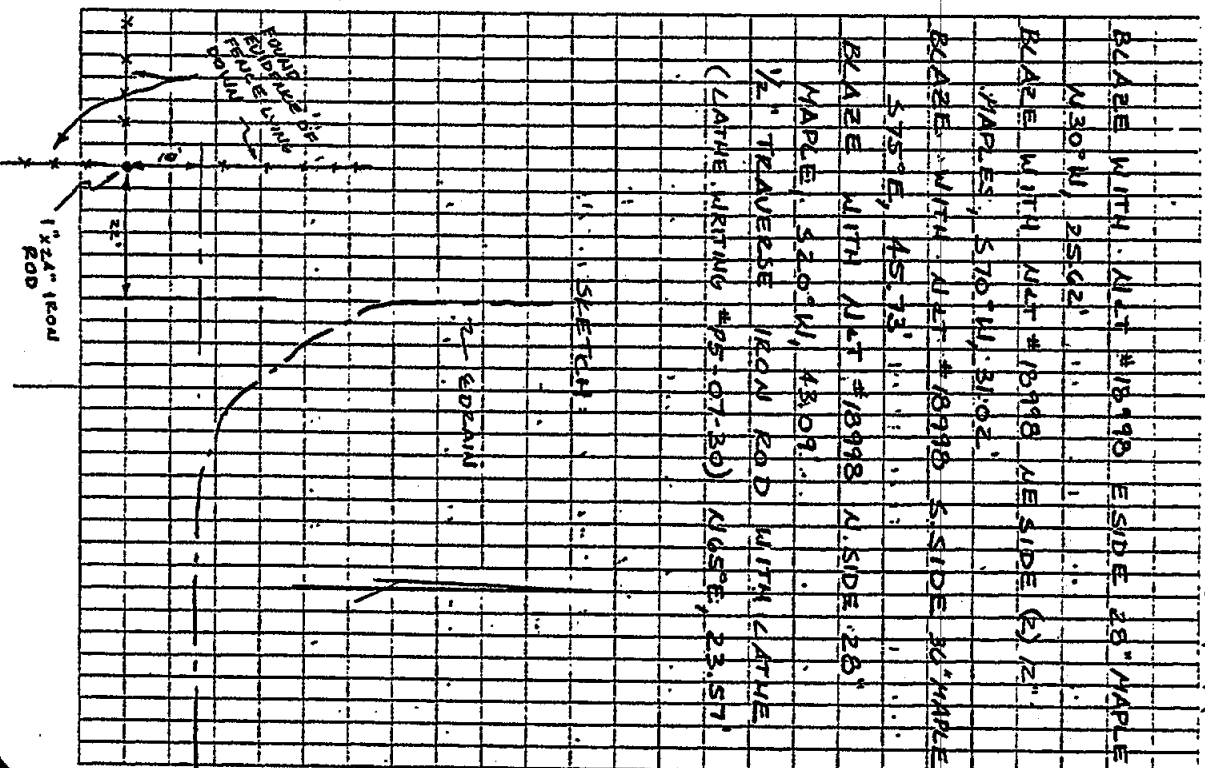

Bunker Hill Twp. T1N, R1E

Sec. 29 - E 1/4 cor.

Found man box in d of

Fitchburg Rd. of fence

1.003 N 1/2 Symington, lid

Found the following tags:

1 N 77° E, 83.33' N 1/4 # 28414

in S. side of 21" Basswood

1 South 26.10' N 1/4 in W. side

of cor. fence post.

1 S 45° W, 53.94' N 1/4 # 18998

in N. side of 11" Pe Ash

1 N 56° W, 44.32' N 1/4 # 25114

in S. side of 30' Oak

1 N 9° E, 32.01' N 1/4 # 28414

in E. side of 10" Hickory

Removed 1/2" pipe from man

box. AT 2.0' ± hit sand

Dug another 1.5' found

no further evidence.

So I removed iron cap

47969. and replaced

man box lid.

BS E-10

8V

N — S

2-23-05

Wood


Fitchburg Rd.
(BIT)

Confirmed
4-26-06
SS BV
Sunny, 60°

33

H. 516

Cap N
Field

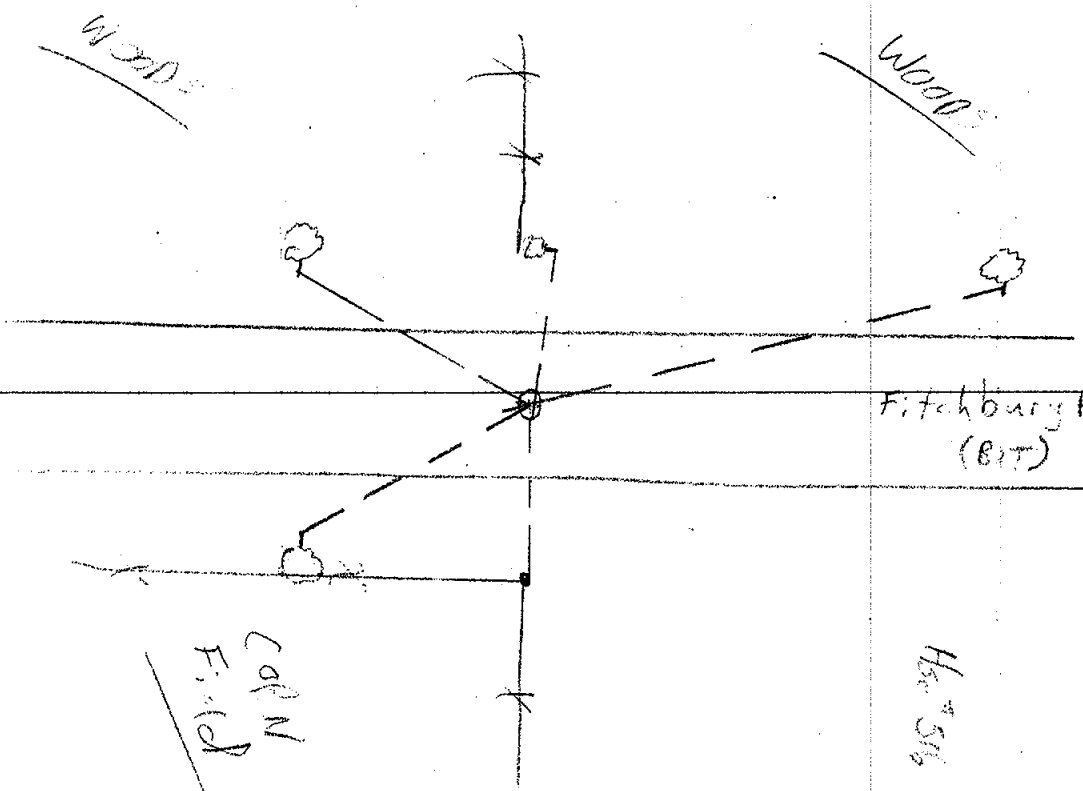

18

OCTOBER 4, 2004
T. S. NUNAVE
T. B. C. B. B. B.

NO BHH-6-221
BS @ BHH-6-220
FS BHH-6-222-E 11
161° 27' 46" 247.88
E-11
Set nail string 1/2" into 10" Ash 5.85W 10.17
Set nail string 1/2" into 10" Box Elder 5.60E 30.39
Centerline Base of post West 36.61
Set nail string 1/2" into 10" Box Elder North 26.74
SET 3/4" X 24" SMOOTH IRON ROD
AND 2 1/4" ALUMINUM REMON
CAP # 28414 AT E. OF EXTENSION
OF E-W DITCH TO EAST

TI BHH-6-219
BS BHH-6-218
FS BHH-6-223

BSD 0° 00' 00"
ESD 148° 28' 16"

BSR 179° 59' 57"

FSR 328° 28' 18"

BSD 0° 00' 01"

ESD 148° 28' 18"

BSR 180° 00' 02"

FSR 328° 28' 20"

148° 28' 18"

TI BHH-6-219
FS BHH-6-223

170.90

170.90

REVERSED

170.87

170.87

170.87

16

21

17

18

① TY, PE JULY 16, 1994
 WITNESSES F-9 BUKER HILL TRIP
 SOUTH 1/4 CORNER, SECTION 21, T17N, R1E1,
 BUKER HILL TOWNSHIP, NEHAM CO., ILL.
 FOUND 5/8" REBAR, NO CARB IN
 EAST-WEST FENCELINE AT A SHALL
 ROCK PILE, FOUND ALL 4 OF
 RON LESTER'S WITNESSES RECORDED
 IN LIBER 7, PAGE 188 ON JULY
 24, 1990.
 WITNESSES FOUND:
 NUT #18998 E. SIDE 15" OAK, N 17° W, 19.03'
 NUT #18998 S. SIDE 36" BASSWOOD, N 27° E, 15.42'
 NUT #18998 N. SIDE 36" OAK, S 85° W, 15.58'
 NUT #18998 E. SIDE 18" OAK, S 65° W, 17.58'
 CORNER FALLS 138' ± EAST OF
 CENTERLINE WILLIAMS ROAD
 LEFT 5/8" REBAR IN PLACE AT
 EAST-WEST FENCELINE, SURROUNDED
 BY SHALL PILE OF ROCKS AND
 SET NEW WITNESSES:

②
 SET NUT #28414 E. SIDE 20" OAK, NORTH, 34.58'
 SET NUT #28414 E. SIDE 15" OAK, N 17° W, 19.05'
 SET NUT #28414 N. SIDE 36" OAK, S 85° W, 15.58'
 SET NUT #28414 E. SIDE 18" OAK, S 65° W, 17.58'
 CENTERLINE WILLIAMS ROAD, WEST, 138' ±

Bunkerhill Township
center of section 28

F-10

SS FRO

PARTLY sunny, 38°
11-3-06

(40)

- Found 1/2" bar's cap #18994; Removed.

Set B+C # 47969 (Remains cap)
NO Mon Box, cap was set flush
w/ ground, 15' ± South of Ditch

- Property controlling corner; bar's cap, unreadable


N. 78° E. - 26.72'

- Set N+T 10' side 6" Hickory
N 05° E 14.90'

- FIND ACOLADE N+T E. side 12"
Oak S 35° E 22.80'

- Set N+T 8' 10' side 12" ASH
S 60° E 32.60'

- Set N+T 10' side 6" Ash
S 20° W 22.83'

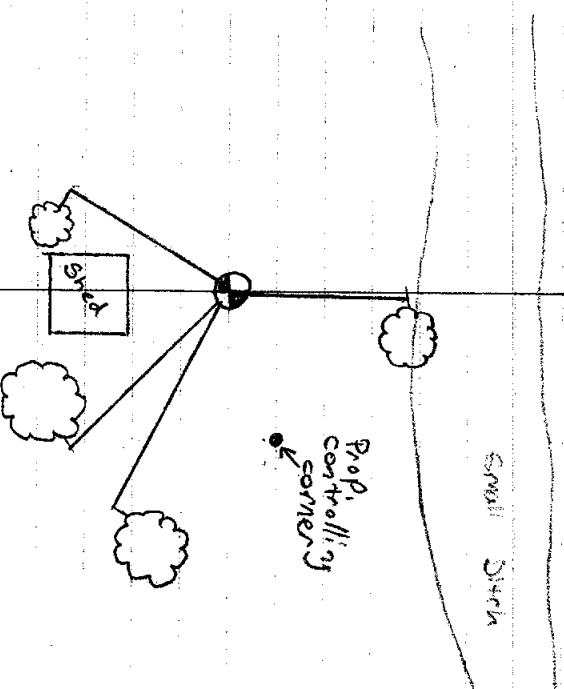

Property controlling corner witnesses;
(bar's cap, unreadable)

set re-mon N+T, w. side 6" hickory, N. 69° W. 26.46'
Id. "accolade" N+T, E. side 12" oak, S. 28° W., 27.61'
set re-mon N+T, in SW side 12" ash, S. 06° E. 22.06'
set re-mon N+T, w. side 6" Ash, S. 51° W. 43.42'
Id. Bar's cap - unreadable, W. 150.38'
set bar's re-mon cap, S. 78° W. 26.72'

F11

SET 3/4" x 2 1/2" SMOOTH IRON ROD
AND 2 1/2" ALUMINUM REMON CAP
#28414 EAST SIDE OF N-S DITCH

20' NORTH OF EXTENSION OF
DITCH TO WEST

1 BH4-6-223

BS BH4-6-219

FS BH4-6-224-F11

SET NAIL TAG #28414 SE SIDE 10"

MAPLE #296 23.36

SET NAIL TAG #28414 W. SIDE 48" POPLAR

SIDE 42.28

SOUND NAIL TAG #18994 NW SIDE

15' DEAD TREE SOUTH 56.67

SET NAIL TAG #28414 NW SIDE 12"

POPLAR S86W 46.02

1 BH4-6-210

BS BH4-6-209

FS BH4-19-226

BSD 0°00'00"

ESD 178°46'33"

BSR 180°00'00"

ESR 358°46'31"

BSD 359°59'59"

ESD 178°46'31"

BSR 180°00'00"

ESR 358°46'31"

178°46'32"

1 BH4-6-210

FS BH4-6-226

2741.38

2741.38


REVERSED

2741.38

2741.38

2741.38

⑥ TY-GM SEPT 28, 1994
 WITNESSES G-9 BUNTER HILL TWP.
 FOUND 1/2" IRON ROD AND CAP # 18057
 AT EAST SIDE OF 6" DIAMETER.
 STONE, STONE AND IRON FALL IN
 DOWNED, EAST-WEST FENCE LINE.
 STAKE ALSO FALLS 3' ± SOUTH
 OF SOUTH BANK OF EAST-WEST
 DITCH, PERAIED 1/2" IRON AND CAP WITH 3/4"
 X 1/4" IRON ROD AND CAP "P.A. 345 P.S. #2844
 WITNESSES:
 NLT #2844 S. SIDE 3/4" BASSWOOD, N75°W, 10.02'
 NLT #2844 W. SIDE 8" CHERRY, SOUTH, 10.15'
 NLT #2844 W. SIDE OAK CLUMP, S45°E, 13.10'
 NLT #2844 N. SIDE OAK CLUMP S75°E, 24.22'

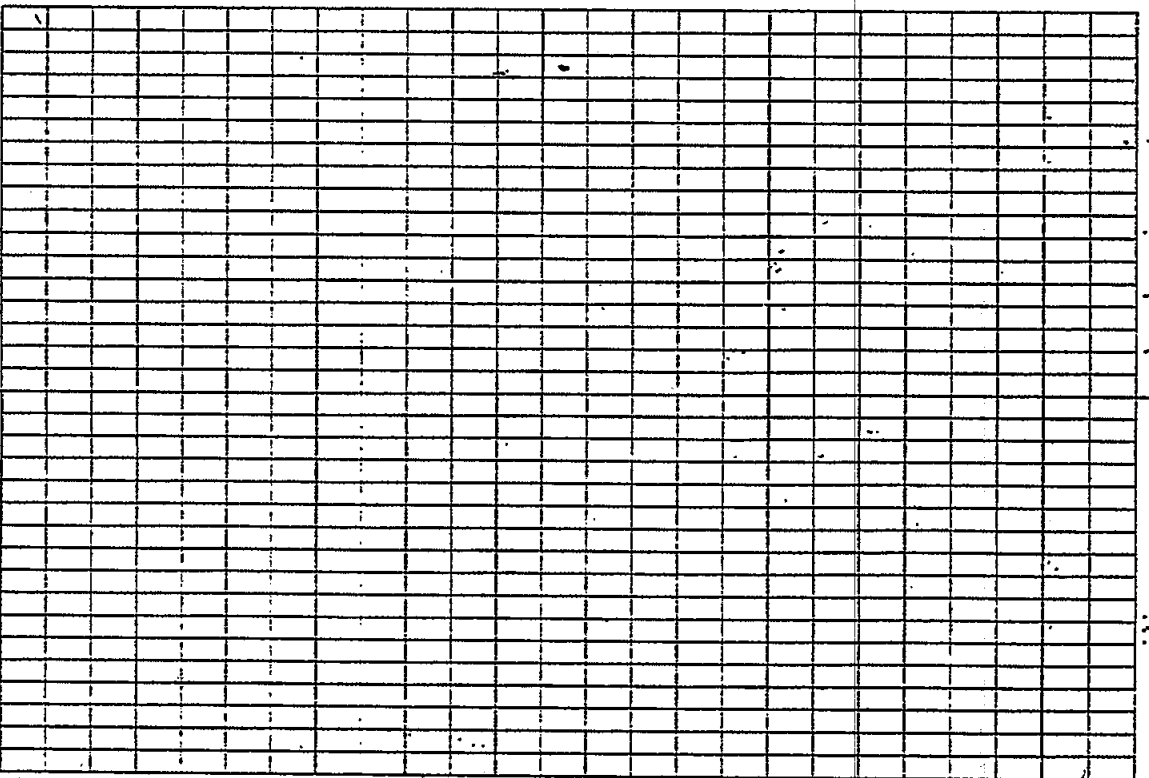

Bunkerhill Township.
E 1/4 cor., Sec. 28

G-10


JS FRO

mostly sunny, 38°
11-3-06

(39)

Found bar & cap # 18657 (1855?)
checked with witnesses; set
new witnesses because old witnesses
were in dead trees. ~~REMOVED~~
Replaced w/ bar & Re-man tablet.

- set nail & tag, N. side 4" Elm,
E. 1.72'
- set nail & tag, NE side 10" Birch,
S. 40° E. 59.40'
- set nail & tag N. side 8" maple,
W. 13.05'
- set nail & tag NE side 12" Elm,
N. 80° W. 57.30'

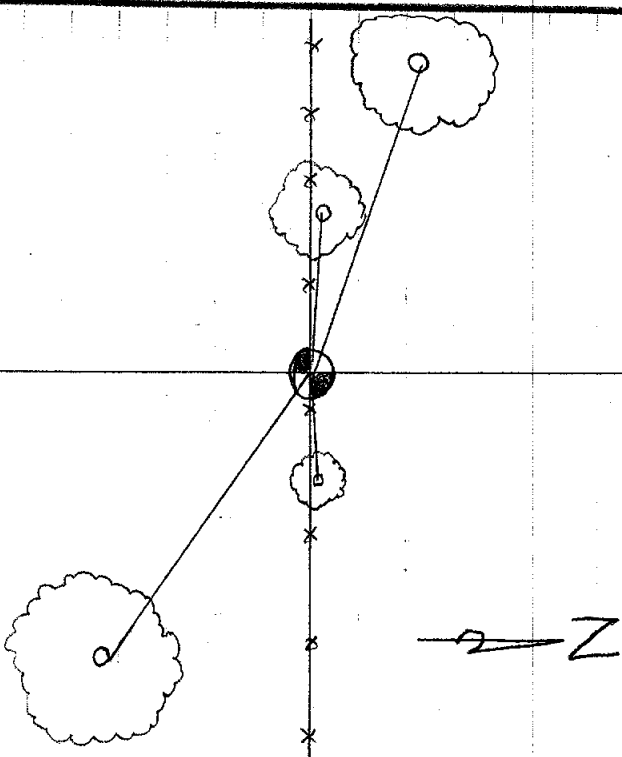

G-11 NW Corner Section
34, Boonehick Twp. S.P.

Found 1/2" Iron Rod in 4" concrete
monument base, (old cap), 0.3' W of
west edge of Williamson Road
monument and 0.30' Decid. old tree
line to west.

① FND NKT (18993) E side 1/2" iron-rod
North mea. 142.28' dist

② FND NKT (25832) in S.E. side triple B's
mea. S 60° W 31.36'

③ FND NKT (25832) in S side of
S 85° W 52.03'


④ FND NKT (25832) in S side triple B's
Elev mea. N 80° W = 18.19'

⑤ NW corner of stone 1st building
of 2 story frame.
S 10° E 272.18'


Recep cap stamped 44299

WASSON
DANECK

10-1-04
C. E. H. H. H.
Book B4-3

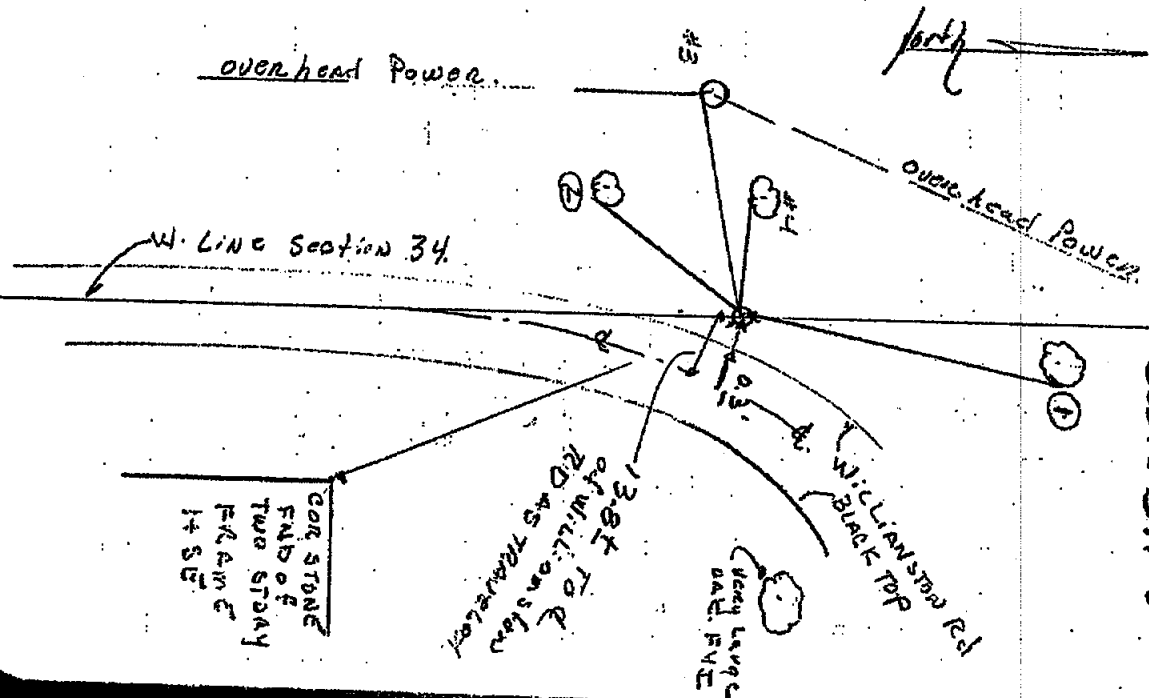


④	OCT 18, 1914		FY-64	
	TRAVERSE DATA	SECTION 20		
T	BH1-14-11		T	BH1-14-12
BS	BH1-9-10-D7		BS	BH1-14-11
FS	BH1-14-12		FS	BH1-14-13
BSD	0°00'00"		0°00'00"	
D	100°13'21"		89°05'29"	
BSL	180°00'03		179°59'57"	
R	280°13'21"		269°05'19"	
BSB	0°00'00"		359°59'59"	
D	100°13'20"		89°05'29"	
BSL	180°00'01"		179°59'54"	
R	280°13'21"		269°05'18"	
	100°13'20"		89°05'26"	
T	BH1-14-11		T	BH1-14-11
BS	BH1-9-10-D7		FS	BH1-14-12
	359.42		1282.99	
	359.42		1282.99	
	359.42		1282.98	
	359.42		1282.99	

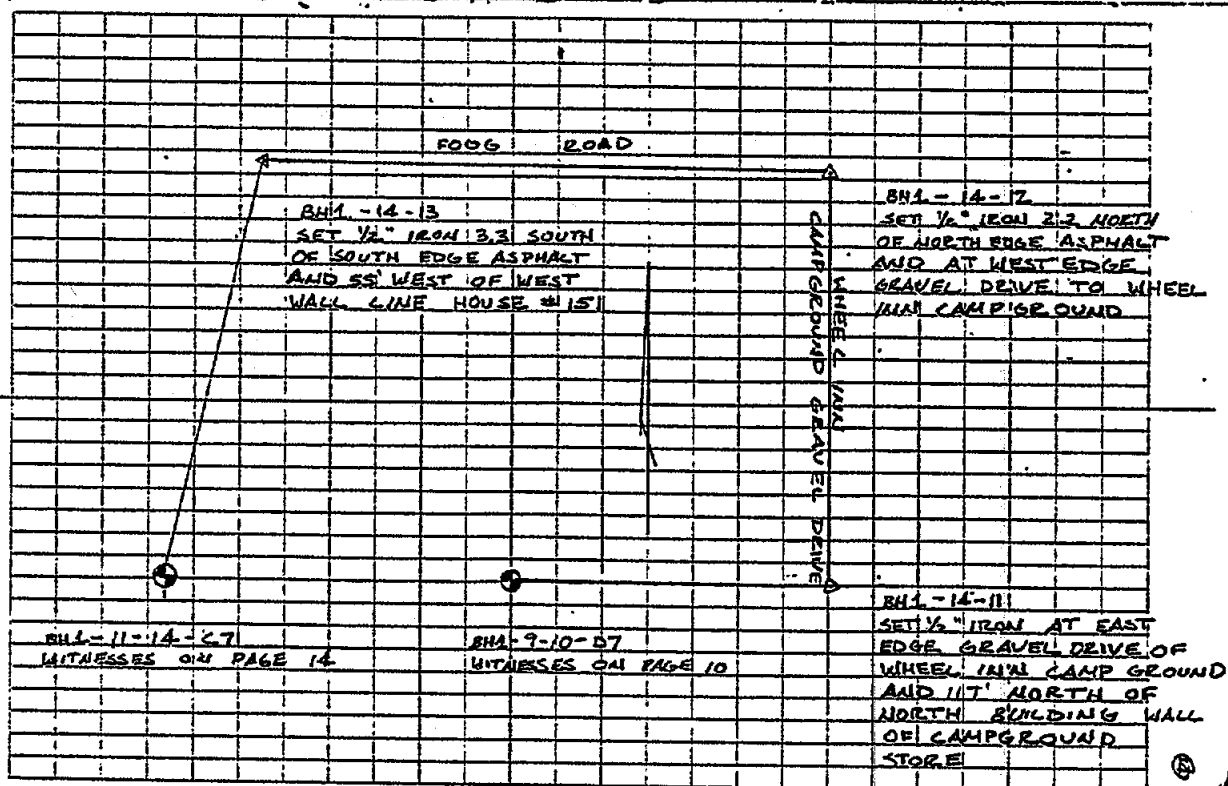

(10)		OCT 1944	TY-64
X BH4-15-15		X BH4-15-16	
BS BH4-11-14-17		BS BH4-15-15	
FS BH4-15-16		FS BH4-15-17	
BSD	0°00'00"	0°00'00"	
D	258°00'05"	185°05'01"	
BSR	179°59'52"	179°59'59"	
R	78°00'03"	5°04'56"	
BSD	359°59'58"	0°00'01"	
D	258°00'05"	185°05'03"	
BSR	179°59'52"	179°59'57"	
R	78°00'04"	5°04'59"	
	258°00'09"	185°05'01"	
X BH4-11-14-17		X BH4-15-15	
FS BH4-15-15		FS BH4-15-16	
1198.91		868.05	
1198.91		868.05	
REVERSE		REVERSE	
1198.91		868.05	
1198.91		868.05	
1198.91		868.05	

X BH4-15-17		X BH4-15-17	
BS BH4-15-16		BS BH4-15-16	
FS BH4-15-18		FS BH4-15-17	
BSD	0°00'00"	0°00'00"	
D	179°44'33"	185°41'43"	
BSR	179°59'56"	180°00'00"	
R	359°44'27"	3°41'30"	
BSD	359°59'58"	359°59'59"	
D	179°44'33"	183°04'24"	
BSR	179°59'52"	79°59'59"	
R	357°44'24"	3°41'38"	
	179°44'33"	183°41'41"	
X BH4-15-16		X BH4-15-17	
FS BH4-15-17		FS BH4-15-18	
1416.77		1283.98	
1416.77		1283.98	
REVERSE		REVERSE	
1416.75		203.98	
1416.75		203.98	
1416.76		1283.98	

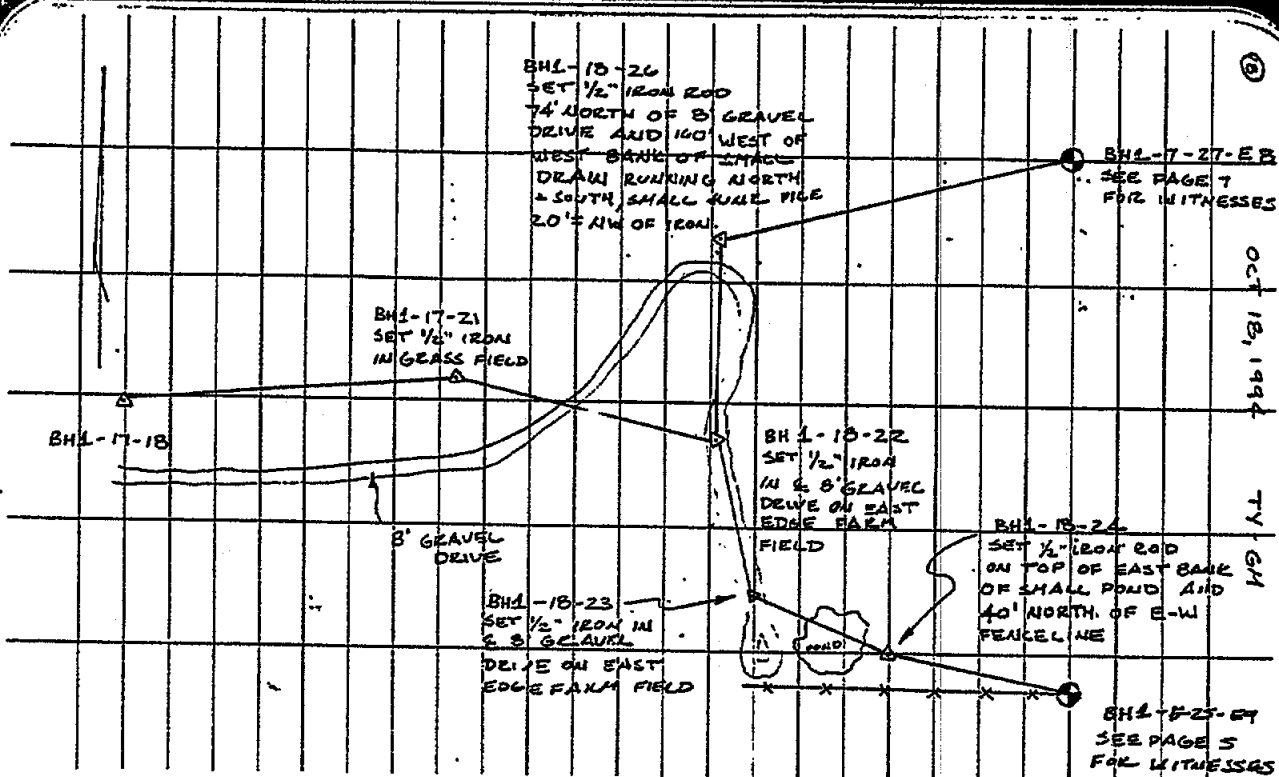

FS BHL-17-21	220° 43' 43"	FS BHL-18-22	221° 54' 22"
BS BHL-17-18	179° 59' 52"	BS BHL-17-21	221° 54' 22"
FS BHL-18-22	40° 43' 43"	FS BHL-18-23	179° 59' 50"
BS BHL-18-23	41° 54' 16"	BS BHL-18-22	41° 54' 16"
BS BHL-18-24	359° 59' 59"	BS BHL-18-25	359° 59' 55"
D BHL-18-23	220° 43' 42"	D BHL-18-24	221° 54' 20"
BS BHL-18-22	179° 59' 52"	BS BHL-18-23	179° 59' 51"
IC BHL-18-23	40° 43' 43"	IC BHL-18-24	41° 54' 14"
220° 43' 47"		221° 54' 24"	
FS BHL-17-21		FS BHL-18-22	
BS BHL-18-22		BS BHL-18-23	
1736.30		457.06	
1736.35		457.06	
REVERSE		REVERSE	
1736.38		457.00	
1736.30		457.00	
1736.37		457.06	

(8)



①	OCT 19, 1994	TY-64
7 BH1-18-23	7 BH1-18-24	
BS BH1-18-22	BS BH1-18-23	
FS BH1-18-24	FS BH1-5-25-E9	
BSD 0°00'00"	0°00'00"	
D 161°39'15"	130°02'28"	28
BSR 179°59'52"	179°59'53"	
R 341°39'13"	310°02'27"	21
BSD 0°00'01"	0°00'02"	
D 161°39'15"	130°02'28"	
BSR 179°59'53"	179°59'54"	
R 341°39'15"	310°02'29"	
161°39'18"	130°02'31"	
7 BH1-18-23	7 BH1-18-24	
FS BH1-18-24	FS BH1-5-25-E9	
544.18	365.70	
544.18	365.70	
REVERSE	REVERSE	
544.16	365.69	
544.16	365.70	
544.17	365.70	

7 BH1-18-22	7 BH1-18-26	
BS BH1-18-2	BS BH1-18-22	
FS BH1-18-26	FS BH1-7-27-E8	
BSD 0°00'00"	0°00'00"	
D 45°03'25"	241°28'11"	
BSR 179°59'55"	179°59'57"	
R 225°03'19"	61°28'03"	
BSD 0°00'01"	354°59'56"	
D 45°03'23"	241°28'08"	
BSR 179°59'54"	179°59'50"	
R 225°03'18"	61°28'02"	
45°03'23"	24°28'12"	
7 BH1-18-22	7 BH1-18-26	
FS BH1-18-26	FS BH1-7-27-E8	
854.49	1334.73	
854.49	1334.73	
REVERSE	REVERSE	
854.49	1334.72	
854.48	1334.73	
854.49	1334.73	

TRAVERSE POINT WITNESS REPORT

Traverse Point No. 12,013Tech. Sup'r. L. BRYANTownship BUNKER HILLCompany POLARISRecorded
Corner
CodeE-10Field Squad GENERAL #4
MARTINDate 4-18-78

Sketch and describe roads, monuments found or set, and witness established:

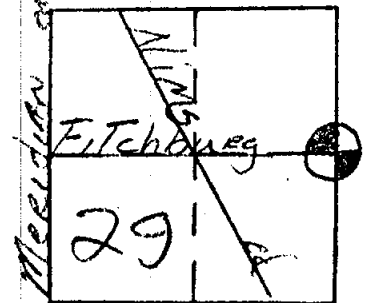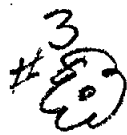1) Fd. N^o 7 S side 16" BRASS WOOD.
N 77° E 83.43'2) Fd. N^o 7 NW side 12" ELM
S 44° W 34.00'3) Fd. NAIL SW side 20" OAK
N 56° W 45.31'Liber 2
Pg. 581Fitchburg —  — rd.OK 11/4/79
MINCHFd. 1/2" pinched pipe
in E Fitchburg
on N^o 5. Fence lines

[illegible]

* I.C Road Commission
Bunker Hill 1/1/1972

BUNKERHILL
TOWNSHIP
TIN-RIE
G.L.O. PLAT MAP
(GENERAL LAND OFFICE)

Measurements which are shown outside subject township refer to adjacent townships. All measurements shown are in feet.



EXTERIOR FIELD SURVEY (Township Boundary)

South Boundary
Surveyed: *January 19, 1824* by *J. Wampler* (corrected by *Wampler, January 31, 1826,*

East Boundary
Surveyed: *February 4, 1824* by *J. Wampler*

North Boundary (South Boundary of Ingham Township)
Surveyed: *February 6, 1824* by *J. Wampler*

West Boundary (East Boundary of Leslie Township)
Surveyed: *by J. Wampler, date not noted*

The distances and monuments shown are from the original field notes which are held by the Michigan State Department of Natural Resources, Lands Division. Distances were originally recorded in chains and links.

Prepared by the Ingham County
Survey and Re monumentation Project
1978 - 1979
under the supervision of
Polaris Associates, Inc.
Registered Land Surveyors
Mason, Michigan

