

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Liber

9 Page

274

For corners in LESLIE TOWNSHIP

INGHAM COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 1N R 1W

K-1

T R

T R

T R

T R

2. Property Controlling S in Section S

T R

3. Miscellaneous S Property in Sec. S

T R

T R

FILED

970047744
12/02/1997 13:38:14
REGISTER OF DEEDS
Paula Johnson
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Maurice H. Mahieu, in a field survey on September 25, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- GLO notes state "79.82 intersection North boundary 115.2 West of Post, Hickory 12 S 51 1/2 E 13, Hickory 7 S 70W 38, survey performed by Hervey Parke, Deputy Surveyor, in February 1826.
- County Surveyor A. Jackson, on Jan. 16, 1843, recorded in Vol. 1, Page 10; Hick 12 S 51 1/2 E 13 links; Hick 7 S 70W 38 1/2 links.
- County Surveyor W. A. Rowe, on May 10, 1896, called for corner to be "stone and brick", W. Oak 12 N-W 33 3/4 lks, Walnut 4 SE 43 3/4 lks. Recorded in Book 3 Page 199.
- Ronnie Lester, P.S. #18998, recorded L.C.R.C. on Sept. 5, 1978 in Liber 4, Page 334, stated "Found 4" x 7" x 14" Blue Rock, 18" below surface. Found 1.5" x 2" x 6" long stone with brick, 32" below road surface, beneath found blue rock, ± 1' West of extended fence/tree line to South and ± 2' North of centerline Plains Road. Found plow point 40" below surface and beneath found blue rock and long stone with brick. Accepted long stone with brick as corner described by W. A. Rowe." Lester set 4" x 36" concrete monument with 1/2" x 38" rod with cap #18998 in location of long stone, with the following witnesses: Nail and Tag #18998 South Side 20" Twin Oak, ENE 85.55'; Nail and Tag #18998 North side 48" Oak, WSW 82.72'; Nail and Tag #18998 NW side 8" Ash, SW 47.11'; Nail and Tag #18998 West side 48" Oak, NW 23.80'; T-Bar, K-13, Vevay Twp., T2N, R1W, East, 73.06'.
- Ron Helsel, P.S. #18994, recorded P.A. 132 survey on Nov. 12, 1990 in Liber 6, Pages 548-550, Helsel stated corner to be concrete monument with the following witnesses: Set Nail and Tag South Side Twin 16" Oak, ENE 85.00'; Found Nail and Tag, North Side 48" Oak, WSW 82.72'; Found Nail and Tag, West side 48" Oak, NW 23.80'; Southwest Corner, Section 36, T2N, R1W, East 73.06'. Measured 2647.91 to K-2.
- Ronnie Lester, P.S. #18998, recorded P.A. 132 survey on May 10, 1996 in Liber 7, Pages 785-786, Lester stated corner to be concrete monument and cap with the following witnesses: Found Nail and Tag #18998 North side 50" Oak Mag Az. 255°, 82.69'; Found Nail and Tag #18998 West side 50" Oak Mag Az. 345°, 23.84'; Northeast Corner House Foundation Mag Az. 216° 120.48'; T-Bar, K-13, Vevay Mag Az. 98° 73.06'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found 1/2" iron concrete monument with damaged cap. Monument falls 2' ± North of centerline Plains Road on tree line to South. Found following witnesses. Nail and Tag #18998 West side 48" Oak N 20° W 23.80'; K-13, Vevay Twp., T2N, R1W, S 85° E, 73.15'; Accepted monument as being in the correct location from previous excavation performed by Ronnie Lester in 1978. Set cap stamped #28414 on monument.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1/2" Iron Rod concrete monument with cap #28414 in monument box, Witnesses:
Set Nail and Tag #28414 Southwest side 48" Oak, N 20° W 22.83'
Set Nail and Tag #28414 North side 11' Walnut, S 60° W 32.27'
Set Nail and Tag #28414 East side 10" Basswood, S 20° E 30.70'
Set Nail and Tag #28414 South side 6" Ash, N 45° E 36.64'
K-13, Vevay Twp., T2N, R1W, S 85° E 73.15'

Signed by Maurice H. Mahieu
Surveyor's Michigan License No. 28414

Date 11-25-97

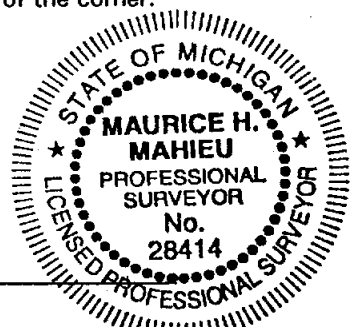

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975

REVISED JAN., 198
REVISED OCT., 199

P.A. 345 INGHAM COUNTY
PEER APPROVED 10/16/97 ML

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Liber

9 Page 275

For corners in
LESLIE TOWNSHIP
INGHAM COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 1N R 1W

L-1

2. Property Controlling
in Section

S

T R

3. Miscellaneous
Property in Sec.

S

T R

S

T R

4. Lot No. , Recorded Plat

5. Private Claims

I, Maurice H. Mahieu, in a field survey on September 23, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules theretofore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
1. NO CORNER WAS SET AS A PART OF THE ORIGINAL GOVERNMENT SURVEY.

2. COUNTY SURVEYOR A. JACKSON IN VOL. 1, PAGE 113 ON JAN. 16, 1843 USED CORNER.
NO MONUMENTATION SHOWN. THE REPORT SAYS THAT THE CORNER IS IN A SWAMP.

3. A LCRC RECORDED IN LIBER 6, PAGE 129, DATED DEC. 8, 1980 BY RONNIE M. LESTER/GARY D. LESTER P.S. #18998/17624. "INVESTIGATION REVEALED EXCAVATION SITE TO BE FUTILE AND UNSAFE AS LOCATION OF CORNER LIES IN A FILL AREA ACROSS A POND. CORNER CONSIDERED LOST. SET CORNER MIDWAY BETWEEN K-1 AND M-1 LESLIE ON THE STANDARD TOWNSHIP LINE. PHYSICAL LOCATION OF CORNER FALLS $\pm 3.0'$ NORTH OF CENTERLINE OF PLAINS ROAD AND $\pm 7.0'$ WEST OF A FENCE LINE SOUTH. MEASURED EAST 2680.10' TO M-1 LESLIE AND WEST 2680.09 TO K-1 LESLIE. MEASURED EAST TO L-13 VEYAY 36.55'. INVESTIGATION CONDUCTED BY INGHAM COUNTY SURVEY AND REMONUMENTATION PROJECT STAFF. SET 4"x36" CONCRETE MONUMENT WITH $\frac{1}{2}$ "x38 REEROD AND CAP #18998 IN LOCATION OF CORNER DESCRIBED ABOVE:
NAIL & TAG #18998, WEST SIDE POWER POLE, ENE, 139.09'
NAIL & TAG #18998, SOUTHWEST SIDE 8" ELM, ENE, 174.99'
NAIL & TAG #18989, NORTH EDGE ROAD SIGN, SSW, 17.55'
NAIL & TAG #18998, EAST SIDE 10" TWIN ASH, SOUTH 18.77'
 $\frac{1}{2}$ " IRON BAR, L-13 VEYAY, T2N, T1W, EAST. 36.55'

(Continued on back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND $\frac{1}{2}$ " IRON ROD & CAP #18998 $\pm 2'$ NORTH OF CENTERLINE OF PLAINS ROAD. NO WITNESSES FOUND. DID NOT EXCAVATE AREA DUE TO EVIDENCE OF PRIOR EXTENSIVE FILL ACTIVITIES. REPLACED $\frac{1}{2}$ " IRON WITH $\frac{3}{4}$ " IRON ROD WITH CAP STAMPED PA 345, PS28414. SET MONUMENT BOX OVER IRON. THE POSITION OF THE $\frac{1}{2}$ " IRON ROD APPEARS TO BE THE SAME POSITION AS THE CONCRETE MONUMENT SET BY R.M. LESTER IN 1980. THE POSITION OF THE LESTER CORNER IS THE CORRECT POSITION FOR A LOST CORNER AND THIS SURVEYOR AGREES WITH THE POSITION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 $\frac{3}{4}$ " x24" iron rod set in the position of the found $\frac{1}{2}$ " iron rod; witnessed by:
Nail & tag #28414, northwest side power pole N81°E, 139.34 feet
Nail & tag #28414, north side 8" Elm, S80°E 236.56 feet
South edge "NO STOPPING, STANDING, PARKING" ROAD SIGN POST, S21°W, 17.02 feet
 $\frac{3}{4}$ " iron rod with cap #28414 (L-13, Vevay Twp.) East 36.56 feet

Signed by Maurice H. Mahieu
Surveyor's Michigan License No. 28414

Date 10-10-97


P.A. 345 INGHAM COUNTY
PEER APPROVED 9/25/97 m

FILED

970047745
12/02/1997 13:38:17
REGISTER OF DEEDS
Paula Johnson
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

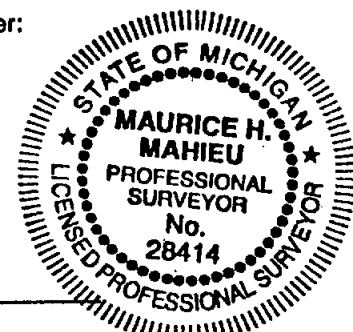

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975

REVISED JAN. 1983
REVISED OCT. 1995

L-1, LESLIE
PAGE 2

SECTION A, CONTINUED

4. An Act 132 Survey recorded in Liber 6, Page 548 on November 28, 1990, by Ron Helsel, P.S. #18994 performed a survey in the Northwest 1/4 of Section 1. Used the same information as A-4.

5. An Act 132 Survey recorded in Liber 7, Page 785 on May 10, 1996, by Ronnie M. Lester, P. S. #18998 performed a survey in the Northwest 1/4 of Section 1. "Set 1/2" bar and cap #18998 2.0 feet north centerline of Road. Corner reset at location established in Liber 6, Page 129 December 1980. Set galvanized nail and 1 1/4" brass tag stamped "18998 LESTER" S.W. side dead 12" elm mag. Az. 88°, 175.29'; Set galvanized nail and 1 1/4" brass tag stamped "18998 LESTER" South side westerly 14" oak of double oak mag. Az. 92°, 247.30'; 1/2" bar and orange "Polaris" traverse cap mag. az. 355, 10.60'; 1/2" bar and cap "18998" L-13 Vevay mag. Az. 97, 36.55'; distance to K-1, Leslie Twp. 2680.25 feet"

INCHON COMPLY'NI
BENTH 1000000
RECEIVED DE DEEDS
15/05/1991 13:39:71
01001112

FILED

1996

2 1/2

276

Liber 9 Page 277

Corner Code #

T_____ R_____
T_____ R_____

P.A. 345 INGHAM COUNTY
PEER APPROVED 10/16/97 M

(A-Continued)

6. Larry Bryan, P.S. #25832, recorded a P.A. 132 survey in Liber 7, Pages 371-372, on Nov. 2, 1994. He recorded finding 1/2" bar at North edge of asphalt on Vaughn Road, he states the same witnesses as A-4. Measured 2,675.96 to M-2.
7. Unrecorded survey by Larry Bryan P.S. #25832 on June 6, 1995 notes corner as found axle shaft in rock pile on Tree line South, witnessed by:
Found Nail and Tag Northwest side Twin 10" Cherry N45° E 25.25'
Set Nail and Tag South side 24" Maple East 33.10'
Set Nail and Tag West side 12" Cherry S 35° W 30.40'
Set Nail and Tag West side 10" Cherry South 42.89'
Measured 2676.12 to M-2 and 2663.05 to L-3.

INBANK COMMIA*43
LATE 200202
RECEIVED OF DEEDS
1510517891 12:20:19
210001122

FILED

01080

2 6986

510

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Liber

9 Page 279

FILED

970047747
12/02/1997 13:38:20
REGISTER OF DEEDS
Paula Johnson
INGHAM COUNTY, MI

for corners in LESLIE TOWNSHIP

INGHAM COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 1N R 1W

L-3

2. Property Controlling
in Section

S

T R

3. Miscellaneous
Property in Sec.

S

T R

4. Lot No. , Recorded Plat

5. Private Claims

Maurice H. Mahieu, in a field survey on September 24, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. GLO notes states "40.31 Set 1/4 Sec. Post at Av'D on a true line, W. Oak, 15 in S 16 W 21 1/2, B Oak 5 in N 44E 43". Surveyed performed by Hervey Parke, Deputy Surveyor, in Feb. 1826.

2. Ronnie Lester, P.S. #18998, Set 1/2" iron rod and cap at intersection of North, East, and West fence lines, on May 21, 1981 under Ingham County Remonumentation Project; Witnesses: Nail & Tag #18998 West Side 10" Cherry, N 30° W 18.43'; Nail & Tag #18998 North Side 40" Dead Willow, East 27.72'; Nail & Tag #18998 South Side 8" Cherry S 60° W 13.06'; Nail & Tag #18998 SE Side 10" Cherry S 55° W 32.21'. Recorded in Ingham County Remonumentation Records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" Iron (Poor Condition) and Cap #18998 with the following witnesses:

Nail & Tag #25832 South Side 8" Cherry, S 75° W 4.00' (Tree Dead)

Nail & Tag #25832 North Side 6" Cherry, S 75° E 3.85' (Tree Dead)

Nail & Tag #25832 Southwest Side 18" Cherry, S 45° E 11.40'

Nail & Tag #18998 East Side 22" Cherry, S 60° W 31.05'

Ron Lester, P.S. #18998, determined corner to be obliterated. Lester measured West to K-3 2639.09 and East to M-3 2657.08, from Ingham County Remonumentation Records. I feel Ron Lester set corner in the correct location by using the occupied North, East, and West fence lines as evidence.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set standard 3/4" iron rod with cap stamped "P.A. 345 P.S. #28414 "in place of 1/2" iron rod and cap #18998." Witnesses:

Set Nail and Tag #28414 North Side 8" Cherry, East 7.55'

Set Nail and Tag #28414 West Side 18" Cherry S 45° E 11.02'

Set Nail and Tag #28414 Southwest Side 20" Cherry, N 45° W 17.74'

Set Nail and Tag #28414 Southeast Side 14" Cherry, S 50° W 12.87'

Signed by Maurice H. Mahieu

Date 11-25-97

Surveyor's Michigan License No. 28414

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975

REVISED JAN., 1993
REVISED OCT., 1995



P.A. 345 INGHAM COUNTY
PEER APPROVED 10/16/97 u

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Liber 9 Page 280

FILED

970047748
12/02/1997 13:38:22
REGISTER OF DEEDS
Paula Johnson
INGHAM COUNTY, MI

For corners in
LESLIE TOWNSHIP
INGHAM COUNTY
(County)

Located in: Corner Code #

1. Public Land Survey	T 1N R 1W	M-1
	T R	
	T R	
	T R	
	T R	
2. Property Controlling In Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number
M-13, T2N, R1W, Vevay Township

4. Lot No. , Recorded Plat
5. Private Claims

I, Maurice H. Mahieu, in a field survey on August 25, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL GLO CORNER WAS SET IN MAY, 1825 BY JOSEPH WAMPLER, D.S. "80.00 SET POST COR. OF TOWNS 1 & 2 N, RANGE 1W; W. OAK 18 S79W 26; DO 11 N44W 22 1/2"

2. LCRC RECORDED IN LIBER 5, PAGE 53, BY RONNIE M. LESTER/GARY D. LESTER P.S. #'S 18998/17624 AS A PART OF THE 1978 INGHAM COUNTY SURVEY & REMONUMENTATION PROGRAM, EXCAVATED HOLE 10'X6' TO AN AVERAGE DEPTH OF 2.5 FEET AT THE INTERSECTION OF THE CENTERLINE OF KELLY AND PLAINS ROADS. FOUND LARGE, FLAT BROKEN SANDSTONE 1.6 FEET BELOW SURFACE, ABOVE BROKEN PIECE OF IRON MACHINERY SURROUNDED BY CROCKERY, 2.2 FEET BELOW SURFACE, +2.0 FEET NORTH OF CENTERLINE OF PLAINS ROAD AND ±1.0 FEET EAST OF CENTERLINE OF KELLY ROAD. ACCEPTED IRON AND CROCKERY AS CORNER. MEASURED ±2645 FEET SOUTH TO M-2, LESLIE TWP., T1N, R1W IN CLOSE ACCORD TO GLO MAP. SET 4"X36" CONCRETE MONUMENT WITH 1/2" X 28" REROD WITH CAP #18998 AND CONCRETE COLLAR WITH COVER AT LOCATION OF IRON DESCRIBED ABOVE:

NAIL & TAG #18998, SOUTHEAST SIDE 30" MAPLE, SSE 92.49'
NAIL & TAG #18998, SOUTHWEST SIDE 24" MAPLE, SE 49.86'
NAIL & TAG #18998, SOUTHWEST SIDE 15" WALNUT, SE, 48.26'
NAIL & TAG #18998, SOUTHWEST SIDE FENCE CORNER POST, NE, 34.78' (See other side)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND 1/2" IRON REBAR IN CONCRETE MONUMENT, 1.5' NORTH OF C/L PLAINS ROAD AND 3.5' WEST OF C/L KELLY ROAD. FOUND THE FOLLOWING WITNESSES: (NEW) NAIL & TAG #18998 N. SIDE 24" WALNUT, S56°E 47.91'; (OLD) NAIL & TAG #18998 S.W. SIDE 24" WALNUT, S56°E 48.27'; (NEW) NAIL & TAG W. SIDE 32" MAPLE, S24°E, 49.16'; C/L 36" MAPLE, S13°E 91.85'; (NEW) NAIL & TAG #18998 S. SIDE UTILITY POLE, N49°W, 40.94'. AREA HAS BEEN EXCAVATED IN PREVIOUS REMONUMENTATION PROGRAM AND NO ADDITIONAL EXCAVATION WAS PERFORMED. LEFT THE 1/2" REBAR IN CONCRETE MONUMENT IN PLACE, PLACED CAP #28414 ON REBAR, AND ACCEPTED AS THE PERPETUATED POSITION OF CORNER. THERE IS NO CONFLICTING EVIDENCE TO SUPPORT ANY DIFFERENT LOCATION FOR CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
1/2" REBAR WITH CAP #28414 WAS LEFT IN PLACE AND WITNESSED WITH THE FOLLOWING:
NAIL AND TAG #18998, SOUTH SIDE UTILITY POLE N49°W, 40.94 FEET
NAIL AND TAG #18998, NORTH SIDE 24" WALNUT, S56°E, 47.91 FEET
NAIL AND TAG WEST SIDE 32" MAPLE, S24°E, 49.16 FEET
NAIL AND TAG #28414, SOUTH SIDE 15" MAPLE, N64°E, 53.85 FEET



Signed by Maurice H. Mahieu DATE 10-10-97
Surveyor's Michigan License No. 28414

M-1 CONTINUED
PAGE 2

PART A:

3. ACT 132 SURVEY RECORDED IN LIBER 3, PAGE 1070 ON NOV. 7, 1979, BY AUSTIN C. WILLIAMS, P.S. 21275 CALLS FOR CORNER AS S.E. CORNER OF SECTION 36, T2N, R1W. NO MENTION OF CORNER MATERIAL.

WITNESSED BY: NAIL & TAG SW/S 30" MAPLE SSE 92.49'

NAIL & TAG SW/S 24" MAPLE SE 49.86'

NAIL & TAG SW/S 15" WALNUT SE 48.26'

4. ACT 132 SURVEY RECORDED IN LIBER 6, PAGE 196 ON JUNE 10, 1990, BY LARRY BRYAN, P.S. 25832, CALL FOR CORNER AS N.E. CORNER OF SECTION 1, T1N, R1W. FOUND BAR & CAP #18998 AT CENTERLINE OF PLAINS & KELLY ROADS, LIBER 5, PAGE 53; WITNESSED BY

FOUND NAIL & TAG #18998 SOUTHEAST SIDE FENCE POST, N45°E, 34.66'

FOUND NAIL & TAG #18998 SOUTHWEST SIDE 30" WALNUT S60°E, 48.26'

"+" STAMPED ON U.S.G.S. BENCHMARK MONUMENT, N45°W, 36.62'

5. ACT 132 SURVEY RECORDED IN LIBER 6, PAGE 524 ON NOV. 28, 1990, BY RON HELSEL, P.S. #18994 CALLS FOR CORNER AS S.E. CORNER OF SECTION 36, T2N, R1W, Refers to LCRC Liber 5, Page 53.



LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Liber

9 Page 282

FILED

970047745
12/02/1997 13:38:24
REGISTER OF DEEDS
Paula Johnson
INGHAM COUNTY, MI

For corners in
LESLIE TOWNSHIP
INGHAM COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 1N R 1W

M-2

T R

T R

T R

T R

2. Property Controlling
in Section

S

T R

S

T R

3. Miscellaneous
Property in Sec.

S

T R

S

T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Maurice H. Mahieu, in a field survey on September 15, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL G.L.O. CORNER WAS SET BY JOSEPH WAMPLER D. S. IN MAY 1825 40.00 SET 1/4 SEC. POST; B. OAK ---- N28 1/2W 32, TAM 8 S76W 27 1/2

2. COUNTY SURVEYOR A. JACKSON DID A SURVEY IN NOVEMBER 1841. SURVEY IS IN VOL. 1, PAGE 113. NO MENTION OF CORNER MATERIAL. WITNESSES: "B. OAK 9 N28 1/2W 32 LKS, TAMARACK 8 S76W 27 1/2 LKS" (THIS INFORMATION WAS TRANSCRIBED FROM COUNTY SURVEYORS RECORD IN VOL 4A, PAGE 112 TO 1979 CETA REMONUMENTATION NOTES)

(See Back for continuation)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" SMOOTH IRON PIPE WITH YELLOW CAP (UNREADABLE) IN MONUMENT BOX AT INTERSECTION OF KELLY AND VAUGHN ROADS. FOUND THE FOLLOWING WITNESSES: NAIL & TAG #25832, WEST SIDE 32" WALNUT, S14°E, 91.73'; CENTERLINE 18" HICKORY, N59°E, 45.3'. 1/2" PIPE IN GOOD CONDITION AND LEFT IN PLACE. Accepted position of 1/2" pipe as the perpetuated position of corner based on investigation of corner by Richard W. Steadman, P.S. 11370.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1/2" SMOOTH IRON PIPE, WITNESSED BY:
SET NAIL & TAG #28414, SOUTH SIDE 18" CHERRY, N59°E, 45.27 FEET
SET NAIL & TAG #28414, EAST SIDE UTILITY POLE, N45°W, 65.48 FEET
SET NAIL & TAG #28414, NORTH SIDE 21" WALNUT, S81°W, 108.15 FEET
FND. NAIL & TAG #25832, WEST SIDE 32" WALNUT, S14°E, 91.73 FEET



Signed by Maurice H. Mahieu
Surveyor's Michigan License No. 28414

Date 10-10-97

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975

REVISED JAN. 1983
REVISED OCT., 1995

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/25/97 M
DEC 8 1997 583

M-2 Continued
Page 2

3. LCRC IN LIBER 4, PAGE 265 DATED JULY 29, 1978 BY RICHARD W. STEADMAN, P.S. 11370. FOUND A RAILROAD SPIKE IN THE INTERSECTION OF VAUGHN AND KELLY ROADS, DUG HOLE, AND BELOW RAILROAD SPIKE ABOUT 2 FEET DEEP, FOUND WELL ROTTED WOOD STAKE. RAISED LOCATION OF WOOD STAKE TO SURFACE WITH 1/2" IRON PIPE. WITNESSED BY:

10" HICKORY N.E. 45.61 FEET
TELEPHONE POLE, S.E. 53.98 FEET
28" WALNUT, S.S.E., 91.79 FEET
C/L 2" STEEL ROAD SIGN POST, S.W. 36.97 FEET

4. LCRC IN LIBER 5, PAGE 151 DATED JAN 16, 1979 BY AUSTIN C. WILLIAMS, P.S. 21275. "FOUND 3/4" IRON ROD IN CENTERLINE OF KELLY & VAUGHN ROADS. MEASUREMENTS NORTH & SOUTH IN CLOSE ACCORD WITH GLO RECORDS. WITNESSED BY:

NAIL & TAG 18" ASH N70°E 46.31'
NAIL & TAG 30" WALNUT S20°E 91.85'
CENTERLINE 2" STEEL SIGN POST S35°W 36.88"

5. AN ACT 132 SURVEY RECORDED IN LIBER 3, PAGE 706 BY AUSTIN C. WILLIAMS, P.S. 21275 CALLS FOR EAST 1/4 CORNER OF SECTION 1; NO MENTION OF CORNER MATERIAL. WITNESSES:

NAIL & TAG 18" ASH N70°E 46.31'
NAIL & TAG 30" WALNUT S20°E 91.85'
CENTERLINE 2" STEEL SIGN POST S35°W 36.88'

6. AN ACT 132 SURVEY RECORDED IN LIBER 6, PAGE 196 BY LARRY BRYAN, P.S. 25832 CALLS FOR EAST 1/4 CORNER AS A FOUND PIPE AND CAP CENTERLINE OF KELLY & VAUGHN ROADS, LIBER 4, PAGE 265. WITNESSED BY:

FOUND NAIL & TAG NORTH SIDE 20" WALNUT, S80°W 108.86'
SET NAIL & TAG WEST SIDE 36" WALNUT, S25°E 91.79'
SET NAIL & TAG SOUTH SIDE 18" HICKORY, N50°E, 45.61'

7. AN ACT 132 SURVEY RECORDED IN LIBER 7, PAGE 372 BY LARRY BRYAN, P.S. 25832 CALL FOR EAST 1/4 CORNER, SECTION 1, T1N, R1W, LIBER 5, PAGE 151. "FOUND 1/2" PIPE WITH CAP AT INTERSECTION OF VAUGHN & KELLY ROADS.

FOUND NAIL & TAG EAST SIDE 15" HICKORY, NE 45.67'
FOUND NAIL & TAG #25832, WEST SIDE 30" WALNUT, SSE, 91.79'
FOUND NAIL & TAG, NORTH SIDE 14" WALNUT, S70°W, 108.84'
CENTERLINE ROAD SIGN POST, N45°W, 38.09"



INCHON COMMUNITY
BAPTIST CHURCH
REGISTER OF DEEDS
151051281 13:38:54
210061112

ELI EL

7061

2 page 585

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in LESLIE TOWNSHIP

INGHAM COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 1N R 1W

M-3

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Sec.

S T R

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Maurice H. Mahieu, in a field survey on September 23, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- GLO notes states "80.00 Set Post Cor. Secs. 1 & 12, W. Oak 30 N 11W, 89, W. Oak 24 S 43W 67" Survey performed by Hervey Parke, Deputy Surveyor, In February 1826.
- Ronnie Lester, P.S. #18998, recorded a P.A. 132 survey on Oct. 29, 1973 in Liber 1, Page 994-995. Lester gives no description of corner monumentation, but states following three witnesses: Set Nail & Tag West side 15" Wild Cherry, NNE, 30.60'; Set Nail & Tag NW side 10" Twin Wild Cherry, NE, 25.27'; Set Nail & Tag North side 10" Apple, SW, 32.51'. Measured 2645.26 to M-4.
- Ronnie Lester, P.S. #18998, recorded L.C.R.C. on Jan. 3, 1974, in Liber 2, Page 613. Lester states "Found 1" Axle set in stones on wood line South, distances West and South in close accord with original government monument." Lester recorded three witnesses which are the same as A-2.
- Austin Williams, P.S. #21275, recorded P.A. 132 survey, on Jan. 16, 1979, in Liber 3, Page 706, Williams gives no description of corner monumentation, but states the following three witnesses: Nail & Tag W/S 15" Cherry, NNE, 30.60'; Nail & Tag NW/S 10" Twin Cherry, NE 25.27'; Nail and Tag N/S 10" Apple SW 32.51'. Measured 2658.61 to M-2.
- Ingham County Remonumentation CETA project of 1979-81 with Technical Supervisor Ronnie Lester, P.S. #18998 did a section breakdown of Section 1. Final date of survey is May 21, 1981. Measurements from M-3 to M-2 is 2656.95 ft.; M-3 to L-3 is 2657.08 ft.

(Continued on back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1" x 5' ± Axle shaft surrounded by pile of stone with the following witnesses:

Nail and Tag #25832 South Side 30" Ash, East 33.15'

Nail and Tag #25832 West Side 18" Ash, South 43.02'

Nail and Tag #25832 West Side 18" Ash, S 45° W 30.65'

The history of the found axle shaft is unknown. However, many surveys have used this axle shaft and has been assumed to be the corner by previous surveyors. There is no other evidence to dispute the location and this surveyor accepts the axle as the perpetuated location of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set standard 3/4" iron rod and cap stamped "P.A. 345 P.S. #28414 in place of 1" axle shaft. Witnesses:

Set Nail and Tag #28414 North Side 8" Triple Maple, S 45° E 15.89'

Set Nail and Tag #28414 North Side 16" Ash, S 80° W 33.05'

Set Nail and Tag #28414 West Side 14" Twin Ash, N 30° E 24.95'

Set Nail and Tag #28414 West Side 12" Elm, N 30° W 36.44'

Signed by Maurice H. Mahieu

Date 11-25-97

Surveyor's Michigan License No. 28414



FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JANUARY 1975
REVISED MAY 1975

FORM 61

2 1996

582

REVISED JAN., 198
REVISED OCT., 199

P.A. 345 INGHAM COUNTY
PEER APPROVED 10/16/97 MC

(A - Continued)

6. Unrecorded survey by Larry Bryan P.S. #25832 on June 6, 1995 notes corner as found axle shaft in rock pile on Tree line South, witnessed by:
Found Nail and Tag Northwest side Twin 10" Cherry N 45° E 25.25'
Set Nail and Tag South Side 24" Maple East 33.10'
Set Nail and Tag West Side 12" Cherry S 35° W 30.40'
Set Nail and Tag West Side 10" Cherry South 42.89'
Measured 2657.61 to M-2, 2657.73 to L-3, and 2645.49 to M-4.
7. Ingham County Remonumentation CETA project of 1979-81 with Technical Supervisor Ronnie Lester, P.S. #18998 did a section breakdown of Section 1. Final date of survey is May 21, 1981. Measurements from M-3 to M-2 is 2656.95 feet; M-3 to L-3 is 2657.08.

INCHON COMMA'NI
BENTIS TOPUSON
BEP121E8 DE DEEDS
C10511001 73:30:52
010041120

FILED

1986

2 1386

564