

DEC 17 1998

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Liber 9 Page 444

SECTION
For corners in BUNKERHILL TOWNSHIP

INGHAM COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 1N R 1E

A-3

2. Property Controlling
in Section

S

T

R

3. Miscellaneous
Property in Sec.

S

T

R

S

T

R

FILED

980061037
12/01/1998 10:44:43
REGISTER OF DEEDS
Paula Johnson
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Maurice H. Mahieu, in a field survey on September 4, 1998 and October 8, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. Original corner set by Joseph Wampler D.S. during February, 1826 "33.69 Intersect Meridian; Tam. 10 S 17E 5 DO. N 32 E 4".
2. An Act 132 survey recorded in Liber 3, Page 604 by Austin C. Williams R.L.S. #21275 on November 17, 1978. Monumentation not described. Witnesses: Nail and Tag in 12" Oak, West 29.25'; Nail and Tag in 8" Elm N 20° W 55.85'; Nail and Tag in 8" Elm S 15° E 45.28'. Corner lies 5845.69' South of A-1 as measured by Williams.
3. LCRC recorded in Liber 5, Page 67 by Austin C. Williams R.L.S. #21275 on November 17, 1978. "Original monument and accessories obliterated. Set 1/2" iron bar with identification cap by proportionate measurement North and South and in line with corners of Section 1, T1N, R1W. Measurements are in close accord with GLO records." Witnesses same as in #2.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" x 20" smooth iron rod +/-1.5' West of the centerline of Kelly Road (gravel) and 2.16' below gravel surface. No visible occupation lines East or West; area wooded and swampy. Corner was found to be +/- 2655.68' South of A-2 during a rough traverse. Found witness: Nail and ribbon in North side of an 18" Oak N 85° W 29.04'. Excavated a 4' x 3' x 4' deep area and found nothing. Measured the Standard Township Line and found 1/2" rod to be 5.77 feet West of Standard Line. Set 3/4" x 24" iron rod with cap due as an amended corner East 5.77 feet from found 1/2" rod. Measured 2655.78 feet North to A-2 (L9, P337); Corner falls 749.48 feet North of M-3 Leslie Township (L9, P284). Accepted North-South location of Williams Corner set amended corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

WILLIAMS CLOSING CORNER

Found 1/2" iron and replaced with 3/4" x 24" iron with aluminum P.A. 345 cap #28414. Witnesses:
Nail and Tag #28414 East side 18" Maple N 30° W 44.70'
Nail and Tag #28414 North side 18" Oak N 85° W 29.04'
Nail and Tag #28414 West side 12" Maple N 40° E 57.77'
Nail and Tag #28414 West side 12" Oak S 30° E 58.14'

AMENDED CORNER

Set 3/4" x 24" iron rod with aluminum cap #28414 on Standard Line. Witnessed by:
Nail & Tag #28414 East side 18" Maple N36°W 47.85'
Nail & Tag #28414 North side 18" Oak N86°W 34.79'
Nail & Tag #28414 West side 12" Maple N35°E 54.24'
Nail & Tag #28414 West side 12" Oak S25°E 55.48'

Signed by Maurice H. Mahieu
Surveyor's Michigan License No. 28414

Date 11-18-98

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975

REVISED JAN., 1983
REVISED OCT., 1995



P.A. 345 INGHAM COUNTY
PEER APPROVED 11/4/98 M

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey T 1N R 1E A-4
T R
T R
T R
2. Property Controlling S T R
In Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

B: 13 P: 184 11/06/2007 01:23 PM
2007-047410 LAND CORNERS Receipt #34179
Paula Johnson, Ingham County, Michigan

Pages: 1



Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Wendy S. Parsons, in a field survey on JUNE 13, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:

1. NOT SET BY GLO
2. DECEMBER 26, 1846 - COUNTY SURVEYOR NOTES - A. JACKSON
DISTANCE FROM A-5 TO A-3 = 79.03 CHAINS (5215.98)
3. FEBRUARY 8, 1848 - COUNTY SURVEYOR NOTES - A. JACKSON - SAME AS A2 ABOVE
4. MAY 15, 1848 - COUNTY SURVEYOR NOTES - A. JACKSON - SAME AS A2 ABOVE
5. NOVEMBER 14, 1977 - CETA FILES - "NO EVIDENCE VISIBLE, 1/2 MILE (WEST OF MERIDIAN ROAD) WOULD TAKE ONE INTO AN INDIVIDUALS YARD AS SCOFIELD JOGS NORTHWEST"
NO ADDITIONAL INFORMATION FOUND

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION FOR CORNER. NO EVIDENCE OF CORNER FOUND. CALCULATED CORNER A-4 POSITION AT THE MIDWAY POINT BETWEEN BUNKER HILL CORNERS THE A-3 STANDARD CORNER AS REMONUMENTED BY MAHIEU IN LIBER 9, PAGE 444 & A-5 AS REMONUMENTED BY PARSONS IN 2007. CALCULATED A-4 WILL BE SET ON THE LINE BETWEEN LESLIE M-3 (AS PREVIOUSLY REMONUMENTED BY MAHIEU IN LIBER 9, PAGE 284) AND LESLIE M-4 (AS SET BY LESTER IN LIBER 2, PAGE 611). REVIEWED ASSESSOR'S DESCRIPTIONS FOR PARCELS IN THE WEST 1/4 OF SECTION 7. DESCRIPTIONS DO NOT CALL OUT OR HAVE NO RELATION TO THE EAST-WEST 1/4 LINE THAT TERMINATES AT BUNKER HILL CORNER A4. ACCEPTED CALCULATED POSITION OF CORNER A-4 AND SET 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" COMPUTED LOCATION FOUND TO BE IN AN OLD DOWN NORTH-SOUTH FENCE LINE. EXCAVATED 2 FOOT x 2 FOOT x 2 FOOT DEEP AND DID NOT FIND ANY EVIDENCE OF CORNER. SAID POINT IS 635 FEET NORTH OF THE CENTERLINE OF SCOFIELD ROAD, MORE OR LESS.

MEASURED IN 2007 AS: A-4 TO A-3 (STANDARD CORNER) = 2626.72', A-4 TO M-3 = NORTH, 1877.27', A-4 TO M-4 = SOUTH 767.91', A-4 TO A-5 = 2626.72', A-4 TO C-4 = 2223.03'

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" AT THE MIDWAY POINT BETWEEN BUNKER HILL CORNERS THE A3 STANDARD CORNER AS REMONUMENTED BY MAHIEU IN LIBER 9, PAGE 444 & A5 AS REMONUMENTED BY PARSONS IN 2007. CALCULATED A4 SET ON THE LINE BETWEEN LESLIE M3 (AS PREVIOUSLY REMONUMENTED BY MAHIEU IN LIBER 9, PAGE 284) AND LESLIE M4 (AS SET BY LESTER IN LIBER 2, PAGE 611) IN AND OLD DOWN NORTH-SOUTH FENCE LINE. SAID POINT IS 635 FEET NORTH OF THE CENTERLINE OF SCOFIELD ROAD, MORE OR LESS.
N2°E 19.40' SET REMON NAIL & TAG, EAST SIDE 12" CHERRY
N50°E 8.68' SET REMON NAIL & TAG SOUTH SIDE 12" CHERRY
S20°W 34.85' SET REMON NAIL & TAG EAST SIDE 6" TWIN IRONWOOD
S88°W 27.20' SET REMON NAIL & TAG SOUTH SIDE 8" ELM

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2" ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

Signed by W.S.P. PS.


Date 10/29/07

Surveyor's Michigan License No. 47969

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 197
REVISED MAY 14, 197
REVISED JAN., 198
REVISED OCT., 198

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/25/2007 RL

| | | | | | | | | | | | | | |
|----|---|----|---|----|---|----|---|----|---|----|---|----|---|
| 1 | A | B | C | D | E | F | G | H | I | J | K | L | M |
| 2 | | 6 | | 5 | | 4 | | 3 | | 2 | | 1 | |
| 3 | | | | | | | | | | | | | |
| 4 | | 7 | | 8 | | 9 | | 10 | | 11 | | 12 | |
| 5 | | | | | | | | | | | | | |
| 6 | | 18 | | 17 | | 16 | | 15 | | 14 | | 13 | |
| 7 | | | | | | | | | | | | | |
| 8 | | 19 | | 20 | | 21 | | 22 | | 23 | | 24 | |
| 9 | | | | | | | | | | | | | |
| 10 | | 30 | | 29 | | 28 | | 27 | | 26 | | 25 | |
| 11 | | | | | | | | | | | | | |
| 12 | | 31 | | 32 | | 33 | | 34 | | 35 | | 36 | |
| 13 | | | | | | | | | | | | | |

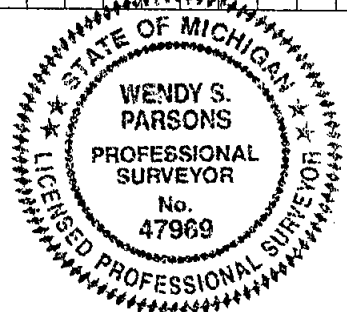

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey

T 1N R 1E A-5

2. Property Controlling
In Section

S T R

3. Miscellaneous
Property in Sec.

S T R
S T R
S T R

B: 13 P: 191 11/26/2007 08:28 AM
2007-049515 LAND CORNERS Receipt #34841
Paula Johnson, Ingham County, Michigan

Pages: 2



Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Wendy S. Parsons, in a field survey on JUNE 13, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. JANUARY-FEBRUARY 1826 - GLO - WAMPLER - INTERSECTED MERIDIAN
8" MAPLE N15°E 45 LINKS (29.7')
5" BLACK OAK S35°E 27 LINKS (17.82')
A-5 TO C-5 = 34.12 CHAINS (2251.92')

2. MAY 21, 1843 - COUNTY SURVEYOR NOTES - A. JACKSON
20" WHITE OAK N19-1/2°E 50 LINKS (33')
18" WHITE OAK N10°W 9 LINKS (5.94')
A6 - A5 = 157 RODS, 32 LINKS (2611.62')
A6 - C6 = 135 RODS, 21 LINKS (2241.36')

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION OF CORNER. FOUND IRON BAR AND CAP #28409 (RON ENGER) 0.25' WEST OF THE LINE BETWEEN LESLIE CORNER M5 (AS FOUND AND RESET BY YOUNG, LIBER 6, PAGE 10) AND LESLIE CORNER M4 (AS SET BY LESTER, LIBER 2, PAGE 611). FOUND FENCE LINE AND ANOTHER ENGER IRON (CORNER SET AS PART OF ITEM A8 ABOVE) WERE FOUND TO BE ON LINE BETWEEN ENGER'S POSITION AT A5 AND CORNER C5 (AS REMONUMENTED BY PARSONS IN 2007). ACCEPTED ENGER'S NORTH-SOUTH POSITION OF CORNER A5 AND REPLACED IT WITH A 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" ON THE M4-M5 LINE.

MEASURED IN 2007 AS: A5 - A4 = 2626.72', A5 - M4 = NORTH 1858.81', A5 - M5 = SOUTH, 787.15', A5 - A6 = 2612.89', A5 - C5 = 2241.07'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

ACCEPTED ENGER'S NORTH-SOUTH POSITION OF CORNER A5 AND REPLACED IT WITH A 3/4"x24" SOLID BAR WITH ALUMINUM INGHAM COUNTY REMONUMENTATION CAP STAMPED "INGHAM COUNTY PA 345 47969" ON THE M4-M5 LINE.

S60°E, 17.25' FOUND NAIL & TAG #28409 (ENGER), SOUTH SIDE, 16" CHERRY
S02°W, 25.48' SET REMON NAIL & TAG, WEST SIDE, 6" ASH
S35°W, 29.78' FOUND NAIL & TAG #28409 (ENGER), NORTH SIDE, 16" COTTONWOOD
S80°W, 12.64' FOUND NAIL & TAG #28409 (ENGER), SOUTH SIDE, 8" ASH

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2 " ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/25/2007

Signed by

WSP

Date 11/5/2007

Surveyor's Michigan License No.

47969

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

BUNKER HILL
INGHAM COUNTY

A5

PART A CONTINUED

3. MAY 21, 1843 - COUNTY SURVEYOR NOTES-- A. JACKSON
CORNER IS NOT DESCRIBED

WITNESSES: MAPLE 8" N15°E, 45 LINKS (29.7')
BLACK OAK 5" S55°E 27 LINKS (17.82')
WHITE OAK 12" S75-1/2°W, 50-1/2 LINKS (33.33')
A5 - C5 = 135 RODS, 14 LINKS (2236.74')
A5 - A6 = 157 RODS, 32 LINKS (2611.62')

4. DECEMBER 26, 1846 - COUNTY SURVEYOR NOTES-- A. JACKSON
CORNER IS NOT DESCRIBED

WITNESS: BLACK OAK 5" S55°E, 27 LINKS (17.82')
A5 - C5 = 135 RODS (2227.5')

5. FEBRUARY 8, 1848 - COUNTY SURVEYOR NOTES-- T.J. BROWN (DEPUTY SURVEYOR)
CORNER IS NOT DESCRIBED

WITNESS: BLACK OAK 5" S55°E, 27 LINKS (17.82')
A5 - C5 = 33.75 CHAINS (2227.5')
A5 - A3 = 79.03 CHAINS (5215.98')

6. MAY 15, 1848 - COUNTY SURVEYOR NOTES-- A. JACKSON
CORNER IS NOT DESCRIBED

WITNESS: BLACK OAK 5" S55°E, 27 LINKS (17.82')
A5 - C5 = 33.75 CHAINS (2227.5')
A5 - A3 = 79.03 CHAINS (5215.98')

7. MAY 1888 - HAND WRITTEN NOTES IN GLO RECORDS

HICKORY 6" N01°E 120
HICKORY 5" N25-1/2°W 113

8. JULY 7, 2003 - FIELD NOTES SUPPLIED BY RON ENGER P.S. # 28409
SET 5/8" REBAR & CAP #28409 ON EXTENSION OF FENCE TO EAST ON LINE WITH
CORNERS M5 AND M4 T1NR1W
S62°E 17.26' NAIL & TAG #28409 IN SOUTH SIDE 15" CHERRY
S81°W 12.59' NAIL & TAG #28409 IN SOUTH SIDE 8" ELM
S47°W 29.71' NAIL & TAG #28409 IN MW SIDE 12" COTTONWOOD
EAST 4.51' TOP OF POINTED IN E SIDE ANCHOR POST HOLE

9. JULY 22, 2003 - UNRECORDED SURVEY - RON ENGER P.S. # 28409

SET 5/8" REBAR & CAP #28409
S62°E 17.26' NAIL & TAG #28409 IN SOUTH SIDE 15" CHERRY
S81°W 12.59' NAIL & TAG #28409 IN SOUTH SIDE 8" ELM
S47°W 29.71' NAIL & TAG #28409 IN MW SIDE 12" COTTONWOOD
EAST 4.51' TOP OF POINTED IN E SIDE ANCHOR POST HOLE

NO ADDITIONAL INFORMATION FOUND

DEC 17 1993

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Liber 9 Page 342

For corners in BUNKERHILL TOWNSHIP

INGHAM COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 1N R 1E

C-3

2. Property Controlling
In Section

S

T R

3. Miscellaneous
Property In Sec.

S

T R

4. Lot No. , Recorded Plat

5. Private Claims

I, Maurice H. Mahieu, in a field survey on July 30, 1993, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. Original corner set by Joseph Wampler D.S. during February, 1826. "Set a post at the corner of Sec. 5, 6, 7 & 8 in prairie; W.O. 16 N 33 W 216; Aspen 8 N 73 W 55".

2. Additional notes to Wampler's: "Iron pump set for corner by A. P. Drake."

3. Road Commission map dated 1971 describes corner as a 7/8" Iron with the following witnesses: Quad. Willow ENE 65.85°; St. Cor. Post East 25.29°; St. Cor. Post W 25.48°; 8" Pine WNW 33.90°.

4. LCRC recorded in Liber 5, Page 205 on March 19, 1979 by Ron Helsel RLS #18994. Monumentation not specifically described; "Monument Box in centerline of Meridian Road on line with fence to East, 4' North of fence to West." Helsel does make reference to monumentation and witnesses as in #3, but in the 'A. Description of original monument....' section. Witnesses: S 85° W 34.59 ft. 8 ft. Wood Anchor Post; N 85° W 34.15 ft. 12" Pine; East 32.54 feet, Steel Post; N 75° E 34.06 ft. 10" Elm.

(Continued On Back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1" pipe in monument box in centerline Meridian Road and on occupation line to East and West. Found Witnesses: Nail and Tag #18998 Ronnie Lester P.S., North side 17" Red Pine N 85° W 33.89°; 6" x 4" x 8' Wood Anchor Post S 85° W 34.59°; Steel Post East 32.54'. Excavated a 2' x 2' x 2.5' area. Pulled pipe out at this point. Pipe measured 4.25' in length. Bottom of pipe was very wet and mucky, therefore excavation was stopped for fear of tapping water table (Land to East Swampy). Position of pipe is best location of obliterated corner. Nothing found in hole. Replaced pipe with a 3/4" Iron and aluminum P.A. 345 Cap #28414 and reset monument box around.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found 1" pipe and replaced with 3/4" Iron and aluminum P.A. 345 cap #28414

Witnessed by:

Nail and Tag #18998 North side 17" Red Pine N 85° W 33.89°

Nail and Tag #28414 Southwest side 4" Willow S 45° E 71.12°

Nail and Tag #28414 South side 6" x 4" Wood Post S 85° W 34.97°

Nail and Tag #28414 West side Wood Post to mailbox #2900 N 15° E 89.45°

Signed by

Maurice H. Mahieu

Date

9-17-98

Surveyor's Michigan License No. 28414

FILED

980049405
09/29/1998 10:51:42
REGISTER OF DEEDS
Paula Johnson
INGHAM COUNTY, MI

Register of Deeds Stamp & File Number

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|---|---|---|---|---|---|---|---|---|---|---|---|---|
| 1 | | | | | | | | | | | | | |
| 2 | | | | | | | | | | | | | |
| 3 | | | | | | | | | | | | | |
| 4 | | | | | | | | | | | | | |
| 5 | | | | | | | | | | | | | |
| 6 | | | | | | | | | | | | | |
| 7 | | | | | | | | | | | | | |
| 8 | | | | | | | | | | | | | |
| 9 | | | | | | | | | | | | | |
| 10 | | | | | | | | | | | | | |
| 11 | | | | | | | | | | | | | |
| 12 | | | | | | | | | | | | | |
| 13 | | | | | | | | | | | | | |



A. (CONTINUED)

5. An Act 132 survey recorded in Liber 3, Page 804 on March 19, 1979 by Ron Helsel RLS #18994. Monumentation and Witnesses as in #4.
6. An Act 132 survey recorded in Liber 3, Page 1008 on August 17, 1979 by Maynard R. Dyer RLS #21565. Monumentation described as found 7/8" rod in monument box. Witnesses same as #4.
7. An Act 132 survey recorded in Liber 7, Page 742 on February 23, 1996 by Maurice H. Mahieu P.S. #28414. Monumentation described as found 1/2 iron rod in monument box. Witnesses: Nail and Tag #12034 Fred White P.S., South side Wood Fence post, West 34.75'; Nail and Tag #18998 North side 18" Pine, N 80° W 33.84'; Nail and Tag #28414 East side 12" Maple N 40° W 87.07'; Nail and Tag #28414 Top West end 12" C.M.P., S 30° W 56.52'.

RECEIVED
TAXATION

DEC 17 1998

SECTION

| | |
|----------|-------|
| Rcpt. No | 97035 |
| CRRR | 9.00 |
| MSSR | 2.00 |
| Total | 11.00 |

79

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In:

Corner Code #

1. Public Land Survey

T 1N R 1E C-4

2. Property Controlling
In Section

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

B:13 P:1 11/14/06 9:02 AM Pages: 2
2006-057177 LAND CORNERS Receipt #19436
Paula Johnson, Ingham County, Michigan



Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Wendy S. Parsons, in a field survey on APRIL 24, 2006 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. JANUARY-FEBRUARY, 1826 - GLO - J. WAMPLER, SET QUARTER POST
11" WHITE OAK S53°W 16 LINKS (10.56')
14" WHITE OAK N15°E 24 LINKS (15.84')
C4 - C5 = 40 CHAINS (2640 FEET), C4 - C3 = 40 CHAINS (2640 FEET)

2. COUNTY SURVEYOR NOTES - HANDWRITTEN COMMENT IN GLO NOTES: "TILE AT CORNER" (PROBABLY COUNTY SURVEYOR)

CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION FOR CORNER. FOUND 1/2" BAR & CAP #28409 (RON ENGER) IN MONUMENT BOX AT THE INTERSECTION OF MERIDIAN ROAD (ASPHALT) AND CATHOLIC CHURCH ROAD (ASPHALT). FOUND THREE OF ENGER'S 1989 WITNESSES. ALSO FOUND TIES TO ADJACENT GOVERNMENT CORNERS TO BE CONSISTENT WITH DYER'S 1979 SURVEY AND WHITE'S 1972 SURVEY. EXCAVATED TO 3 FEET AND NO ADDITIONAL INFORMATION WAS FOUND. REPLACED FOUND BAR & CAP WITH 3/4" X 24" SOLID BAR AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 IN EXISTING MONUMENT BOX IN ASPHALT PAVEMENT AT THE INTERSECTION OF MERIDIAN ROAD AND CATHOLIC CHURCH ROAD. MEASURED IN 2006 AS C4 - C3 = 2608.11' AND C4 - C5 = 2642.40'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REPLACED FOUND BAR & CAP WITH 3/4" X 24" SOLID BAR AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 IN EXISTING MONUMENT BOX IN ASPHALT PAVEMENT AT THE INTERSECTION OF MERIDIAN ROAD AND CATHOLIC CHURCH ROAD.

N22°E 133.70' FOUND NORTH EDGE ANGLE IRON FENCE POST
N78°E 99.00' FOUND EAST EDGE ANGLE IRON FENCE POST
N83°W 22.76' FOUND SOUTH STEEL POST OF SIGN
S55°E 80.6' SET REMON NAIL & TAG ON NORTHEAST SIDE 6" TWIN BOX ELDER
N45°W 71.62' SET REMON NAIL & TAG ON NORTH SIDE UTILITY POLE

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2" ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

P.A. 345 INGHAM COUNTY
PEER APPROVED 5/23/2006 AC

Signed by

WSP

Date

11/14/06

Surveyor's Michigan License No.

47969

INGHAM COUNTY
BUNKER HILL
T1N-R1E
C4

3. CETA FILES - NO INFORMATION FOUND

4. JANUARY 1, 1972 ROAD COMMISSION NOTES - NO INFORMATION FOUND

5. DEC. 18, 1972 - PA 132 - LIBER 1, PAGE 614 - FRED WHITE, PS #12034
2" STEEL STREET SIGN - N20°30'E, 72.93'
ANCHOR POLE - N55°00'E, 98.72'
TELEPHONE POLE - S18°00'W, 83.80'
C4 - C5 = 3248.6' (PROBABLE TYPO - SHOULD READ 2642.08')

6. DEC. 19, 1972 - PA 74 - LIBER 2, PAGE 345 - FRED WHITE, PS #12034
A. ORIGINAL CORNER & WITNESSES OBLITERATED
B. FOUND BOAT SPIKE PRESUMED TO HAVE BEEN SET BY ICRC
C. BOAT SPIKE
2" STEEL STREET SIGN - N20°30'E, 72.93'
ANCHOR POLE - N55°00'E, 98.72'
TELEPHONE POLE - S18°00'W, 83.80'

7. JULY 17, 1979 - PA 132 SURVEY - LIBER 3, PAGE 1008 - MAYNARD DYER, PS #21565
REFERS TO LIBER 2, PAGE 345
2" STEEL SIGN POST, N20°30'E, 72.93'
ANCHOR POLE, N55°00'E, 98.72'
TELEPHONE POLE, S18°00'W, 83.80'
C4 - C3 = 2608.54

8. OCTOBER 18, 1989 - PA 132 SURVEY - LIBER 6, PAGE 447 - RON ENGER, PS #28409
SET 1/2" BAR & CAP LS 28409
N. EDGE ANGLE IRON FENCE POST IN CONCRETE, MAG. NAZ 22°, 133.7'
E. EDGE ANGLE IRON FENCE POST IN CONCRETE, MAG. NAZ 78°, 99.0'
ABANDONED POLE GUY ANCHOR, MAG. NAZ 323°, 48.92'
FD. BOAT SPIKE, MAG. NAZ 183°, 605.72'
S. STEEL POST OF DOUBLE POST SIGN, MAG. NAZ 277°. 22.76'
C4 - C5 = 2642.44'

9. MAY 6, 1992 - PA 132 SURVEY - LIBER 6, PAGE 1138 - RON HELSEL, PS #18994
REFERS TO LIBER 2, PAGE 345
E/SD, E/LG, RD SN S10°W, 105.86'
S/SD, S/LG, RD SN WEST, 22.81'
A. IRON, FNC PST N55°E, 98.72'
C4 - C5 = 2642.55'

10. AUGUST 12, 1993 - PA 132 SURVEY - LIBER 7, PAGE 66 - RON ENGER, PS #28409
1/2" BAR & CAP LS 28409
N. EDGE ANGLE IRON FENCE POST IN CONCRETE, MAG. NAZ 22°, 133.7'
E. EDGE ANGLE IRON FENCE POST IN CONCRETE, MAG. NAZ 78°, 99.0'
ABANDONED POLE GUY ANCHOR, MAG. NAZ 323°, 48.92'
FD. BOAT SPIKE, MAG. NAZ 183°, 605.72'
S. STEEL POST OF DOUBLE POST SIGN, MAG. NAZ 277°. 22.76'
C4 - C5 = 2642.44'

11. DEC. 13, 1995 - PA 132 SURVEY - LIBER 7, PAGE 742 - MAURICE MAHIEU, PS#28414
FOUND 1/2" IRON ROD #28409 IN CL MERIDIAN ROAD
N. EDGE ANGLE IRON FENCE POST IN CONCRETE, MAG. NAZ 22°, 133.7'
E. EDGE ANGLE IRON FENCE POST IN CONCRETE, MAG. NAZ 78°, 99.0'
ABANDONED POLE GUY ANCHOR, MAG. NAZ 323°, 48.92'
FD. BOATSPIKE, MAG. NAZ 183°, 605.72'
S. STEEL POST OF DOUBLE POST SIGN, MAG. NAZ 277°. 22.76'
C4 - C3 = 2608.49'

12. NO FURTHER EVIDENCE FOUND



LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
BUNKER HILL TOWNSHIP
INGHAM COUNTY

Located In: Corner Code #

1. Public Land Survey

T 1N R 1E C-5

2. Property Controlling
In Section

S T R

3. Miscellaneous
Property in Sec.

S T R

B:13 P:6 11/17/06 8:31 AM Pages: 2
2006-057969 LAND CORNERS Receipt #19658
Paula Johnson, Ingham County, Michigan



Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Wendy S. Parsons, in a field survey on APRIL 24, 2006 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Degree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. JANUARY-FEBRUARY, 1826 - GLO - J. WAMPLER,
SET POST AT CORNER OF SECTION 7, 8, 17 & 18
12" WHITE OAK S75-1/2°W 50-1/2 LINKS (33.33')
13" WHITE OAK N71°E 53 LINKS (34.98')

C6 - C5 = 40 CHAINS (2640 FEET), C5 - C4 = 40 CHAINS (2640 FEET),
C5 - A5 = 34.12 CHAINS (2251.92 FEET)

2. JANUARY 17, 1843 - COUNTY SURVEYOR NOTES - A. JACKSON
13" WHITE OAK N71°E 53 LINKS (34.98')

3. MAY 21, 1843 - COUNTY SURVEYOR NOTES - A. JACKSON
13" WHITE OAK N71°E 53 LINKS (34.98')
24" BLACK OAK N82°W 32 LINKS (21.12')

C5 - A5 = 135 RODS 14 LINKS (2236.74') (ALSO SHOWN AS 33.89 CHAINS = 2236.74'), C5 - C6 = 158 RODS 30 LINKS (2626.8')

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|---|----|---|----|---|----|---|----|---|----|---|---|
| 1 | | | | | | | | | | | | | |
| 2 | 6 | | 5 | | 4 | | 3 | | 2 | | 1 | | |
| 3 | | | | | | | | | | | | | |
| 4 | 7 | | 8 | | 9 | | 10 | | 11 | | 12 | | |
| 5 | | | | | | | | | | | | | |
| 6 | 18 | | 17 | | 16 | | 15 | | 14 | | 13 | | |
| 7 | | | | | | | | | | | | | |
| 8 | 19 | | 20 | | 21 | | 22 | | 23 | | 24 | | |
| 9 | | | | | | | | | | | | | |
| 10 | 30 | | 29 | | 28 | | 27 | | 26 | | 25 | | |
| 11 | | | | | | | | | | | | | |
| 12 | 31 | | 32 | | 33 | | 34 | | 35 | | 36 | | |



CONTINUED ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SEARCHED APPARENT LOCATION FOR CORNER. FOUND BENT BOAT SPIKE IN MONUMENT BOX IN THE CENTERLINE OF MERIDIAN ROAD (ASPHALT). FOUND THREE WITNESSES, TWO OF WHICH ARE CONSISTENT WITH ENGER'S 1989 INFORMATION. MEASUREMENT TO C4 TO THE NORTH WAS CONSISTENT WITH WHITE'S 1972 SURVEY. EXCAVATED TO 3.0 FEET. NO ADDITIONAL INFORMATION WAS FOUND. REPLACED FOUND BOAT SPIKE WITH 3/4" X 24" SOLID BAR AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 IN EXISTING MONUMENT BOX IN ASPHALT PAVEMENT IN THE CENTERLINE OF MERIDIAN ROAD.
MEASURED IN 2006 AS C5 - C4 = 2642.40'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REPLACED FOUND BOAT SPIKE WITH 3/4" X 24" SOLID BAR AND 2-1/2" ALUMINUM CAP MARKED PA 345 INGHAM COUNTY AND STAMPED PS 47969 IN EXISTING MONUMENT BOX IN ASPHALT PAVEMENT IN THE CENTERLINE OF MERIDIAN ROAD.

WEST 32.85' FOUND NORTHWEST EDGE ANGLE IRON FENCE POST
N50°E 127.45' NORTHWEST CORNER BRICK CHURCH
N15°E 155.65' FOUND TOP CENTER 4-1/2" DIAMETER FENCE POST
S19°W 87.65' REMON NAIL & TAG ON SOUTHEAST SIDE 14" ELM
S16°E 135.00' SOUTHWEST EDGE ANGLE IRON FENCE POST

P.A. 345 INGHAM COUNTY
PEER APPROVED 5/23/2006

REMON NAIL & TAG = SET MAGNETIC NAIL AND 1-1/2" ALUMINUM TAG STAMPED "INGHAM COUNTY WITNESS PA 345"

Signed by

Date 11/06/06

Surveyor's Michigan License No. 47969

INGHAM COUNTY
BUNKER HILL
T1N-R1E
C5

4. DECEMBER 21, 1846 - COUNTY SURVEYOR NOTES - A. JACKSON
SAME AS GLO NOTES
C5 - A5 = 135 RODS (2227.5')

5. DECEMBER 26, 1846 - COUNTY SURVEYOR NOTES - A. JACKSON
SAME AS GLO NOTES
C5 - A5 = 33.75 CHAINS (2227.5'), C5 - C4 = 30.75 CHAINS (2029.50')

6. FEBRUARY 8, 1848 - COUNTY SURVEYOR NOTES - THOMAS J. BROWN, DEPUTY COUNTY
SURVEYOR
C5 - A5 = 135 RODS (2227.5')

7. MAY 15, 1848 - COUNTY SURVEYOR NOTES - A. JACKSON
SAME AS A6 ABOVE

8. MAY 10, 1888 - COUNTY SURVEYOR NOTES - (HANDWRITTEN IN GLO NOTES)
1" SUGAR MAPLE S47°W 45-1/2 (30.03')
1" SUGAR MAPLE N51°W 43 (28.38')

9. JANUARY 1, 1972 - INGHAM COUNTY ROAD COMMISSION GRID MAP
STONE CROCKERY
NW CORNER CHURCH SHED WALL 54.4'
SW COR. CHURCH 126.3'

10. CETA FILES - NO INFORMATION FOUND

11. DEC. 18, 1972 - PA 132 - LIBER 1, PAGE 614 - FRED WHITE, PS #12034
20" CHERRY, N65°00'E, 25.87'
20" MAPLE - EAST 56.40'
ANCHOR POST - WEST 27.33'
C4 - C5 = 3248.6' (PROBABLE TYPO - SHOULD READ 2642.08')

12. DEC. 19, 1972 - PA 74 - LIBER 2, PAGE 345 - 614 - FRED WHITE, PS #12034
A. ORIGINAL CORNER & WITNESSES OBLITERATED
B. FOUND BOAT SPIKE PRESUMED TO HAVE BEEN SET BY ICRC
C. BOAT SPIKE
20" CHERRY, N65°00'E, 25.87'
20" MAPLE - EAST 56.40'
ANCHOR POST - WEST 27.33'

13. OCTOBER 18, 1989 - PA 132 SURVEY - LIBER 6, PAGE 447 - RON ENGER, PS #28409
FOUND BOAT SPIKE
FD. NAIL & TAG #12034 N. SIDE 22" CHERRY, N80°E, 26.1'
METAL ANGLE IRON FENCE CORNER POST, WEST, 32.79'
SET 16d DUPLEX NAIL & SHINER E. SIDE 26" WALNUT, S20°E, 152.60'
CL. 30"+ TREE WITH SPLIT TRUNK (NOT A MAPLE), EAST 56.6'
NW CORNER BRICK CHURCH, N50°E, 127.5'
TOP CENTER 4-1/2" DIA. STEEL PIPE FENCE POST, N15°E, 155.8'
C5 - C4 = 2642.44'

14. MAY 6, 1992 - PA 132 SURVEY - LIBER 6, PAGE 1138 - RON HELSEL, PS #18994
REFERS TO LIBER 2, PAGE 347
N&T 12034 20" CHERRY N65°E, 25.81'
N&T 12034 20" MAPLE EAST 56.40'
NE/COR ST. ANG. PST WEST, 32.80'
N&T N/SD WD FNC. PST S60°W 38.28'
C5 - C4 = 2642.55'

15. AUGUST 12, 1993 - PA 132 SURVEY - LIBER 7, PAGE 66 - RON ENGER, PS #28409
BOAT SPIKE
FD. NAIL & TAG #12034 N. SIDE 22" CHERRY, N80°E, 26.1'
METAL ANGLE IRON FENCE CORNER POST, WEST, 32.79'
SET 16d DUPLEX NAIL & SHINER E. SIDE 26" WALNUT, S20°E, 152.60'
CL. 30"+ TREE WITH SPLIT TRUNK (NOT A MAPLE), EAST 56.6'
NW CORNER BRICK CHURCH, N50°E, 127.5'
TOP CENTER 4-1/2" DIA. STEEL PIPE FENCE POST, N15°E, 155.8'
C5 - C4 = 2642.44'

16. NO FURTHER EVIDENCE FOUND

