SECTION

NORTHWEST CORNER, SECTION 18, T2N RIE, INGHAM TWP, INGHAM CO., MICH. FOUND' 1/2" IRON ROD WITNESSED BY:
N8 T# 28414 W. SIDE 36" OAK, S 5° E, 6.50'
N8 T# 28414 W. SIDE 28" OAK, N 0° E, 5.55'
N8 T# 28414 S. SIDE 28" OAK, N 45° E, 8.20'
1/2" IRON PIPE, EAST, 14.95'

NORT.H

S 899 28' 05" E

\$89°28',05"E

ō 660

8

8 ဗ

8

160.

8

8

8

Si

1.00'4


Sī

\$89°28' 05" 91.09

N

SEP 4 11 41 AM 192 REGISTER OF DEEDS Bank Jordnam INGHAM COUNTY, MICH.

RECORDING SPACE



NORTHEAST, CORNER, SECTION 18, T2N RIE, INGHAM TWP, INGHAM CO., MICH. FOUND !/2" PIPE WITNESSED BY: NAT#11370 S. SIDE UTILITY POLE, WEST, 26.50 N A T #28414 W. SIDE WOOD FENCE POST, N 45°E, 51.20' N 8 T #28414 N. SIDE 18" ELM, S80°E, 8 73.95 MERIDIAN

BROWN RD.

N& T#28414 S. SIDE 4" CHESTNUT, N 75°E, _67.60'

660.00

ш

z

z 0

O

لنا S

ഗ

8

8

ક 18 18

500 ≥ تط

800

SI

33.00

P.O.B. 660,00 \$89° 28' Q5" E

10,001 AC ±

N 89° 28' 05" W

751.09

NO. 00, 00, E 1479.43

EAST 1/4 CORNER, SECTION 18, T2N RIE, INGHAM TWP, INGHAM CO., MICH. FOUND 1/2" IRON & MERIDIAN RD. WITNESSED BY: WITHESSED BTNRT#28414 E SIDE UTILITY POLE
S45°W, 36.75'
NRT#18998 TOP WOOD FENCE POST
EAST, 30.10'
C CONSUMERS POWER GAS SIGN POST, N 45°E, 36.20' © CONSUMERS POWER GAS SIGN POST, N45° W, 41.35

OF HICH MAURICE H 加州四 LAND SURVEYOR 6-16-92

LEGEND

ALL DIMENSIONS ARE IN FEET AND DECIMALS THEREOF D= DEEDED FI= FOUND IRON D= DEEDED
P= PLATTED
M= MEASURED SI= SET IRON

PROPERTY CORNER IRON CONCRETE MONUMENT FENCE UNE Ω

4213



WOLVERINE ENGINEERS & SURVEYORS, INC 312 NORTH ST. MASON, MICHIGAN 48854 PHONE (517) 676-9200

SURVEY	FOR:	REX	JORDAN

FIELD SURVEY: T. YOUNG	DATE: 5/4/92
DRAWN BY: R. BINDER	SHEET: 1 OF 2
SCALE: 1" = 200"	JOB NO.: 920063

DESCRIPTION

Part of the Northeast 1/4 of Section 18, T2N, R1E, Ingham Township,
Ingham County, Michigan, described as beginning at a point on the
East section line S 00° 00' 00" E 660.00 feet from the Northeast
Corner of Section 17; thence S 00° 00' 00" E 500.00 feet along the
East section line; thence N 89° 28' 05" W 751.09 feet parallel with
the North section line; thence N 00° 00' 00" E 1,160.00 feet parallel
with the East section line to the North section line; thence S 89° 28' 05" E 91.09 feet
along the North section line; thence S 00° 00' 00" E 660.00 feet parallel with the East
section line; thence S 89° 28' 05" E 66C.00 feet parallel with the North section line to
the point of beginning and containing 10.001 acres of land more or less and subject to

All bearings are referenced to the East section line of Section 18, which is assumed to bear N $00^{\circ}~00'~00''$ E.

I hereby certify that I have surveyed and mapped the land above platted and/or described on June 4, 1992, and that the ratio of closure on the unadjusted field observations of such survey was 1/10,000, and that all of the requirements of P.A. 132 1970 have been complied with.

Maurice H. Mahieu, L.S. #28414

any easements and/or rights of way of record.



LEGEND


ALL DIMENSIONS ARE IN FEET AND DECIMALS THEREOF
D= DEEDED Fi= FOUND IRON
P= PLATIED SI= SET IRON
M= MEASURED

PROPERTY CORNER IRON © CONCRETE MONUMENT OF FENCE LINE




WOLVERINE ENGINEERS & SURVEYORS, INC 312 NORTH ST MASON, MICHIGAN 48854 PHONE (517) 676-9200

SURVEY FOR: REX JORDAN	
FIELD SURVEY: T. YOUNG	DATE: 6/4/92
	SHEET: 2 OF 2
SCALE: !"= 200"	JUB NO.: 920063

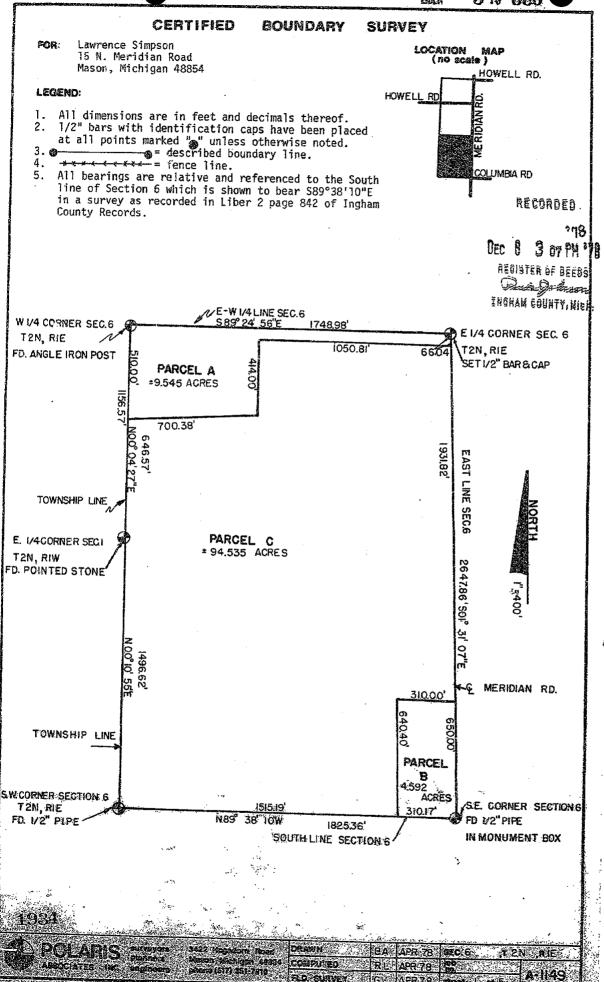

LEGAL DESCRIPTION: PARCEL B

A parcel of land in fractional Section 6, T2N, R1E, Ingham Township, Ingham County, Michigan; the surveyed boundary of said parcel being described as beginning at the Southeast corner of said Section 6; thence N89°38'10"W along the South line of said Section 6, 310.17 feet; thence N01°31'07"W parallel with the East line of said Section 6, 640.40 feet; thence N88°35'24"E, 310.00 feet to the East line of said Section 6; thence S01°31'07"E along the East line of said Section 6, 650.00 feet to the point of beginning of this description; said parcel containing 4.592 acres more or less including 0.492 acres more or less presently in use as public right of way; said parcel subject to all easements and restrictions of record.

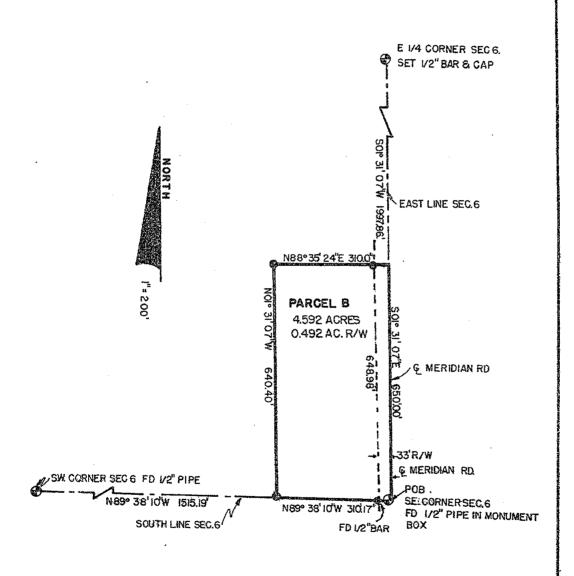

	123		ini Tarihir e	100 CM		ر السياد فقا
42.2		949	\$1988°		200	1.77.70
			A +A	7.14	n Re	gistarec
					Lo	16
24.50	医 国金统	MOCO		200		40.5

422 Italian Octob		

ينهم كالمعاول مواد	11 1 May 2 2 2 2		are area.		
CRAY		BA	APR 76	sec.6 ∓ 2	N RIE
COM	UTED	- RL	4PR 78	drawing no	January Older See Co
FLG.	SURVEY	GV	MAR-78	shoot 3 of 5	TA-HAG


2N

RIE

CERTIFICATE OF SURVEY

LEGAL DESCRIPTION: PARCEL C

A parcel of land in fractional Section 6, T2N, R1E, Ingham Township, Ingham County, Michigan; the surveyed boundary of said parcel being described as commencing at the Southeast corner of said Section 6; thence NO1°31'07"W along the East line of said Section 6, 650.00 feet to the point of beginning of this description; thence S88°35'24"W, 310.00 feet; thence S01°31'07"E parallel to the East line of Section 6, 640.40 feet to the South line of Section 6; thence N89°38'10"W along the South line of said Section 6, 1515.19 feet to the Southwest corner of said Section 6; thence N00°10'55"E along the West line of said Section 6, 1496.62 feet to the East 1/4 corner of Section 1, T2N, R1W; thence N00°04'27"E along the West line of said Section 6, 646.57 feet; thence N88°07'46"E, 700.38 feet; thence N00°04'27"E parallel to the West line of said Section 6, 414.00 feet to a point 66 feet Southerly of the E-W 1/4 line of said Section 6; thence S89°24'56"E parallel to and 66 feet distant from the E-W 1/4 line of Section 6, 1050.81 feet to a point on the East line of said Section 6, thence S01°31'07"E along said East line, 1931.82 feet to the point of beginning of this description; said parcel containing 94.537 acres more or less including 1.464 acres more or less presently in use as public ritht of way; said parcel subject to all easements and restrictions of record.

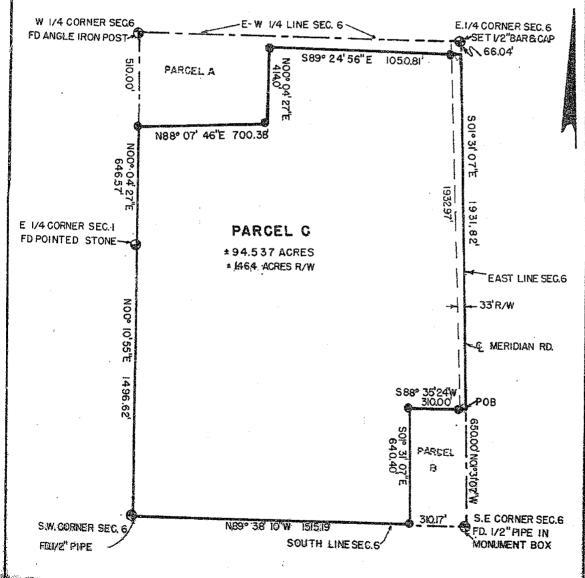

1934

	NAME OF THE POST OF THE PARTY O	A STANDARD CO. I.	tage to the first of the same
	1001810190 3422 None to	DRAWN: 1	RA IAPR 78 fee 6 -
			BA APR 78 SEC 6 T
Accession		18854 COMPUTED	FL APP 78 straining no.
TOWN IEE . INC	durveyora - Johann (517) 561-721		The second secon
		FID CHEVOY	And the second s

WITNESSES TO GOVERNMENT CORNERS:

East 1/4 Corner Section 1, T2N, R1W 12" maple N35°W, 31.28' 10" elm, S58°W, 15.23' 5" elm, South, 6.34'

SE Corner Section 6, T2N, RIE 24" maple, N20°W, 141.58' 8" butternut, N80°W, 32.00' Telephone Pole, N46°E, 43.96'

SW Corner Section 6, T2N, R1E 3" steel post, East 1.25' 30" stump, North, 20.08' 26" walnut, S35°W, 132.00'

West 1/4 Corner Section 6, T2N, R1E
Nail & tag in West side 18" oak, E.S.E., 12.96'
Nail & tag in North side 18" oak, East, 28.59'
Nail & tag in West side 12" oak, S.E., 17.53'

East 1/4 Corner Section 6, T2N, R1E Nail & tag #17022 West side fence post, NE, 59.59' Nail & tag #17022 South side post, E.N.E., 27.11' Nail & tag #17022 S.E. side p. pole, S.W., 134.63'

CERTIFICATE OF SURVEY:

I hereby certify to the parties named hereon that we have surveyed and divided into several parcels, at the direction of said parties, a tract of land previously described as:

The South 1/2 of fractional Section 6, T2N, RIE, Ingham Township, Ingham County, Michigan

and that we have found or set, as noted hereon permanent markers to all corners and angle points of the boundary of the parcel shown hereon and that the more particular legal description of said parcel is as designated hereon.

This survey complies with the requirements of P.A. 132 of 1970.

This survey was performed with an error of closure no greater than a ratio of l in 25,000.

Ronnie M. Lester
Registered Land Surveyor #18998




1934

POLARIS surveyors 342 hagadorn planners Mason Michigan 4885 ASSOCIATES MG. segress poore (S)7) 3527410

| DRAWN | BA | APR78 | SEC.6 | F2N | RE | COMPUTED | RE | APR678 | F10 | Fac. | COMPUTED | GV | APR78 | Side | 5 | 01 5 | A-1149 |

A part of the SW 1/4 of Section 5, T2N-RIE, Ingham Township, Ingham County, Michigan, described as follows: Beginning at the SW corner of said Section: 5, thence N.1°45'W., 368.58 feet, along the centerline of Meridian Road, also being the West section line of said Section 5, thence due East 650.0 feet, thence S.1°45'E., 368.58 feet, thence due West 650.0 feet along centerline of Columbia Road, also being South section line of said Section 5, to the point of beginning containing 5.5 acres more or less and subject to road easement for Meridian and Columbia Roads.

RECORDED

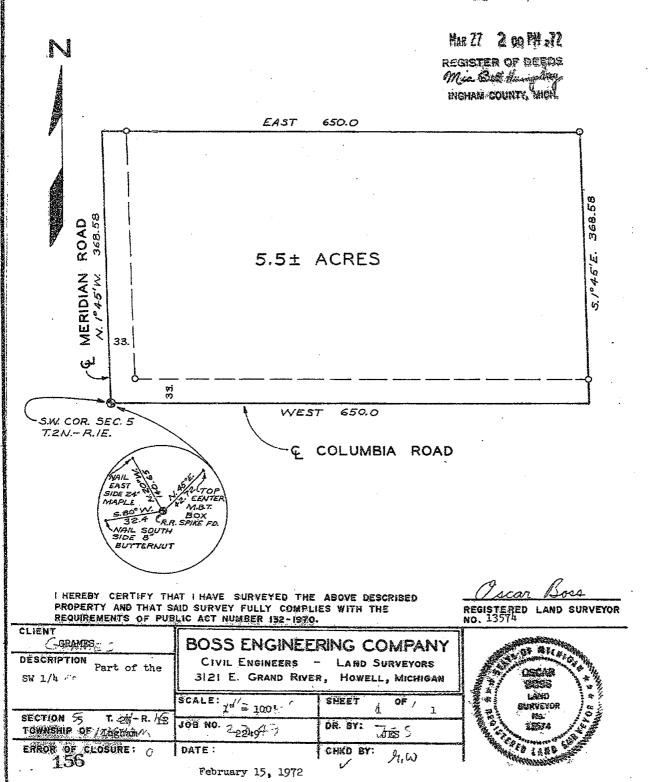

LIBER

RECORDED


CERTIFICATE OF SHRVFY

FOR: Jacob Strobe!

Sheet I of 4

LEGAL DESCRIPTION: See Sheets 3 & 4

Jul 26 1 36 PH 76 REGISTER OF DEEDS Comile M. Leurin INGHAM COURTY, MICH

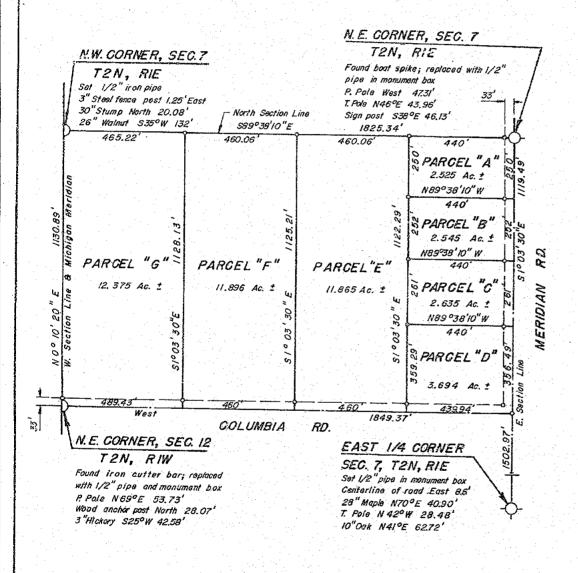

I CERTIFY THAT THIS MAP CORRECTLY REPRESENTS A SURVEY MADE UNDER MY SUPERVISION OF THE LAND DESCRIBED ABOVE IN COMPLIANCE WITH THE REQUIREMENTS OF PUBLIC ACT 132 OF 1970, THE RELATIVE ERROR OF CLOSURE BEING NO GREATER THAN 1 PART IN 5000; AND THAT THE EN-CROACHMENTS AFFECTING SAID LAND, IF ANY, ARE LOCATED AS SHOWN HEREON.

DATE 6- 14 - 76

G. A. STEADMAN & SON, INC.

improvements not located o Indicates 1/2" pipe set

£ Columbia Rd. assumed to bear East-West

LAND SURVEYING & ENGINEERING 3236 W. ST. JOSEPH ST. LANSING, MICHIGAN 48917

Dictard W. Steadman REGISTERED LAND SURVEYOR #11370

RICHARD W. Steadman SURVEYOR

2 % 343 LIBER

ğ

CERTIFICATE OF SURVEY

FOR: Jacob Strobe!

Sheet 2 of 4

LEGAL DESCRIPTION: See Sheet 4

N.E. CORNER, SEC. 12, T2N, RIW Found iron cutter bar; Replaced with 1/2" iron pipe in monument box

Power pole N69°E 53.73' Wood anchor post North 28.07' 3" Hickory \$25°W 42.58'

West

N.E. CORNER, SEC. 7, T2N, RIE Found boat spike; Replaced with 1/2" iron pipe in monument box

Power pale West 47.31' Telephone pole N46°E 43.96' Sign post S38°E 46.13'

& COLUMBIA ROAD

1849.37

(64.511 ACRES)

PARCEL H = 82.838 ACRES 1 (TOTAL)

1879.85

E-W 1/4 Line

(18.327 ACRES)

tron pipe on Sec. Line fails 3.2' West of anc. post

S. Line - N. 18 Acres of S. frl. 1/2 - Sec. 7 (fence) N 89°39'50"E 1888.43

E. 1/4 CORNER, SEC. 12,

T2N, RIW Found "I" iron at anc. post

12" Basswood N30°W :2.68' 15" Basswood S40°W 10.26' 24" Oak N57°W 43.20'

S.E. CORNER, SEC. 7

T2N, RIE Found wood stake in 4" dia. clay tile; raised with 1/2" iron pipe in monument box

Power pole N89°W 26.50' Wood anchor post N47°E <6.44' & N. end 12" C.M.P. drive culvert N35°W 38.05'

I CERTIFY THAT THIS MAP CORRECTLY REPRESENTS A SURVEY MADE UNDER MY SUPERVISION OF THE LAND DESCRISED ABOVE IN COMPLIANCE WITH THE REQUIREMENTS OF PUBLIC ACT 132 OF 1850. THE RELATIVE ERROR OF CLOSURE BEING NO GREATER THAN 1 PART IN 5000; AND THAT THE EN-CROACHMENTS AFFECTING SAID LAND, IF ANY, ARE LOCATED AS SHOWN HEREDN.

G. A. STEADWAN & SON, INC.

LAND SURVEYING & EPRINEERING 3236 W. ST. JOSE™M ST. LANSING, MICHIGAN 48917

Lichard W. Steadure

RICHARD W STEADMAN LAND SURVEYOR SE LAND

DATE ___ 6-14-76

ORDER NO. 76-298

R.W.S. **T315**

REDISTERED LAND PURVEYOR # 11370

FOR: Jacob Strobe!

Sheet 3 of 4

LEGAL DESCRIPTION:

Parcel A, according to Survey No. 1315 as recorded in Liber 2 on Pages 842,843,844,845 of the Certified Survey Maps in the Register of Deeds Office, Ingham County, Michigan, and further described as:

County, Michigan, and further described as:

beginning at the N.E. corner of Section 7, T2N, RIE, Ingham Township,
Ingham County, Michigan; thence SOI°03!30"E along the East section line 250
ft.; thence N89°38'10"W 440 ft.; thence NOI°03!30"W 250 ft. to the North
section line; thence S89°38'10"E 440 ft. to the point of beginning;
containing 2.525 acres more or less.

PARCEL B. according to Survey No. 1315 as recorded in Liber 2 on Pages 842, 843, 844, 845 of the Certified Survey Maps in the Register of Deeds Office, Ingham County, Michigan, and further described as:

beginning on the East section line SOI° 03'30"E 250 ft, from the N.E. corner of Section 7, T2N, RIE, Ingham Township, Ingham County, Michigan; thence N89° 38' 10"W parallel with the North section line 440 ft; thence SOI° 03' 30"E 252 ft; thence S89° 38' 10"E 440 ft, to the East section line; thence NOI° 03' 30"W 252 ft, to the point of beginning; containing 2,545 acres more or less.

PARCEL C, according to Survey No. 1315 as recorded in Liber 2 on Pages 842, 843, 844, 845 of the Certified Survey Maps in the Register of Deeds Office, Ingham County, Michigan, and further described as:

beginning on the East section line SOI° 03/30"E 502 ft. from the N.E. corner of Section 7, T2N, RIE, Ingham Township, Ingham County, Michigan; thence N89° 38' 10" W parallel with the North section line 440 ft.; thence SOI° 03' 30" E 261 ft.; thence S89° 38' 10" E 440 ft. to the East section line; thence NOI° 03' 30" W 261 ft. to the point of beginning; containing 2.635 acres more or less.

PARCEL D, according to Survey No. 1315 as recorded in Liber 2 on Pages 842, 843, 844, 845 of the Certified Survey Maps in the Register of Deeds Office, Ingham County, Michigan, and further described as:

beginning on the East section line SOI°O3'30"E 763 ft. from the N.E. corner of Section 7, T2N, RIE, Ingham Township, Ingham County, Michigan; thence N89°38'IO"W parallel with the North section line 440 ft.; thence SOI°O3'30"E 359.29 ft. to the centerline of Columbia Road; thence East along said centerline 439.94 ft. to the East section line; thence NOI°O3'30"W 356.49 ft. to the point of beginning; containing 3.694 acres more or less.

PARCEL E, according to Survey No.1315 as recorded in Liber 2 on Pages 842, 843, 844, 845 of the Certified Survey Maps in the Register of Deeds Office, Ingham County, Michigan, and further described as:

beginning on the North section line N89°38'10" 440 ft. from the N.E. corner of Section 7, T2N, RIE, Ingham Township, Ingham County, Michigan; thence SOI°03'30" E parallel with the East section line 1122.29 ft. to the centerline of Columbia Road; thence West along said centerline 460 ft.; thence NOI°03'30" W 1125.21 ft. to the North section line; thence S89°38'10" E 460.06 ft. to the point of beginning; containing 11.865 acres more or less.

I CERTIFY THAT THIS MAP CORRECTLY REPRESENTS A SURVEY MADE UNDER MY SUPERVISION OF THE LAND DESCRIBED ABOVE IN COMPLIANCE WITH THE REQUIREMENTS OF PUBLIC ACT 132 OF 1970, THE RELATIVE ERROR OF CLOSURE BEING NO GREATER THAN 1 PART IN 5000; AND THAT THE ENCROACHMENTS AFFECTING SAID LAND, IF ANY, ARE LOCATED AS SHOWN HEREON.

DATE July 24, 1976

ORDER NO. 76-298

MES R.W.S.

G. A. STEADHAN & SON, INC.

LAND SURVEYING & ENGINEERING 3236 W. ST. JOSEPH ST. LANSING, MICHIGAN 48917

EY: Dich I W. Stee Sura.
REGISTERED LAND SURVEYOR # 11370



FOR: Jacob Strobe!

Sheet 4 of 4

LEGAL DESCRIPTION:

PARCEL F, according to Survey No. 1315 as recorded in Liber 2 on Pages 842, 843, 844, 845 of the Certifie Survey Maps in the Register of Deeds Office, Ingham of the Certified County, Michigan, and further described as:

beginning on the North section line N89°38'10"# 900.06 ft. From the N.E. corner of Section 7, T2N, RIE, Ingham Township, Ingham County, Michigan; thence SOI°03'30"E parallel with the East section line 1125.21 ft. to the centerline of Columbia Road; thence West along said centerline 460 ft.; thence NOI°03130"W II28.13 ft. to the North section line; thence S89°38'10"E 460.06 ft. to the point of beginning; containing 11.896 acres

PARCEL G, according to Survey No. 1315 as recorded in Liber? on Pages 842, 843, 844, 845 of the Certified Survey Maps in the Register of Deeds Office. Ingham County, Michigan, and further described as:

beginning on the North section line N89°38'10"W 1360.12 ft. from the N.E. corner of Section 7, T2N, RIE, Ingham Township, Ingham County, Michigan; thence SO1°03'30"E parallel with the East section line 1128.13 ft. to the centerline of Columbia Road; thence West along said centerline 489,43 ft. to its intersection with the West section line, said intersection being the N.E. corner of Section 12, T2N, RIW; thence NOO 10120mE along the West section line 1130.89 ft. to the N.W. corner of said Section 7; thence \$89°38'10"£ 465.22 ft. to the point of beginning; containing 12.375 acres more or less.

PARCEL H, according to Survey No. 1315 as recorded in Liber 2 on Pages 842, of the Certified Survey Maps in the Register of Deeds Office, 843, 844, 845 Ingham County, Michigan, and further described as:

beginning at the intersection of the West line of Section 7, T2N, RIE, Ingham Township, Ingham County, Michigan, and the centerline of Columbia Road, said intersection being the N.E. corner of Section 12, T2N, RIW; thence SOO 06:10"W 1936.30 ft. along the West line of said Section 7; thence N89° 39' 50"E 1888.43 ft. along the South line of the North 18 acres of the South fractional % of said Section 7 to the East section line; thence NOI° 03' 30" & along the East section line 1925.54 ft. to the centerline of Columbia Road; thence West 1849.37 ft. to the point of beginning; containing 82.838 acres more or less.

I CERTIFY THAT THIS MAP CORRECTLY REPRESENTS A SURVEY MADE UNDER MY SUPERVISION OF THE LAND DESCRIBED ABOVE IN COMPLIANCE WITH THE REQUIREMENTS OF PUBLIC ACT 132 OF 1970. THE RELATIVE ERROR OF CLOSURE BEING NO GREATER THAN 1 PART IN 5000; AND THAT THE EN-CROACHMENTS AFFECTING SAID LAND, IF ANY, ARE LOCATED AS SHOWN HEREON.

DATE July 24, 1976

ORDER NO. 76-298

G. A. STEADMAN & SON, INC.

LAND SURVEYING & ENGINEERING 3236 W. ST. JOSEPH ST. LANSING, MICHIGAN 48917

IW. Steady

REGISTERED LAND SURVEYOR # 11370



2 11147 CERTIFIED SURVEY MAP RECORDED FOR: Robert Green, Ron Ginther, Jacob Strobel Ja 15 2 20 PM TT Sheet 1 of 2 REGISTER OF DEEDS DESCRIPTION: See Sheet 2 Bed Johnson N E. GORNER, SEC. 12, Inokan County, Mich. N. E. CORNER, SEC. 7, T2N, RIW Found iron cutter bar; T2N, RIE Found boot spike; Replaced with 1/2" iron pipe in monument box Replaced with 1/2 iron pipe in Power pole N69°E 53.73' monument box Wood anchor post North 28.07" Power pole West 4731 3" Hickory \$23°W 42.58 Telephone pole N46°E 43 96 Sign post \$38°E 46 13' G COLUMBIA ROAD (assumed to bear East-West) 668.37 ⁽-638' 4543' 850 1936.30 PARCEL H-2 PARCEL H-3 30 12.447 ACRES : ခ္ကြန္က NOI 9 03 8 10.594 ACRES ± 638 543 48 90, 28 8 N70°E 40.9 PARCEL H- I 29.567 ACRES ± Š 375 489° 39' 50" E 1874 25 \$ 89° 39' 50" W 1874, 25 S 2 PARCEL 88 5 N89º44' 10"E E-W 1/4 Line WEST 1/4 CORNER SEC. 7, T2N, RIE 8 8 30. 230 ACRES ± S Set 1/2" from pipe 12" Ash N50°E 50,86 NO1 003 26"Oak N80°E 60-80" 28" Oak East 12.54" 5. Line N. 18 Acres of S. frl. 1/2 - Sec. 7 N 89 39 50 E. 18 iron pipe on Sec. Line falls 3.2° West of anchor post S.E. CORNER, SEC. 7, T2N, RIE Found wood stake E 1/4 CORNER, SEC. 12 in 4" dia clay tile; raised with V2" iron pipe in monument box T2N, RIW Found "T" iron at onc. post Power pole N89°W 26.50' 12" Bosswood N 30°W 12.68" Wood anchor post N47°E 46.44'
€ N. and 12" C.M.P. drive culvert
N35°W 38.05' 15" Basswood \$40° W (C.26" 24"Oak N57°W 43.20" I Certify that this map correctly represents a survey made under my supervision of the Croachmente affecting said () hd, if any, are located as emosin mereon. o indicates 1/2" iron pipe ser. Improvements not located. richard W. g. a. steadman & son, inc. DATE JUILE 14, 1977 STEAMER LAND SURVEYING & ENGINEERING LANO ORDER NO __ 77-432 , 77-520 3235 W. ST. JOSEPH ST. MARAEAD LANSING, MICHIGAN 45517 Iw.

CERTIFIED SURVEY MAP

FOR: Robert Green, Ron Ginther, Jacob Strobel

Sheet 2 of 2

DESCRIPTION:

PARCEL H-! (Green):

Beginning at the intersection of the West line of Section 7.

T2N, R1E, Ingham Township, Ingham County, Michigan, and the centerline of Columbia Road, said intersection being the N.E. corner of Section 12, T2N, R1W; thence S00°06'10"W 1236.33 ft. along the West line of Section 7; thence N89°39'50"E 1874.25 ft. to the East section line; thence N01°03'30"W along the East section line 375.54 ft.; thence West 1181 ft.; thence N01 03'30"W 850 ft. ft. to the centerline of Columbia Road; thence West 668.37 ft. to the point of beginning; containing 29.567 acres more or less, according to the survey recorded in the Certified Survey Maps of Ingham County on file in the Register of Deeds Office.

PARCEL H-2 (Green):

Beginning on the centerline of Columbia Road 668.37 ft. East of the intersection of said centerline and the West line of Section 7, T2N, R1E, Ingham Township, Ingham County, Michigan, said intersection being the N.E. corner of Section 12, T2N, R1W; thence S01°03'30"E 850 ft. parallel with the East line of Section 7; thence East 638 ft.; thence N01'03'30"W 850 ft. to the centerline of Columbia Road; thence West 638 ft. to the point of beginning; containing 12.447 acres more or less, according to the survey recorded in the Certified Survey Maps of Ingham County on file in the Register of Deeds Office.

PARCEL H-3 (Strobel):

Beginning on the centerline of Columbia Road 1306.37 ft. East of the intersection of said centerline and the West line of Section 7, I2N, RIE, Ingham Township, Ingham County, Michigan, said intersection being the N.E. corner of Section 12, I2N, RIW; thence S01°03'30"E 850 ft.; thence East 543 ft. to the East line of Section 7; thence thence West 543 ft. to the point of beginning; containing 10.594 acres more or less, according to the survey recorded in the Certified Survey Maps of Ingham County on file in the Register of Deeds Office.

PARCEL H-4 (Ginther):

Beginning at the East 1/4 corner of Section 7, T2N, R1E, Ingham Township, Ingham County, Michigan; thence NO1°03'30"W along the East section line 277.43 ft.; thence S89°39'50"W 1874.25 ft. to the West section line; thence S00°06'10"W along the West section line 275.04 ft. to the West 1/4 corner; thence S00°06'10"W continuing along the West section line 424.93 ft.; thence N89°39'50"E 1888.43 ft. along the South line of the North 18 acres of the South fractional 1/2 of said Section 7 to the East section line; thence N01°03'30"W 422.57 ft. to the point of beginning; containing 30.230 acres more or less, according to the survey recorded in the Certified Survey Maps of Ingham County on file in the Register of Deeds Office.

icerthy that this sap correctly represents a survey made under my supervision of the land described above in complance with the requirements of public act 122 of 1270. The relative error of closure semig 1 part in \$\frac{356}{000}\$, and that the encorrecting said limb, if any are located as shown hereor.

OATE June 14, 1977

ORDER NO . 77-432 : 77-520

G. A. STEADMAN & SON, INC.

LAND SURVEYING & ENGINEERING

3238 W. ST. JOSEPH ST.

LANSING, MICHIGAN 49917

1478

MEGISTERED LAND SURVEYOR STISTE

