

17

Reeser / Sec 5 & 6 Locke Twp

C-13

Unrecorded Survey N.V.R. Feb 1994

Revered

East 33.00 Revered

S 50° E 4" Iron Post 24.32'

West 25.93.54 RSC #246.22 @ 5 1/4 Cor Sec 31

N 01° 23' 24" 26.44.85' 1" Pin @ E 1/4 Cor Sec 31

C-13

S 50° E 4" Iron Post 24.55

Bolt Head in Wood Gate Post 92° 24.45

N 1/2 T 28409 S. Side 3" Hick 17.68

C-13

5/8" BSC 28409

4" Iron Pipe Fence Post 550° E 24.55'

N 1/2 T 18998 N. Side GATE Post 24.45

N 1/2 T 28409 S. Side 3" Hick 235° 17.68

N 1/2 T 18989 W. Root 29° Hick 526° E 298.65

N 1/2 T 18989 E. Side 20" Hick 544° E 171.80

N 1/2 T 18998 E. Side 24" Hick N 11 W 145.37

DLC

MAB

33-21

17

20 Apr 95

22 Apr 95

EXCAVATED 6' Dia Hole 11.6' W. of

IL Remon BSC purported to be @

C-1 - Found Nothing

EXCAVATED Large Hole around

MVR Iron 5' Fd. What appears to

be an old Anchor Post hole to

NE of Bar. Many Stones around

hole.

C-1

5/8" Smooth Bar 1/2 CAP #28409

5/8" Rebar 1/2 CAP 28409 @ C-13 Perry West 99.00

N 1/2 T 18998 N. Side GATE Post ~~44.55~~ 74.55

N 1/2 T 18998 E. Side 24" Hick N 41° E 190.63

N 1/2 T 18989 E. Side 20" Hick 59° E 126.53

N 1/2 T 18989 W. Root 29" Hick 570° E 270.71

18

Reese / Locke

B-1

LAB Unrecorded Survey 3/10/92

Fid 1/2" B&C #18998 8' North of E.M. Hwy Rd.

N 1/4 18998 S. S. 1/4 12" Ash N70W 41.80'

N 1/4 18998 S. S. 1/4 12" Tw. Ash N60W 12.60'

N 1/4 18998 N. S. 1/4 12" Ash N80E 24.95'

B-13 Perry

LAB

Found 1/2" B&C 18998 8' N. of E.M. Hwy

N 1/4 18998 E. S. 1/4 12" OAK N50W 39.67'

N 1/4 18998 S. S. 1/4 10" Tr. Ash N70E 39.70'

1/2" Box East 99.00

B-13

LCRC 52 pg 382 Nov 1984

MNR Unrec. Survey Feb 1994

Revised & CAP next to Stone

N10E 39.00 N 1/2 W 6" Ash

N45E 23.86 N 1/2 W 6" Ash

N75E 40.67 N 1/2 W 10" Ash

S02E 15.62 ICIP

DUC

PIN

33-21

22 Apr 95

18

EXCAVATED 6' DIA Hole 11.6' W. of
STANDARD Remon Iron Cap purported
to be @ B.T. DETERMINED THIS
LOCATION

18

Reese / Locke

B-A-2 W 1/4 Cor Sec 6

LAB Unres. Surv. 11/2/84

1/2" B&C 25832 3'E. of Fen. N. 15' N. of dwlgs

N 1/2 T 18998 NE Side 36" Oak N 50W 30.10

N 1/2 T W. Side 32" Maple S 35 E 42.76

N 1/2 T W. Side 32" Maple S 20 E 67.05

Fd. 1/2" B&C 25832

Replaced w/ 3/4" Pipe & Cap 25837

21 Apr. 95

C-2 UCC 18 p 368 Forty Remor -

3/4" X 24" PA 345 Bar & Cap

N 1/2 T W. Side 30" Oak S 05 W 21.70

N 1/2 T S. Side 10" Oak East 23.28

N 1/2 T W. Side 10" Ash N 110 E 48.27

N 1/2 T West Side 10" Ash N 100 W 31.63

N 1/2 T N. Side 12" Ash N 130 W 57.07

19

Reese Locks
 A 101-20-22 (Recon. 1/2" Bar
 BS 101-20-21 (Recon. 1/2" Bar
 FS 3321-19-50 (R.P. Set 6" Spk @ Trail Int.
 FS 3321-19-51 (B-2 Pa. 1/2" BSC
 BS D 000-00-00 29" ✓
 1-D 179-50-29 22" ✓
 2-D 359-54-22 28" ✓
 BS R 180-00-00 27" ✓
 1-R 359-50-27 31" ✓
 2-R 179-59-31 24" ✓
 BS D 000-00-00 24" ✓
 1-D 179-50-24 35" ✓
 2-D 359-54-22 29" ✓
 BS R 180-00-00 24" ✓
 1-R 359-50-24 26.5" ✓
 2-R 179-59-24 29.5" ✓
 Mean FS 179-50-27 ✓ FS 359-59-28 ✓
 Dist To BS FS
 FS 2322.454 ✓ 609.754 ✓
 M 707.8853 ✓ 185.8533 ✓
 A 3321-19-50
 BS 101-20-22
 FS 3921-19-52 (Set pad spk @ 18 Car Hnd
 BS D 000-00-00
 103-52-32 ✓ 103-52-32 ✓
 180-00-00 103-52-30 ✓
 283-52-28 103-52-28 ✓
 359-59-49
 103-52-28 103-52-39 ✓
 179-59-59 103-52-32.5 ✓
 283-52-25 103-52-26 ✓
 Dist M 103-52-31 ✓
 Dist BS
 1573.948 ✓ 1360.263 ✓
 479.7403 419.6069
 M


DLC

MAB

33-21

19

21 Apr 95

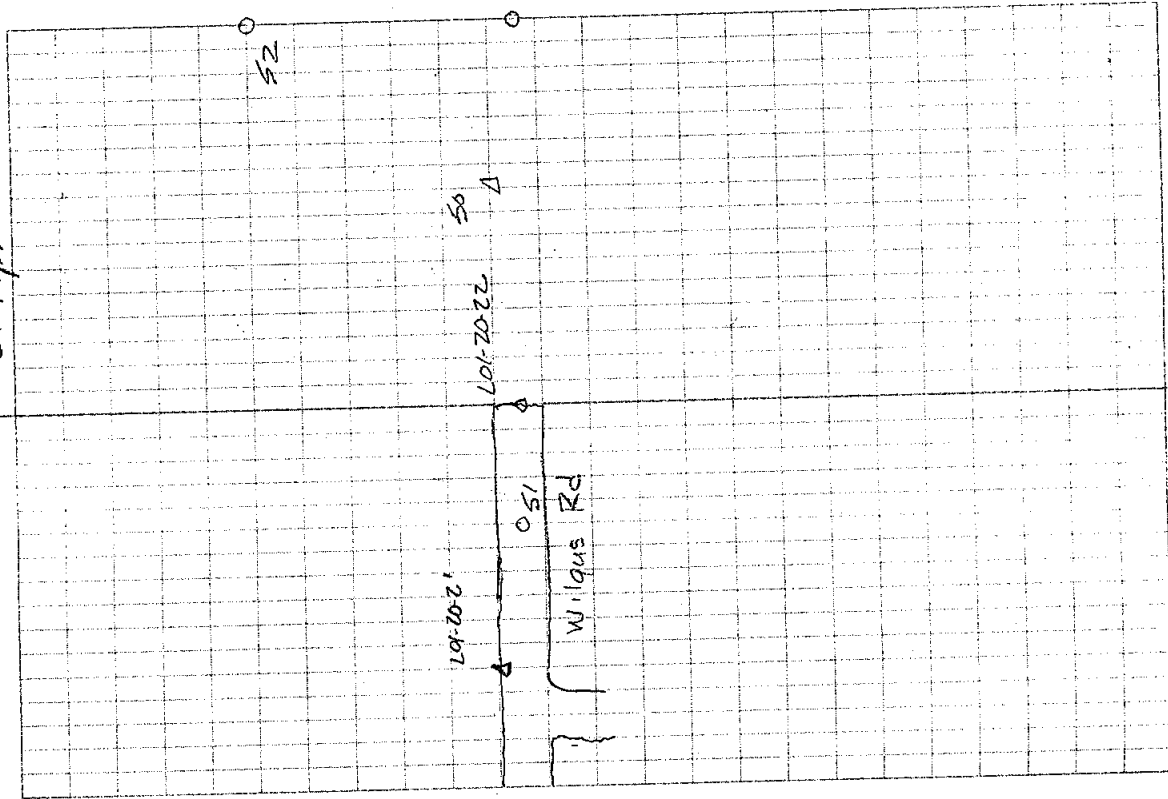

20

Reese Lockt

K

21

BS

22

FS, 3321-20-53

(A-2-3/4" Pipe & Cap.

BSO

000-00-00

10

184-19-40

184-19-40 ✓

BS R

179-59-53

12

004-19-52

184-19-59 ✓

Mean

184-19-49.5 ✓

Dist

chain 11.60

33-21

DLC

MAIS

21 Apr. 95

20

Reesev 1/18/68
 T 101-17-16 (Recvr 1/2" Bar Polaris
 BS 101-17-16 (Recvr 1/2" Bar
 FS₁ 3321-21-54 (as 1/2" Bar used by AVR
 FS₂ 3321-21-55 (1/2" Bar placed by DIC in
 FS₃ 3321-21-56 (1/2" Bar set by Polaris
 FS₄ 3321-21-57 (by single proportional
 at location of Polaris C-1)

BS_D 000-00-100

1D 5-05-06

2D 10-19-31

3D 180-13-30

BS_R 179-59-33

1R 180-05-09

2R 190-19-37

3R 00-13-26

Dist To BS

Fr 606.54

M 184.873

FS₁

1068

FS₂

878

FS₃

98.79

30.112

T 201-18-18 Recv 1/2" Bar @ MVR C-13

BS 201-17-16 Recv 1/2" Bar

FS₁ 3321-21-54 1/2" Bar in file of stampsFS₂ 3321-21-55 1/2" Bar Polaris C-13FS₃ 3321-21-56 3/4" Bar 345 Cap @ C-1?BS_D 00-00-00

1D 14-00-14

2D 185-15-45 185-15-45

3D 180-47-14 180-47-14

BS_R 179-59-29

1R 34-02-14

2R 5-15-43 185-16-14 185-16-00

3R 0-47-38 180-48-09 180-47-42

Dist To BS

Fr 595.99

101.657

FS₁

212

FS₂

10.68

FS₃

108.30

33.313

27

3321

Reesev - Locke Twp

T 401-14-10 (Rebov. 1/2" Bar

BS 401-13-8 (Recov. 1/2" Bar

FS, 3321-27-63 (P.O.L Set 60d spk

Dist To BS FS

FT 4459.263✓

M 1359.1860

FS₂ 3321-27-64 (Set 60d spk @ 1/8 Cor
Anc. PostBS_D 000-00-00

ID 174-26-49 174-26-49 ✓

BS_R 179-59-43

IR 354-26-55 174-27-12 174-27-00.5 ✓

BS_D 000-00-00

ID 174-26-49 174-26-49 ✓

BS_R 179-59-58

IR 354-26-53 174-26-55 174-26-52 ✓

Mean 174-26-56" ✓

Dist to FS FT 196.083 ✓

M 59.766

DL

MAB

27

25 Apr 95

T 3321-27-63

BS 401-14-10

FS, 3321-27-64 (Ed. 3/4" Bar & PA 345 CAP
LS 18987FS₂ 3321-27-65 (Solitary Gauge Stone @ N-SW
Pen. 147562. TwpBS_D 000-00-00

ID 252-03-05 252-03-05

IR 273-39-04 273-39-04

BS_R 180-00-00

IR 172-03-20 252-03-20 252-03-25

IR 93-39-05 273-39-05 273-39-05

Dist To BS

FS 1135.301 ✓

M 346.0404

FS₂ 11.20

T 401-16-13 BS 401-14-10

Search for 401-17-15

x Rt 180-36-16 Pa. is destroyed

Dist 1263.30

Dist To BS

1404.053

427.9562

33-21

33
Reese / Locke

T 18

BS 17

SET 224 S.E. Cor. Par. 1

BS 0-00-00

AR 330-17-14

F 330-17-31

SET 5/8" IRON BAR F.C. AD

SET

~~269-15-08~~ 2396.78

SET 236 NE Cor. PAR 2

AR 357-45-10

F 357-45-12

SET 5/8" x 24" IRON F.C. AD

SET 220 SE. Cor. Par. 2

AR 340-14-26

F 340-14-26

SET 5/8" x 24" IRON F.C. AD

237

AR 354 37-00

354-37-00

SET 5/8" x 24" IRON BAR F.C. AD

SET 226

AR 302-58-29

F 302-58-27

SET 5/8" x 24" IRON BAR F.C. AD

DLG

PSN

29 Apr 95

33

269-23-56

178-39-04

330-44-52

269-15-08

33.00

33.00

269-23-56

89-48-05

179-35-51

79.00

SET 5/8" B.F.C. 17

OBS 18-17-202

BS 00-00-00

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

FSD 180-24-50

DL<

P/N

35

29 Apr 95

No Witnesses Withing 130,000'

33-21

T 63

BS 10 BACK AZ 356-36-18

Set PB, 203 Cen. Sec S.

AZ 274-03-17 11.78

FIN. 274-03-17 11.78

67 9/8" B&C in Old Anch. Post Hole

BSO 00-00-00

P30 277-29-47

T 10

BS 63

SET 206 N 1/16 Cor on N 5/4 line Sec 5

Back AZ 176-36-18 ✓

AZ 353-56-52 194.52

F 353-56-52

SET 9/8" B&C 10' E of ANCHOR POST

NOV- 4-94 FRI 12:12

Bryan Land


FAX NO. 3398047

P. 02

BRYAN LAND SURVEYS, P.C.
6019 Marsh Road
HASLETT, MICHIGAN 48840

WORK INSTRUCTIONS:

JOB Section 8 Locke Twp
SHEET NO _____ OF _____
CALCULATED BY _____ DATE _____
CHECKED BY _____ DATE _____
SCALE _____

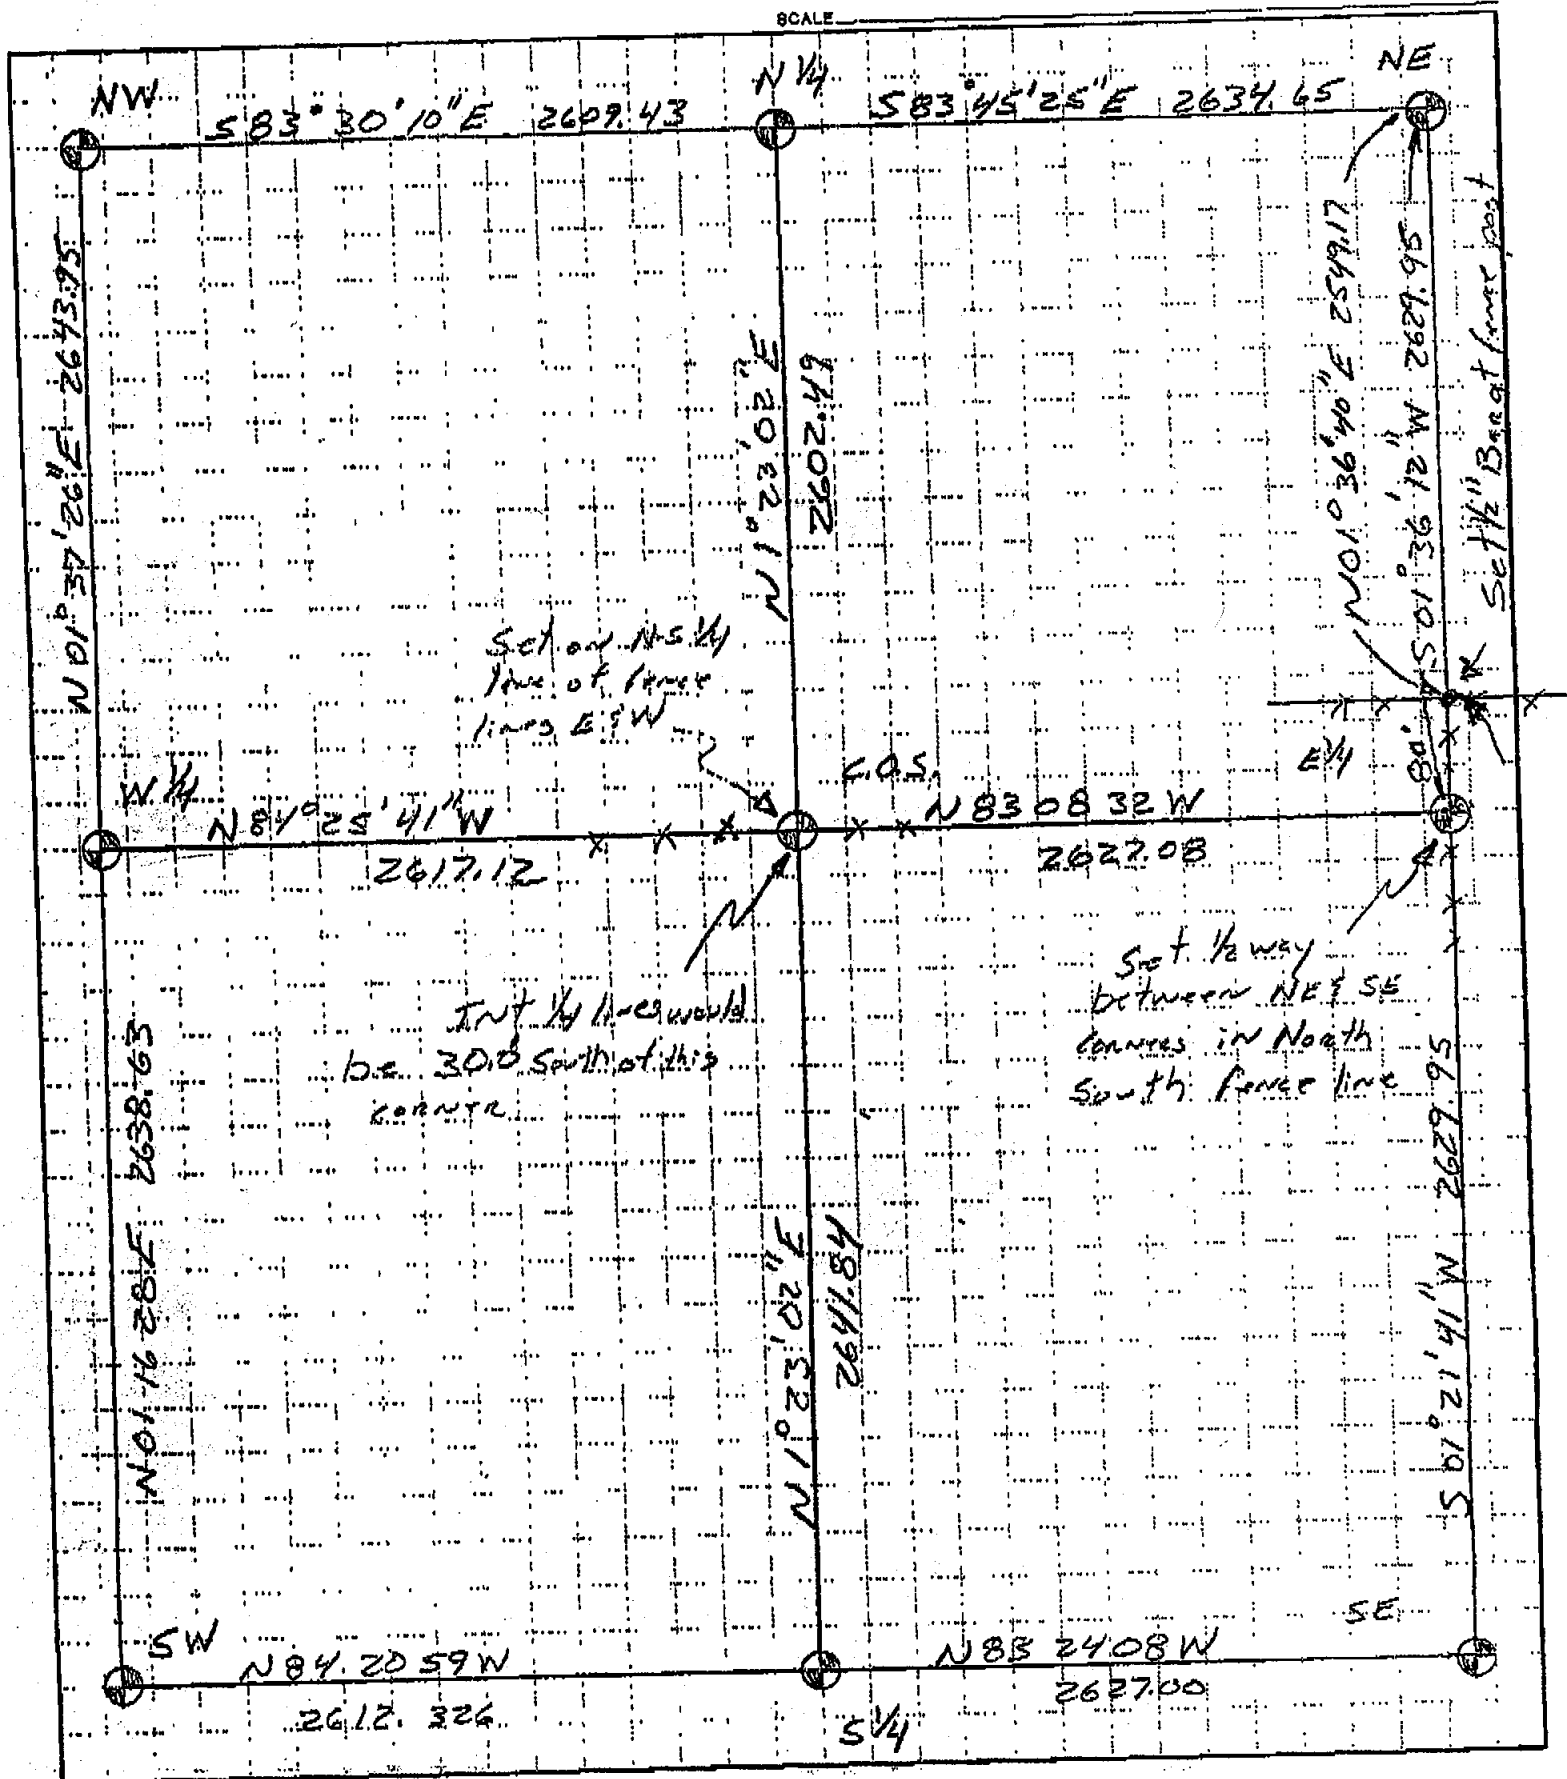

OCT 27 '94 09:41PM POLARIS SURVEYING CO MASON MICH

P.2

POLARIS ASSOCIATES, INC.
3422 Hagadorn Road
MASON, MI 48854

SHEET NO

OF

2

CALCULATED BY

DATE

MAY 81

CHECKED BY

DATE

SCALE

none

TM 20 C EDM

