

DLC	35	700	16 June 04
ASA			
K-13			
B. Field investigation at apparent location of corner revealed a 1/2 Bar in concrete. Marching LASTER with witnesses of 1981. Accepted Found Monumentation as perpetuation of corner based on R. Lester Abbilds of situation and capped it with standard cap.			
1/2" Bar in Conc. Mon. with 2 1/2" Alum. Cap.			
NST 18998 SE Side 18" Hick			N50°E 32.13'
NST 25837 NE Side 18" Hick			S30°E 32.35'
" " N. Side 30" Oak			South 21.73'
" " NW Side 13" Hick			S65°W 53.33'
" " SW Side 15" Hick			N65°W 73.75'
4" Conc. Mon			E 49.53'
4" Laxon Co. Mon.			W 54.72'
Prop. Conc. Cor. 1/2" Bar in Conc. Mon.			
NST 18998 SE Side 18" Hick			N44°W 35.05'
NST 25837 NE Side 18" Hick			S50°W 40.32'
" " N. Side 30" Oak			S42°W 52.51'

①	ESE-2004 CONTRACT	ONZ	
K-12			
B. Field investigation at apparent location of corner revealed a 3/4" Pipe w/ cap #18998 LASTER 2' South and 1' East of Angle Iron Fnc. Post in concrete. MATCHING all of LASTER's witnesses. Accepted Found monumentation as perpetuation of corner and set 3/4" Bar with STANDARD CAP in pipe.			
Measured EAST			26.38.97' to L-12
Measured North			26.31.42' to K-11
Measured South			26.39.00' to K-13
Measurements are from			ESE 66.33.39'
C. 3/4" x 24" STEEL BAR with 2 1/2" CAP STAMPED PA 345 Ingham Co. PS 25837 in 3/4" Pipe			
NST 18998 East side 5" Maple			N29°W 16.00'
NST 25837 South side 4" Oak			N63°W 24.45'
NST 18998 East Root 30" Hick			S30°W 4.35'
NST 25837 SE Side 24" Oak			N40°E 13.11'
NST 18998 West Side 10" Hick			N40°E 5.45'

(3)

L-13

Field investigation @ apparent location of corner revealed a 1/2" Bar in Conc. Mon. Accepted found mon. as perpetuation of corner and capped it with std. cap.

C. 4" Conc. Mon. w/ 2 1/2" Alum. Cap.
 NIT 25837 N.S. de 23" Oak 580°E 159.77'
 " NW Side 7" Hick 546°W 38.86'
 " SE Side 24" Hick 545°W 53.46'
 " SW Side 8" Hick N80°W 137.70'
 " SW. UTIC Pole N36°W 64.18'
 4" Conc. Mon w/ Jack Co. Cap. W45° 39.87'

35, 36

16 June 04 (3)

J-13

Field investigation at apparent location of corner revealed a 1/2" Bar in Conc. Matching LESTER WITNESSES of 1978. Accepted Found monumentation as perpetuation of corner and capped it with Aluminum Ing Van Co. Cap.

C. Conc. Mon. w/ 1/2" Bar & 2 1/2" Alum. Cap.
 NIT 25837 E. Face Wooden Gate Post N09°E 76.73'
 " " N. Face FWC Post 576°W 91.0'
 Conc. Mon. w/ 1/2" Bar (N-175 R2W) West 89.41'
 NIT 18998 N. Face 15" Hick 585°W 260.61'
 NIT 25837 S. Root 30" Oak N85°W 272.37'

7

J-12

B. Field investigation at apparent location of corner revealed a 1 1/4" I.D. Pipe at vague occupation To North-South and West. Matching Lester's 3 Maple witnesses of 1898. Could find no indication of ROW's Gas Pipe from 1895. Accepted Fed Monumentation as corner and capped it with standard cap

ON-2

DLC

JUL

24.55

7:50

17 MAR 04

7

I-12

B. Field investigation at apparent location of corner revealed a 1 1/4" I.D. STEEL Pipe FENCE Post @ 4' away. Fence in this section matching Lester's witnesses of 1974. Accepted found monument from as proposed from of corner and placed standard PARS CAP in it.

C. 11" DIA STEEL PIPE FENCE POST WITH PARS ALUM CAP
 NBT 29837 S.S. Side 12" Oak 180°E 39.13'
 NBT 29837 South Side 4" Oak 180°E 34.5°E 11.41'
 NBT 18998 NE Side 16" Twin Cherry 180°E 11.5°E
 NBT 29837 W. Side 14" Maple 180°W 35.91'


C. 1 1/4" Pipe WITH 2 1/2" Alum. Cap STANDARD
 NBT 18998 SE Side Top 12" Maple 150°E 31.44'
 NBT 18998 South Side Oak 15° Maple 180°E 76.22'
 NBT 18998 South Side 28" Maple 563°E 91.39'
 NBT 29837 Near S. side Maple 18" Maple South 51.16'

11 7400 17 MAR 01

04C 20C 21K

0N-2

11					
K	06				
BS	03				
FS	11-07	(I-13 5/2)	Box in Man Box		
BS	00-00-20				
	180-00-09	179-59-49			
BS	180-00-38				
R	00-00-17	179-59-39	179-59-44		
BS	60-20-30				
	240-20-19	179-59-49			
BS	240-20-54		179-59-40.5		
R	60-20-26	179-59-32	179-59-42		
DIST	BS	FS			
	1318.87	1318.86			
	1316.88	1318.86			

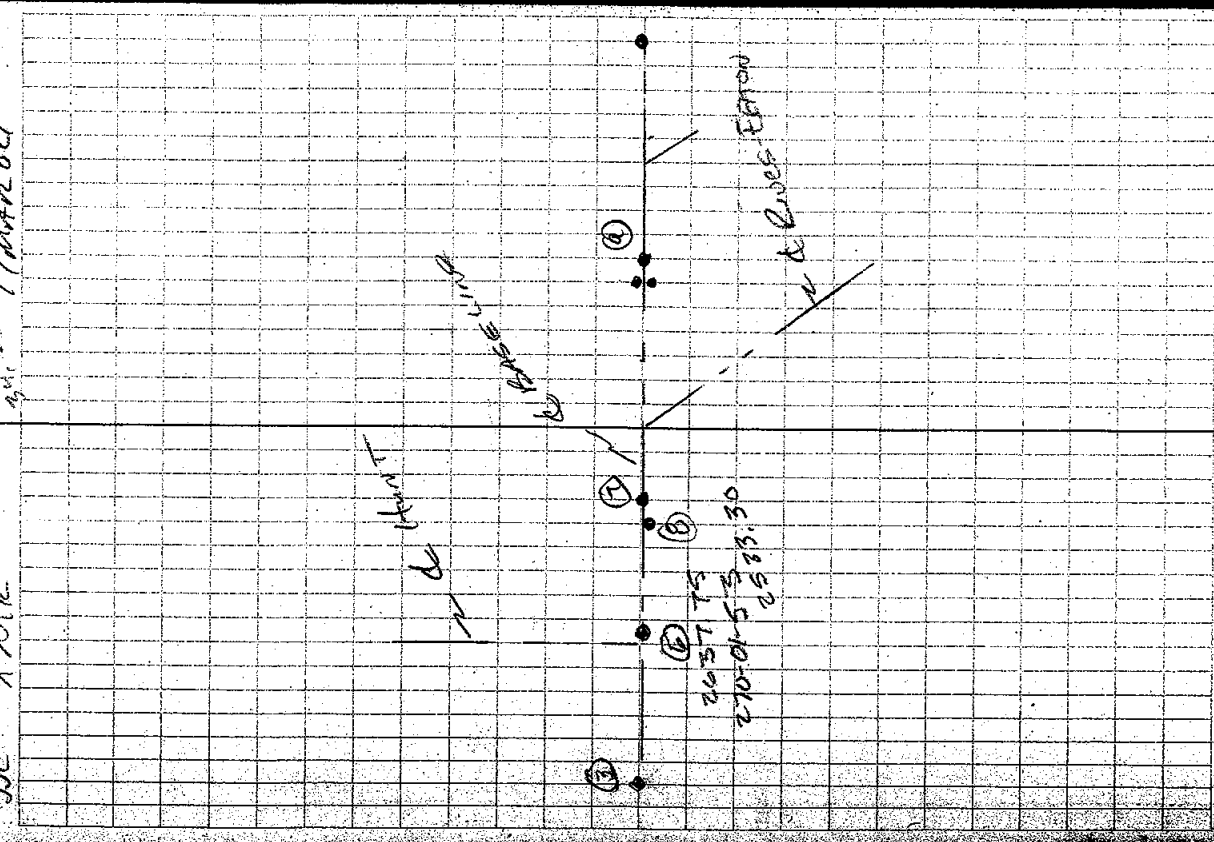


12

T 400 21 85 17 MAR 2005

DEC 2002 T NIK

12			00-2	
R	07			
BS	06			
FS ON 2-12-08		I-1 Tompkins Sp. Box in Mon		
FS ON 2-12-09		J-13 STD. Mon		
BS 2 00-00-20				
0 00-26-53		00-26-33		
0 180-08-43		180-08-23		
RSR 180-00-26				
R 180-27-04		00-26-36	00-26-345	
R 00-08-56		180-08-30	180-08-265	
BS 0 60-20-30				
0 240-29-02		180-08-32		
BS R 240-20-40		180-08-32	180-08-32	
R 60-29-12				
DISTO BS 7		FS 8	FS 9	
1318.88		104.44	2642.37	
1318.87		104.45	2642.38	

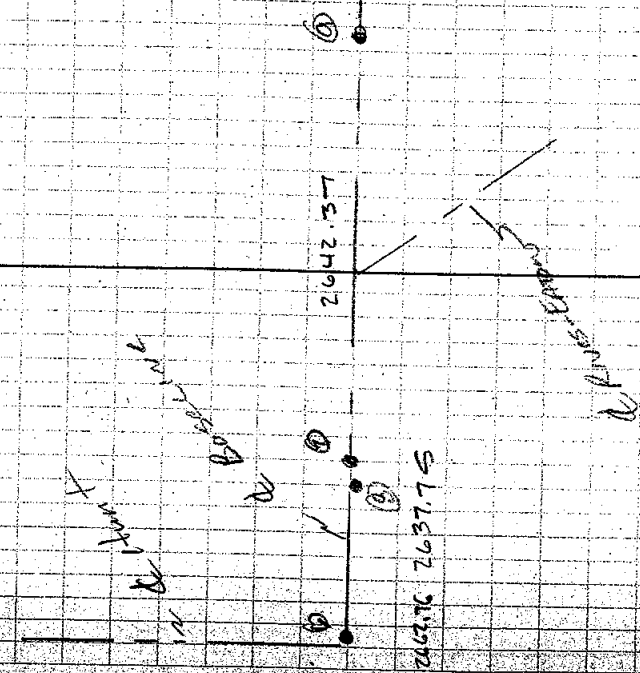

T 40° 34.9 17 MAR 05

DLC JUL TULK

ON-2

13

X

09

BS

07

FS ON 2-13-10 (CONT. MON)

FS ON 2-13-11 (LEFT T-IRON K-13 STAND MON)

FS ON 2-13-12

BS 00-00-20

0 359-33-46 359-33-26

0 00-25-48 00-25-28

0 179-18-36 179-18-16

BS R 180-00-33

R 179-34-00 359-33-27 359-33-26.5

R 180-25-54 00-25-21 00-25-24.5

R 359-18-54 179-18-21 179-18-18.5

BS 0 60-20-30

0 239-38-50 179-18-20

BS R 240-20-48 179-18-16

R 59-39-00 179-18-12 179-18-17

BS 7 BS 10 FS 11 FS 12

2642.36 89.41 89.17 2622.87

2642.37 89.17 89.17 2622.89

270-10-100

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

2642.37

12

11

10

9

8

7

6

5

4

3

2

1

0

-1

-2

-3

-4

-5

-6

-7

-8

-9

-10

-11

-12

-13

-14

-15

-16

-17

-18

-19

-20

-21

-22

-23

-24

-25

-26

-27

-28

-29

-30

-31

-32

-33

-34

-35

-36

-37

-38

-39

-40

-41

-42

-43

-44

-45

-46

-47

-48

-49

-50

-51

-52

-53

-54

-55

-56

-57

-58

-59

-60

-61

-62

-63

-64

-65

-66

-67

-68

-69

-70

-71

-72

-73

-74

-75

-76

-77

-78

-79

-80

-81

-82

-83

-84

-85

-86

-87

-88

-89

-90

-91

-92

-93

-94

-95

-96

-97

-98

-99

-100

26
TWO 24.50
6 Apr 05
T.N.K.

26

I-13

Fd 1/2" Bar in Mon Box 0.07 East and
0.14' South of Surface Iron. Kepted
as LESTER Perpetuation of Corner

NET N. SIDE 36" OAK 59.66 N 70.50 N 20
N 85 N. SIDE 29" OAK 61.54 56.90 E
N 85 189.90 N. SIDE 36" Hickory 58.45 24.44 20.44
N 85 SW. SIDE 7" Hickory 29.46 33.11 11.07

Replaced Fd. Monument from with 3/4"
Bar & PA 345 CAP

26