

42

A-11

Searches at apparent location of
corner and found 3/4" pipe and cap
in Man Bar on E. Waverly Rd & on
L Barnes Rd. To East. Accepted
Pipe & Cap in corner as perpetuated
By Dec Stand in 1973 and Capped
w/ PA 345 LS 28409 Cap.

A-11

DLC

DLC

TOS

22 Aug 95

42

C. 3/4" Pipe w/ PA 345 LS 28409 in Man Bar
N 97° 28' 41" E. Side 28" Hick 342° 102.43
N 57° 28' 41" W. Side 36" Oak 40° 57.90
N 57° 28' 40" W. Side Walnut 158° 88.95
N 57° 28' 41" E. Side 36" Oak 196°
3/4" Pipe 11370 in Man Bar N-11 TUNESW 2° 61.05

DLC	T750	24 Sep 96	43
JLC			
B.	Searched at apparent location of corner and found $3\frac{1}{4}$ " pipe & cap in Mon Box on W. Edge Waverly Rd. Accepted pipe as perpetuation of corner based on Steadman Excavation of 1973. Capped pipe with PA 345 Cap LS 28409 & 20 Penny GALVANIZED Spike.		
C. $1\frac{1}{2}$ "	Pipe & PA 345 Cap LS 28409		
NST	28414 S. Side 14" Poplar	286°	16.10'
NIT	28409 in Top Sowed off P.P.	95°	47.90'
Punch Mark	W. End 12" CMP	240	43.33'
Punch Mark	E. End 12" CMP	140°	56.85'
$3\frac{1}{4}$ " P&C	in Mon Box	0°	22.10'
NIT	28409 E. Side 8" Walnut	193°	124.83'

43				Aug 1
A-12				
A. Nor	Set in original Govt Survey			
z A. Jackson	Co. Surveyor set corner in March 1839 in a survey recorded in Vol 1. pg 40 Co. Surv. Records			
Elm	14" 552 $\frac{1}{2}$ W 196			
Hick	12" 516 $\frac{3}{4}$ W 183			
3. R. Steadman	LS 11370 Excavated Corner in Dec. 1973 and found large amount of Crockerly and brick but no monument. He set $3\frac{1}{4}$ " pipe on Standard Line on Fence line to East amongst brick & Crockerly.			
NST	in P.P. WSW 80.47			
$3\frac{1}{4}$ " Pipe	ESE 56.53			
$3\frac{1}{4}$ " pipe	over Stone (N-12 TEN R3W)			
North	27.11			

45				ALL
C-11				
1. Original Post	Set by Henry Poole D.S.			
FEB 1826				
W.O. 34	N 67° W 5			
W.O. 34	N 77° E 38			
A. Charles				
Cherry 18	S 61 3/4° W 54 1/3° (NEW) (359)			
Beech 20	S 50 2/3° E 140° (NEW) (92.4)			
A. Jackson Co. Surv.	Used corner in			
March 1839	with (New) witnesses			
Above.				
3. T.J. Brown	Co Surv. used cor in			
Jan. 1866	w/ same w.t. as A-2			
4 R. Helzel	fd 1" sq steel bar			
L 4 Pg 83	Act 7th Aug 77			
N 45° E	134.4' SW corner top of slab			
Conc Porch				
N 55° E	39.63' N 3/4 T 24" OAK			
S 30° E	52.47' N 3/4 T 18" Wild Cherry			
N 80° W	86.74' N 3/4 T 36" Maple			

DC	7700	45
226	24 Sep 96	
B. Searched at	apparent location of	
Corner and	Found 1/2" B&C in Mon	
Box 45' N. of	& Barnes Rd and	
on	& Gale Rd. Removed Iron	
and EXCAVATED	Through Mon.	
Box and found	1" Square bar as	
called for	by R. Helzel. This is	
the type of bar	frequently used	
by Road Comm.	in 40's & 50's	
Falled 92.4'	S 55° E to remains	
of Large Beech	stump. Accepted	
1" bar as	perpetuation of corner	
because of	agreement with historical	
witness and	replaced with standard	
bar flap.	above it.	
C. 3/4" x 24" Bar	PA 345 Cap 3528409	
in Mon. Box	on & Gale road	
and 4.5' N. of	& Barnes Rd	
N 3/4 T 28414	S. Side 30" OAK 59° 39.00'	
N 3/4 T 28409	S. Side 19' Maple 82° 102.75'	
N 3/4 T 28409	N. Side 10" Walnut 105° 144.95'	
S.W. Cor	Con. Porch 46° 134.40'	
N 3/4 T 28409	S. Side Tw 5" Maple 284° 118.40'	

DLG T750 46
JUL 24 Sep 96

B Searched of apparent location of corner and found 1/2" Bar in Mon Box 2' N. of E Barnes Rd on occupation line 660' N. Filled in and EXCAVATED through bottom of Mon Box through 2nd B.F. surface and found 1" gas pipe 18" deep beneath 1/2" Bar. Because of complete lack of a better location of corner accepted pipe as perpetuation of corner and set standard Bar and Cap above it

C. 3/4" Bar 9 PA 345 CAP LS 28409
in Mon Box 2' N. of E Barnes Rd.
NAT 28409 SE Side 22" Walnut 61° 70.79
NAT 28409 S Side 18" Walnut 84° 275.79
NAT 28409 N Side 23" Walnut 96° 256.51
NW Cor Conc. Block Fdn Hse # 106° 259.57
NE Cor Conc Block Fdn 221° 234° 247.74

46
B-11
A. Original Post Set by Harvey Parke D.S. in Feb 1826
B.O. 28 541W 43
W.O. 20 N55E 27
2. A. Jackson Co. Surveyor Used Corner in Survey rec. Vol 1. Pg 40 March 1839 with same man & witnesses as 10
3. A. Jackson Vol 2. pg 112 Feb 1838
4. T. J. Brown Jan 1866
5.
6.
7. Hendry LS Found 1" gas pipe 55ft
1/2" Reel above Act 74 12 pg 401 3/73
2 10" R. Oak NW 45.9
2 18" DBB W.O. WNW 64.6
2 18" Ash NW N. 68.1

DUC

PL

TSD

48

10 Oct 96

AUL


C-13

R. J. Robb County Surveyor did a section survey in Sec. 31 T2N R2W about 1909 and recorded it in Vol. 2 page 272. County Surveyor's Records Robb calls on a stone at this corner with witnesses of S.E. Cor. House NW 93; W: Oak 13" S.E. 66'. He then crossed this entry out and entered it for C-11. The conditions at C-11 do not agree with Robb and the witnesses match conditions at this corner.

B. Searched at apparent location of corner and found 1/2" Bar 3' N. of & Plains Rd. & 10' W. of & Gale Rd. Matching Robb's House witness to N.W. Excavated 18" Dia hole 2' deep and found painted sandstone under iron. Accepted stone as corner as perpetuated by R. J. Robb and replaced it 1/2" Bar with standard Indian County Re-monumentation Mon. and set Mon Box


C. 3/4" x 24" Smooth Steel Bar W. & H. Yellow Plastic Cap imprinted PA345 PS 25837 in Mon. Box 3' N. of & Plains and 10' W. of & Gale Rd. S.E. Cor. Fdn. Hse #6008 -
 N 1/2 25837 N. Side Power Pole 1240 164.95
 S.W. Cor Pole Barn 340 182.90
 S.E. Cor. Fdn. Hse #6008 325 93.10
 N 1/2 5.5' side Power 298 77.90
 1/2" Bar in Conc. 220 39.80
 N 1/2 28414 E. Side 28" Oak 205 48.48
 3/4" x 24" Bar & PA345 PS 25837 (C-1 TANK) 95 10.05
 In Mon Box

SO				Aug 1:
Traverse				
T		3		
BS		2		
FS	Aug-50-07	(R.P. Set May 1941 N.E. Rd. Barnes & GALE)		
BSO	000-00-20			
D	180-09-40	180-09-20		
BSR	180-00-07			
R	000-09-54	180-09-47	180-09-34.5	
BSO	60-20-30			
D	240-30-03	180-09-33		
BSR	240-20-16			
R	60-30-06	180-09-50	180-09-41.5	
			37.56	
			180-09-36.5	
Dist To	BS		FS	
FT	264490	✓	2669.85	✓
M1	806.167		813.771	
			J	

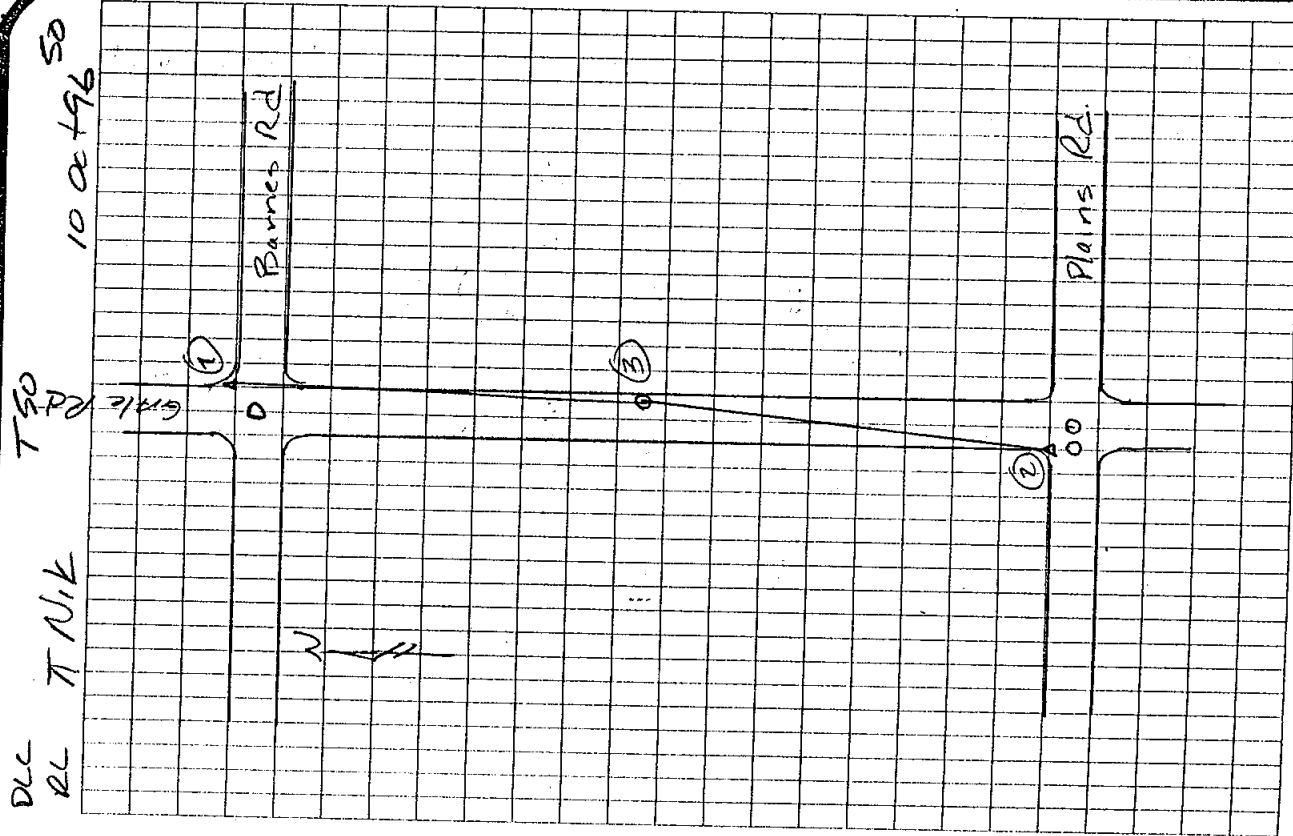


SI	Traverse	07	03	SEE PP	AVI
FS ₁	Aug-51-08	C-11 TAN R2W			
FS ₂	Aug-51-09	P. 51-16-13-07	SEE PP		
BS D	000-00-20	{ 1/8 Line Fence to N.			
10	46-34-26	46-34-06 ✓			
20	88-11-05	88-11-05 ✓			
BS R	180-00-13				
1R	226-34-21	46-34-08 ✓ 46-34-07 ✓			
2R	268-11-21	88-11-08 ✓ 88-11-13 ✓			
BS D	60-20-30				
2D	148-31-20	10-50 ✓			
BS R	240-20-34				
2R	328-30-58	88-10-45 ✓ 88-10-59 ✓			
	31-14				
Dist To BS		FS ₁	FS ₂		
FT	2669.85 ✓	16.54 ch	1339.02 ✓		
M	813.773		408.134		

DUC
 AL
 TSD
 T NIK
 SI
 10 Oct 96

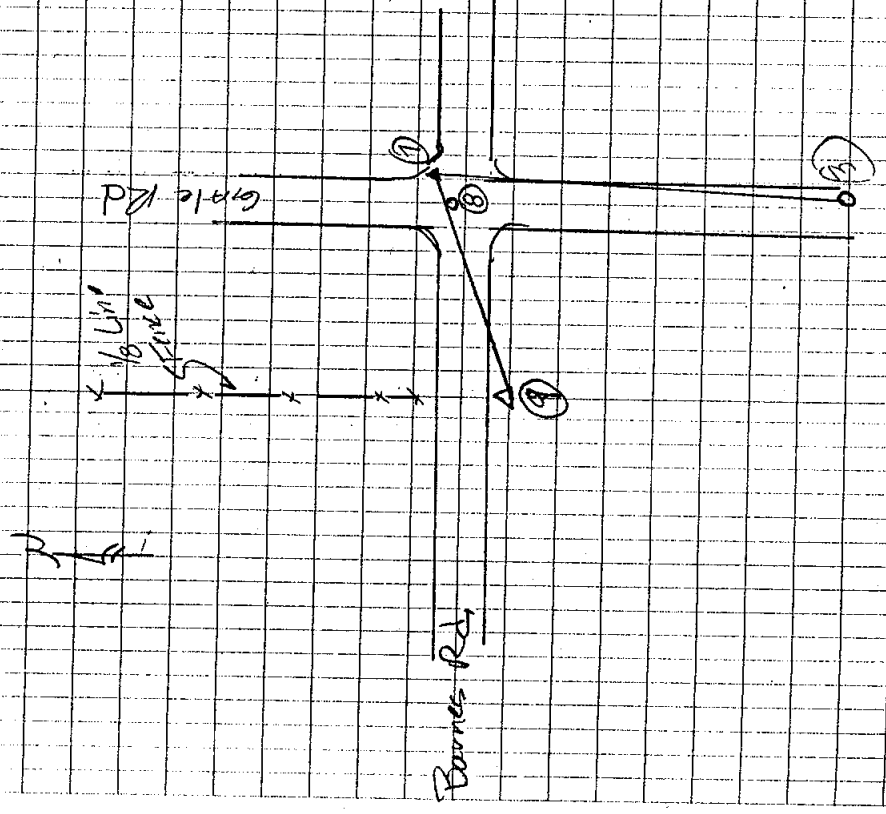


DCC T N.K TSO 10 Oct 96 52

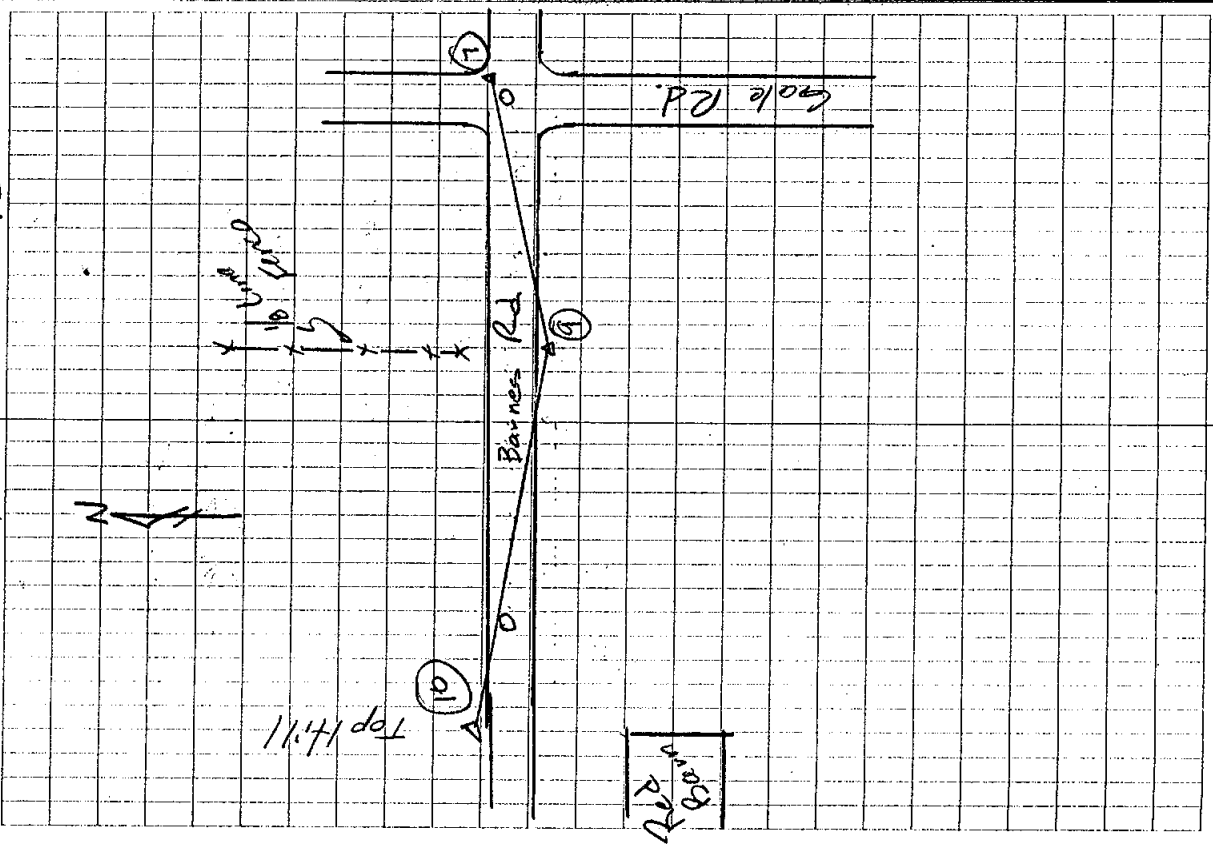


52	Traverse	Aug 1
T	07	
BS	07	
FS	Aug-52-10 (R.P. Set 1/2" 1342 & N. of N. Edge Barnes on E. Wall)	
BS	000-00-200 (Vine Red Barnes to S. on Top of Hill)	
O	182-06-00 182-05-40 ✓	
BS	180-00-13	
R	2-06-08 182-05-55 182-05-45 ✓	
BS	60-20-30	
D	242-26-33 182-06-03 ✓	
BS	240-20-39	
R	62-26-25 182-05-46 182-05-45 ✓	
		15-50-20 ✓
Dist To	BS	FS
ET	1339.02 ✓	1606.71 ✓
M	408.135	489.727

S3	AUI			
Traverse				
T		10		
BS		9		
FS	AUI-53-11	11	Barnes Rd - R2W	
FS	AUI-53-12	12	Sec 19 1/2 " BFC 3' w. of W. Edge Wav. 40' S. of 4 Barnes To East	
BS	000-00-20			
10	1-21-29	1-21-09	✓	
20	178-36-57	178-36-37	✓	
BS	180-00-07			
1R	181-21-19	1-21-12	✓	1-21-40.5
2R	358-37-03	178-36-59	✓	178-36-48
BS	60-20-30	56		46.5
0	230-57-17	178-36-47	✓	
BS	240-20-17	36-58		58.5
58-57-15	170-37-02	170-36-54.5	✓	170-36-54.5
170-36-54				
FS	BS	FS	FS	
Ft	1606.71	✓	280.82	✓
11	489726	85.595	757.168	

DLC
RL T N.L
TSD
10 Oct 96
S3

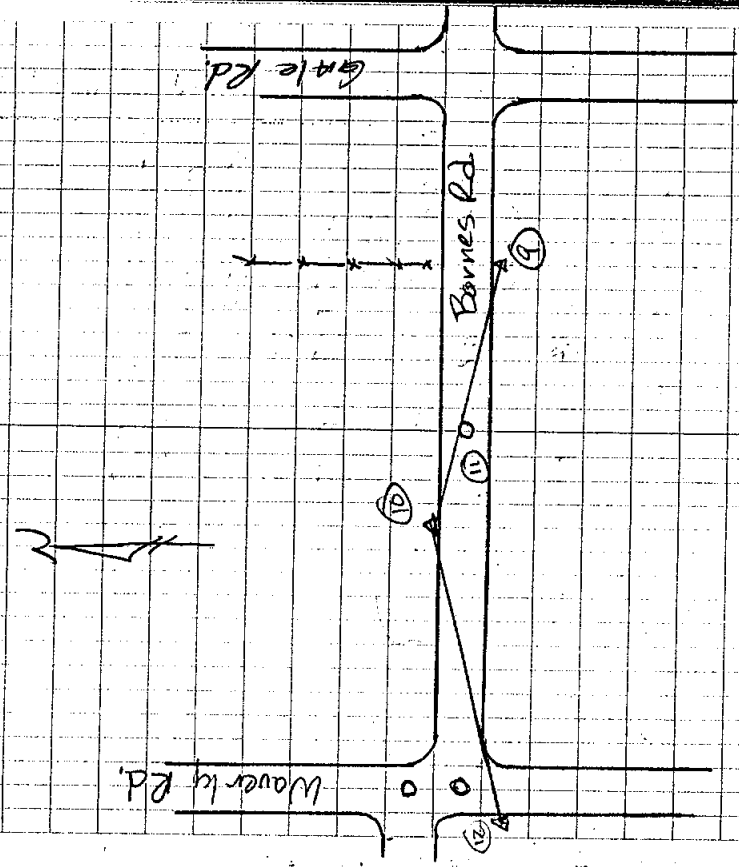

DUC
 RL
 T N/L
 T50°
 15 Oct 96
 54

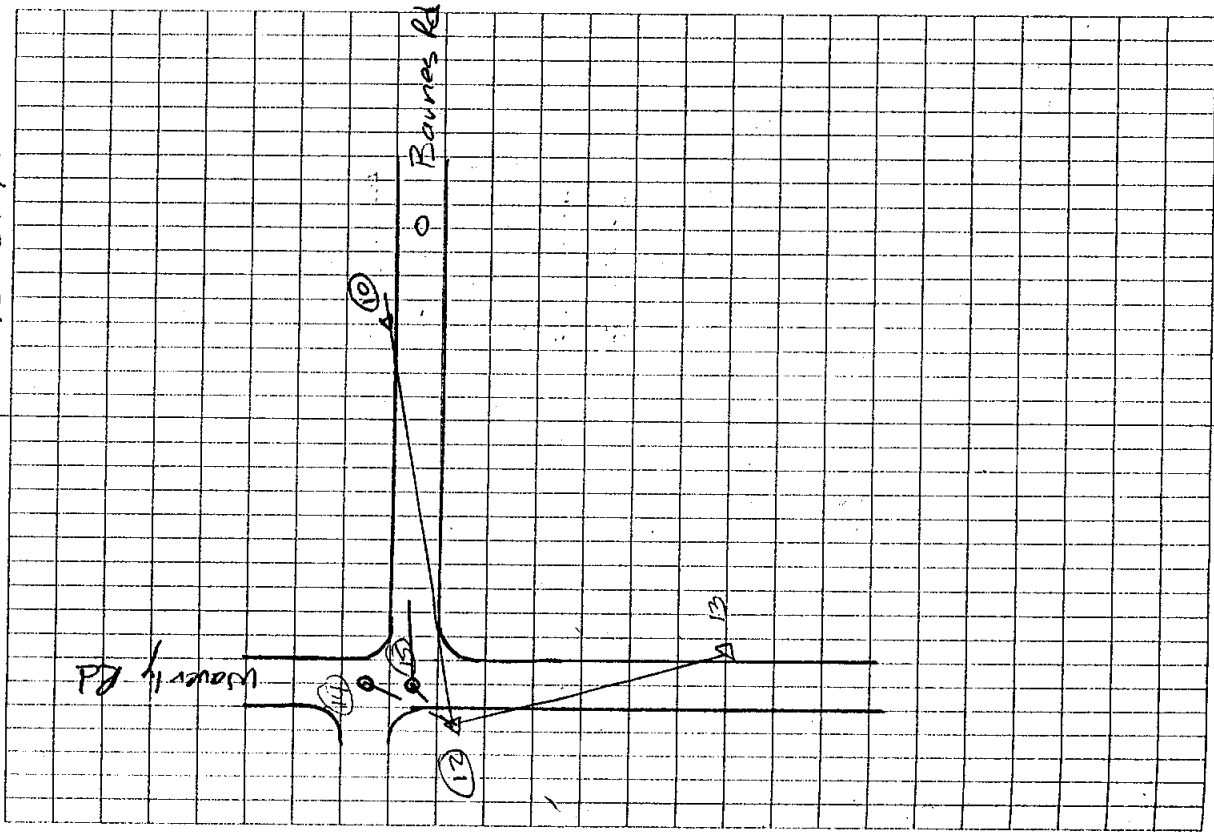


64	Traverse	Sec 31	T 20, R 20 W & Sec 6	T 10 R 20 W	A 11
T	A 11-53-12				
BS	A 11-52-10				
FS	A 11-54-13		(R.P. Set 1/2" B.C. 3' 6" of E. of station on S. wall Link Red Barn To E.)		
FS	A 11-54-14		M-11 T 20 R 30 W Sec 15. 42		
FS	A 11-54-15		(A-11 T 20 R 20 W Sec 15. 42)		
BS	000-00-20				
10	89-15-42		89-15-22 ✓		
20	282-45-33		282-45-13 ✓		
30	318-17-32		318-17-12 ✓		
BS	180-00-24				
10	269-15-25		69-15-01 89-15-11 ✓		
20	102-45-33		282-45-09 ✓ 282-45-11		
30	153-17-43		318-17-19 ✓ 318-17-15		
BS	60-20-30		8		
10	149-35-58		89-15-20 ✓		
BS	240-20-38				
10	229-35-38		89-15-00 89-15-14 ✓ 89-15-13		
Dist To	BS	FS	FS	FS	
FT	2484.13	1316.94	77.12 ch	21.30 ch.	
M.	757.165	401.404			

DLC
JUL

SS

10/21/96

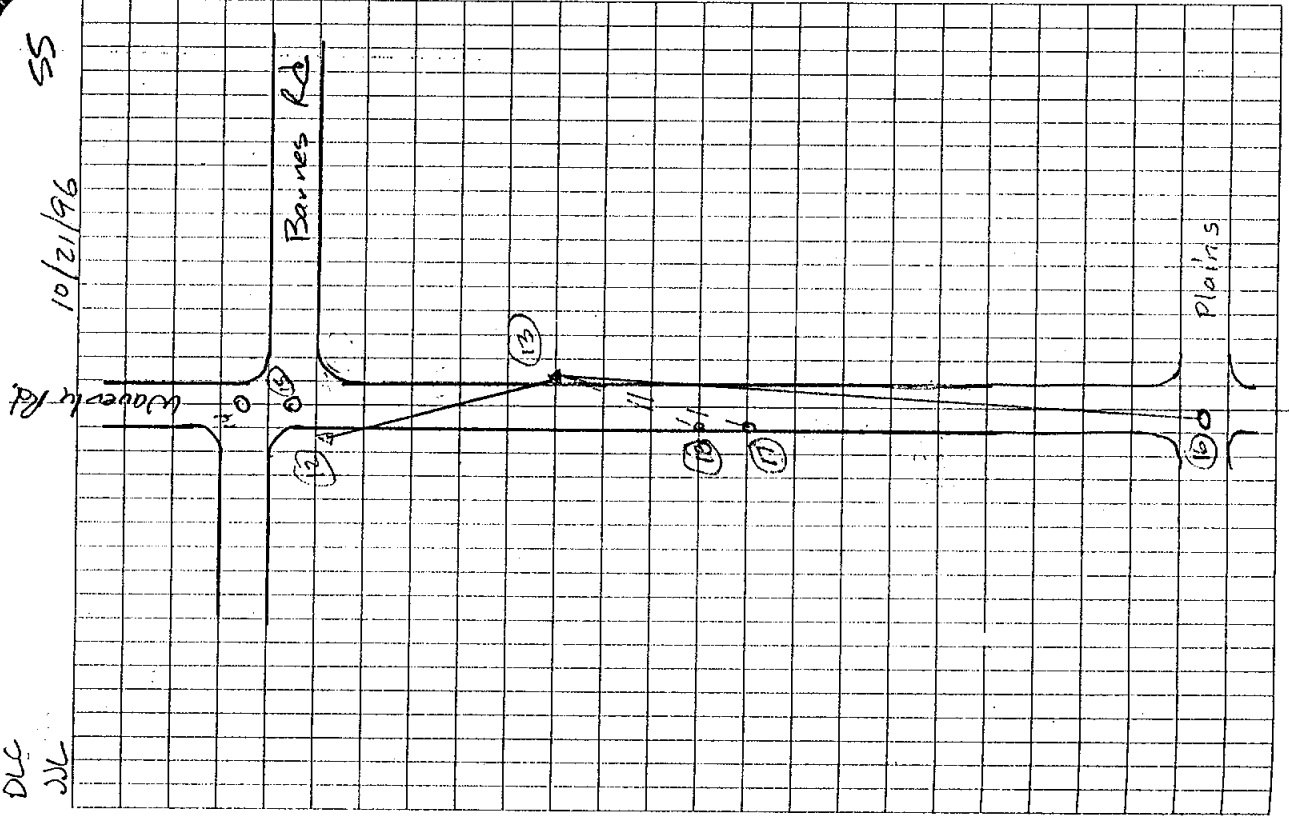


SS	Trav. Sec	31 A	Sec 60	Aul
1			13	
BS			12	
FS	AU1-55-16	(A-13 TAN R2W, A-1 TAN R2W)		
FS2	AU1-55-17	(A-12 TAN R2W)		
FS3	AU1-55-18	(A-12 TAN R3W)		
BSD	000-00-20	(see pg 43)		
10	182-04-28 181-35-13	181-34-53		
20	182-03-38	182-03-18		
30	182-04-28	182-04-08		
BSR	180-00-28			
1R	2 181-35-15	181-34-47	181-34-50	
2R	2-03-27	182-02-59	182-03-08	
3R	2-04-17	182-03-47	182-03-58	
BSD	60-20-30			
10	241-55-34	181-35-01		
BSR	240-20-42			
1R	61-55-17	181-34-35	181-34-49	181-34-50
DIST TO	35	FS	FS	FS
FT	1316.94	3926.71	1296.04	1269.04
M	401.405	1196.864	395.034	386.805

DIC T Nikon
SSA

86


St.	Sec. 31 TAN, RAW	Sec. 6 TAN, RAW	Aug 1
1	16		
2	13		
FS	AU1-49-01	(Recon. 1/2" BSC)	
FS	AU1-56-19	(R.P. Set 1/2" BSC W. Edg. Waverly on N. Wall Line Garage @ 2707 Waverly)	
L	00-00-20		
1	39-56-43	89-56-23	
2	180-00-11	179-59-54	
3	180-00-12		
4	269-56-54	89-56-424	89-56-225
5	0-00-16	180-00-04	179-59-575
6	60-20-30		
7	150-17-05	89-56-34	
8	240-20-25	179-59-55	
9	240-20-23		
10	330-17-19	89-56-56	89-56-45
11	60-20-30	180-00-07	180-00-01
			179-59-59

Dist To: BS FS FS2
 FT. 3926.74 2713.82 2384.16 ✓
 M. 1196.874 827.173 726.692

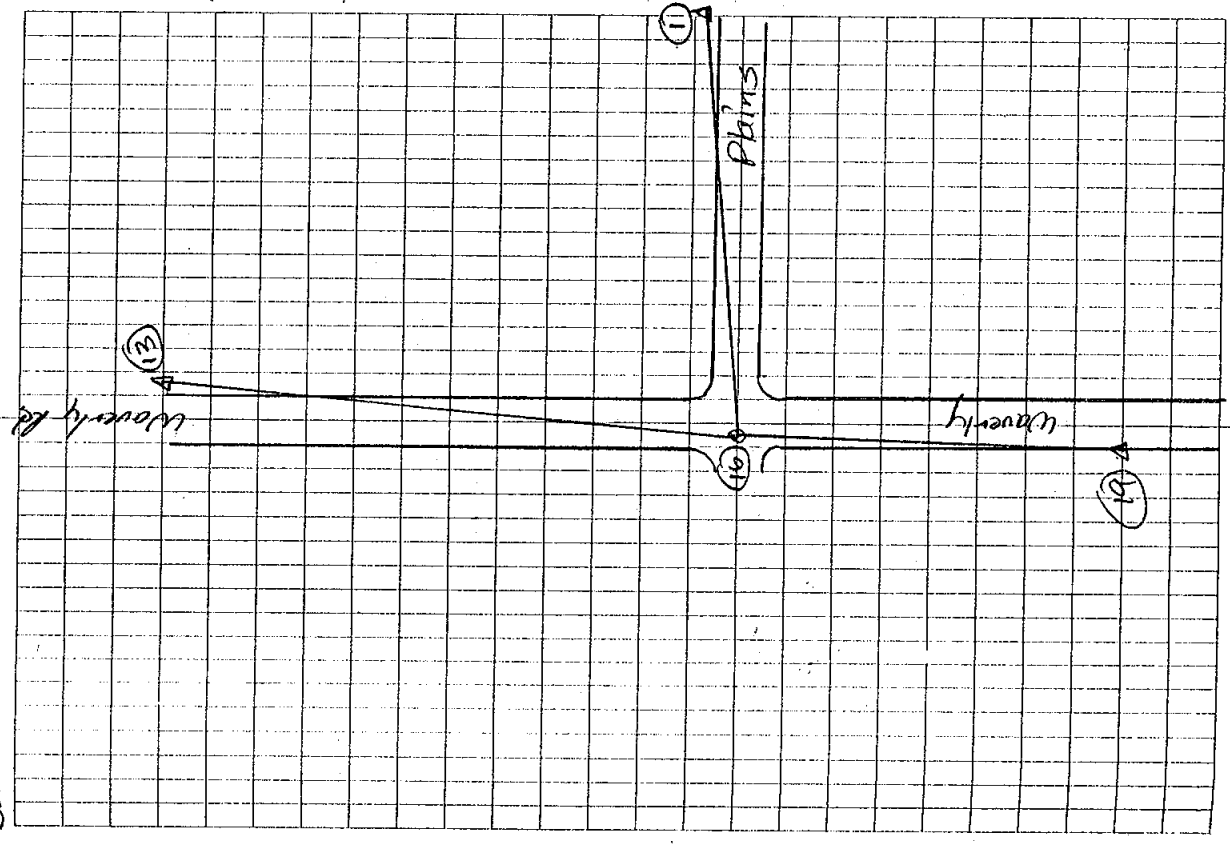

57					Au1
Traverse	Sec. 31 T2N, R2W	Sec. 6 T1N, R2W			
T	19				
BS	16				
FS ₁	Au1 - 57 - 20	(M-2 Hamilton? Fd 1/2" BSC			
FS ₂	Au1 - 57 - 21	(A-2 on on. ? Fd R.R. spk.			
FS ₃	Au1 - 57 - 22	(P.R. on top stone?			
FS ₄	Au1 - 57 - 23	(R.P. Set 1/2" BSC w. 2 dy			
FS ₅	Au1 - 57 - 24	(Wav. on 1/8 line on top)			
BS ₀	00 - 00 - 20				
0	178 - 09 - 24	178-09-04			
0	178 - 11 - 23	178-11-03			
0	178 - 17 - 28	178-17-08			
0	180 - 13 - 30	180-13-10			
BS _R	180 - 00 - 07				
0	358 - 09 - 35	178-09-28	178-09-16	L	
0	358 - 11 - 26	178-11-19	178-11-11	L	
0	358 - 17 - 37	178-17-30	178-17-19	L	
0	00 - 13 - 39	180-13-32	180-13-21		
BS _L	60 - 20 - 30				
0	240 - 33 - 45	180-13-15			
BS _R	240 - 20 - 20				
0	60 - 33 - 54	180-13-34	180-13-24	180-13-23	
Dist To:	BS	FS ₁	FS ₂	FS ₃	FS ₄
Ft.	2384.16	320.61	328.87	331.53	1604.84
M.	726.644	97.722	100.241	101.051	507.459

JUL - T N.E.
 T550
 20 Oct 94

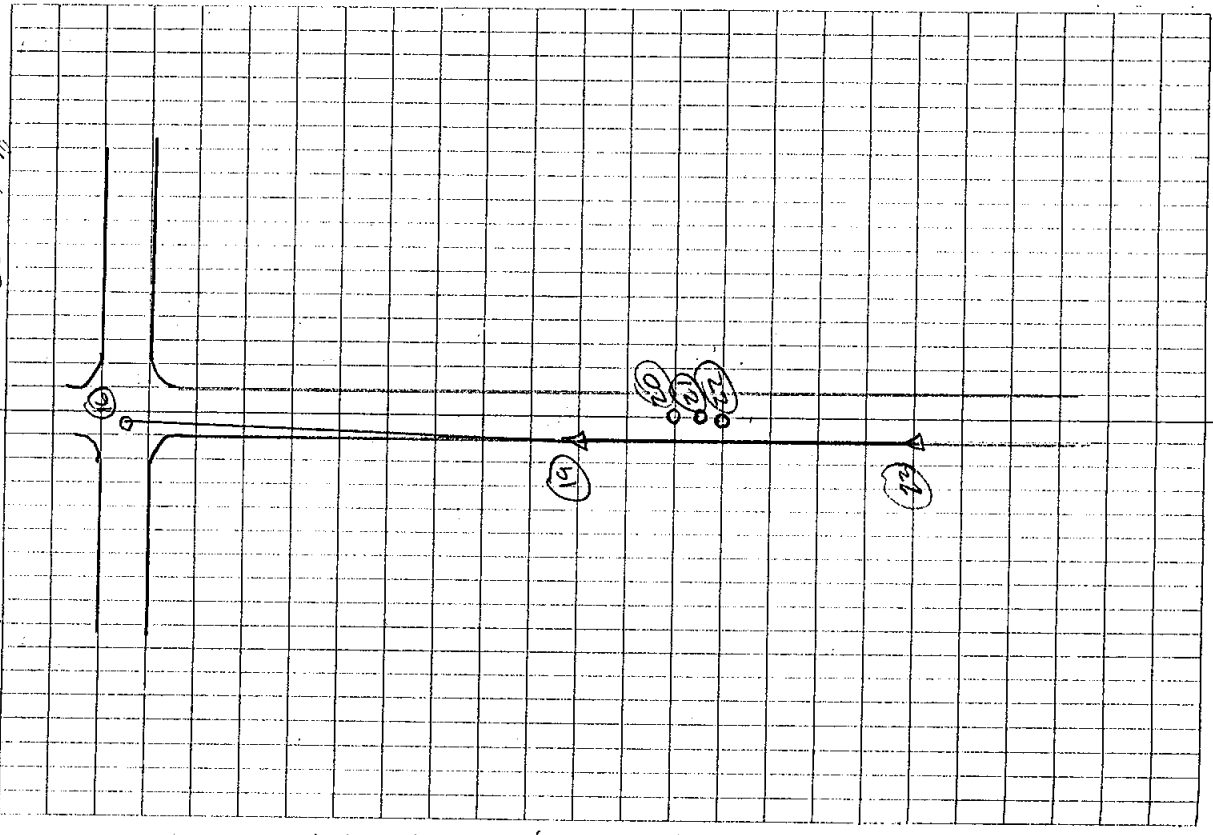


DHC X Nikon
532 T. 55°

58

20 Oct. 96

58	Traverse Sec. 31 T2N, R2W Sec. 6 T1N, R2W	Aw1
N	23	
BS	19	
FS	Aw1 - 58 - 24 (RP, Set 1/2 B/C 3' W. of W. Edge)	
FS	00 - 00 - 20 (W. Rd. on G. D. 2905)	
O	179 - 48 - 31	179-48-11
F	180 - 00 - 11	
B	359 - 48 - 33	179-48-22 179-48-16.5 L
F	60 - 20 - 30	
C	240 - 08 - 43	179-48-13
F	240 - 20 - 19	
C	60 - 08 - 49	179-48-30 179-48-215
		179-48-19 L

Dist to BS FS.
FT 1664.93 ✓ 670.11 ✓
M. 507.472 204.249

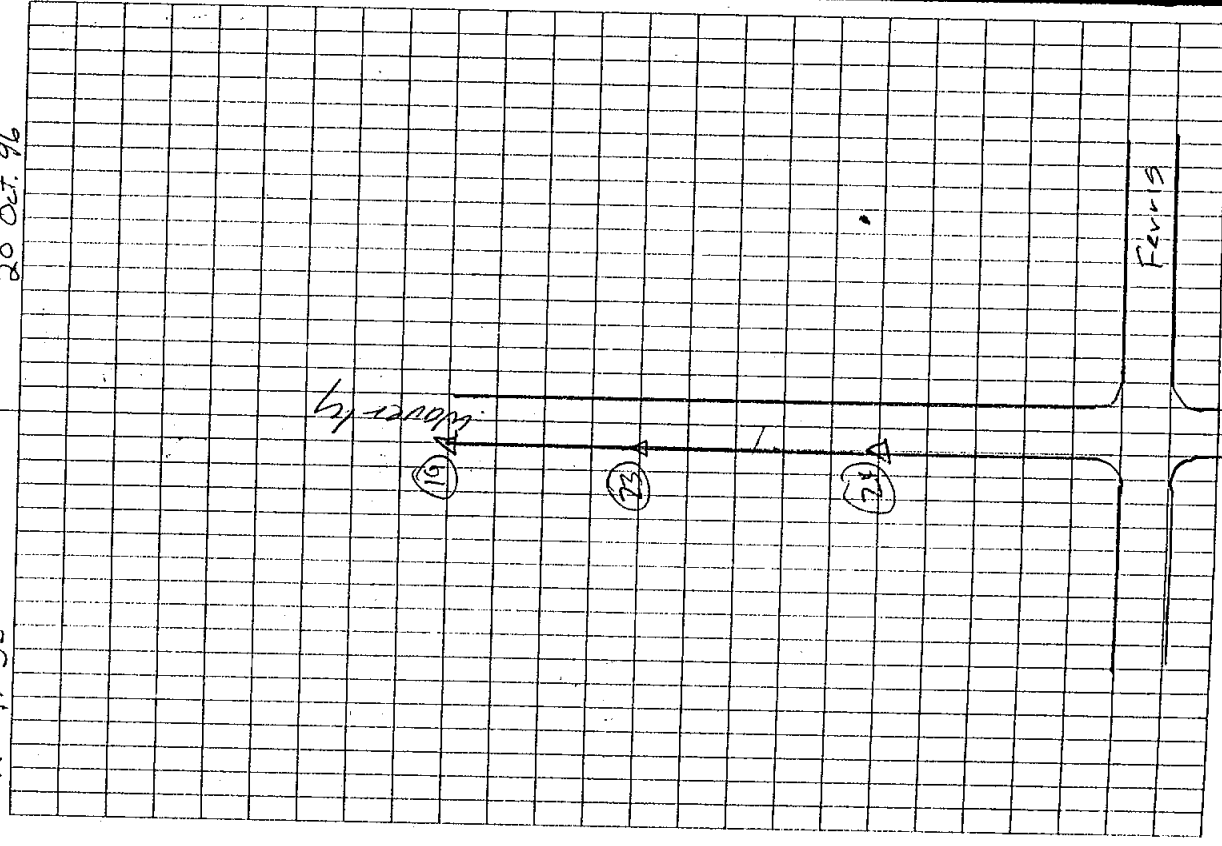


OLC T. 52°
SSh T. 52°

59 20 Oct. 96

59	Traverse	Sec. 31 T2N, R2W	Sec. 6 T1N, R2W	Aug
	24			
BS	23			
FS	Aug 1 - 59 - 25	(R.P. Set for Pipe w/ Mag Nail in T.P.)		
250	00 - 00 - 20	(3' W. of E.A.M. W. W. W. R. R. R.)		
	179 - 31 - 35	L Ferris Rd. 16 E.		
	180 - 00 - 11			
	359 - 31 - 41	179-31-30 179-31-225		
	60 - 20 - 30			
	239 - 51 - 47	179-31-17		
	240 - 20 - 21			
	59 - 51 - 56	179-31-255		
		179-31-24 ✓		

St. T.:	BS	FS
FT.	670.10 ✓	661.41 ✓
N.	204.247	201.597

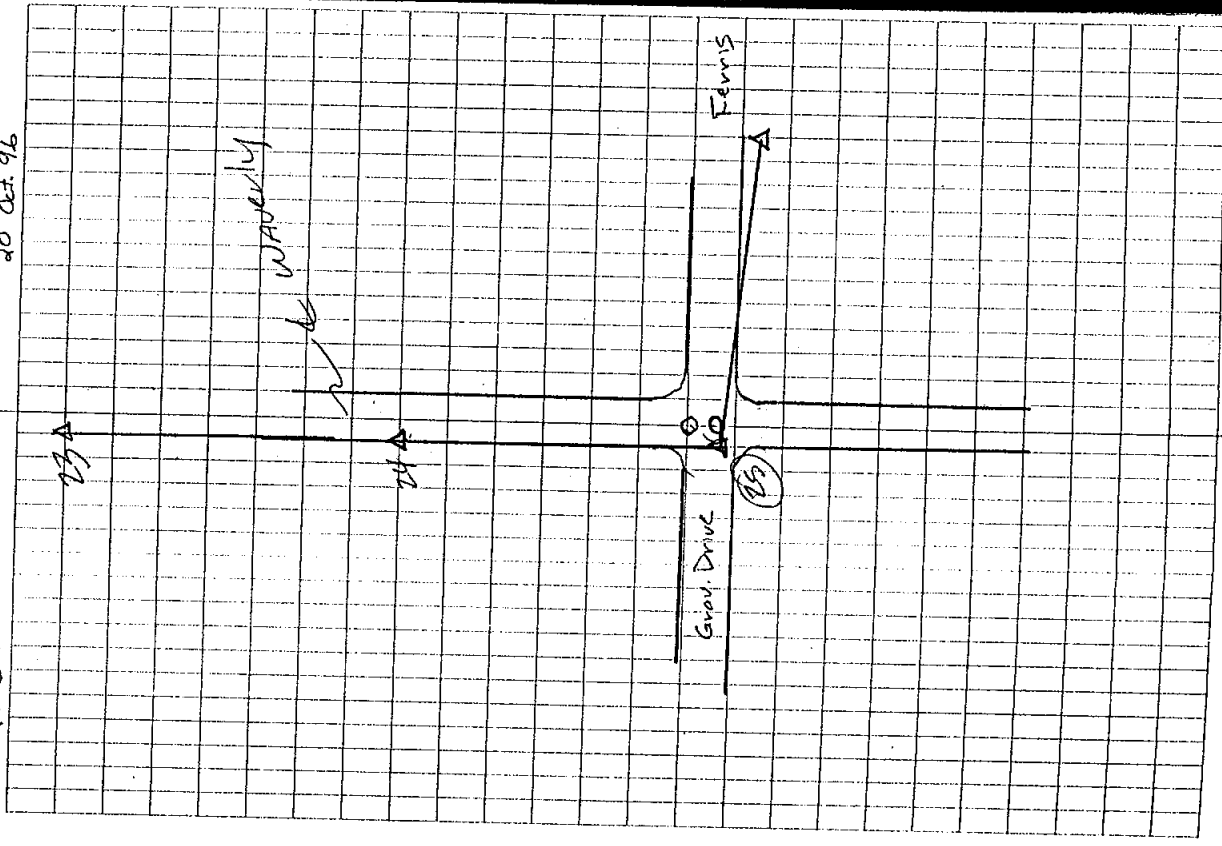


DHC T. 52°
SSL

61

20 Oct 96

9396

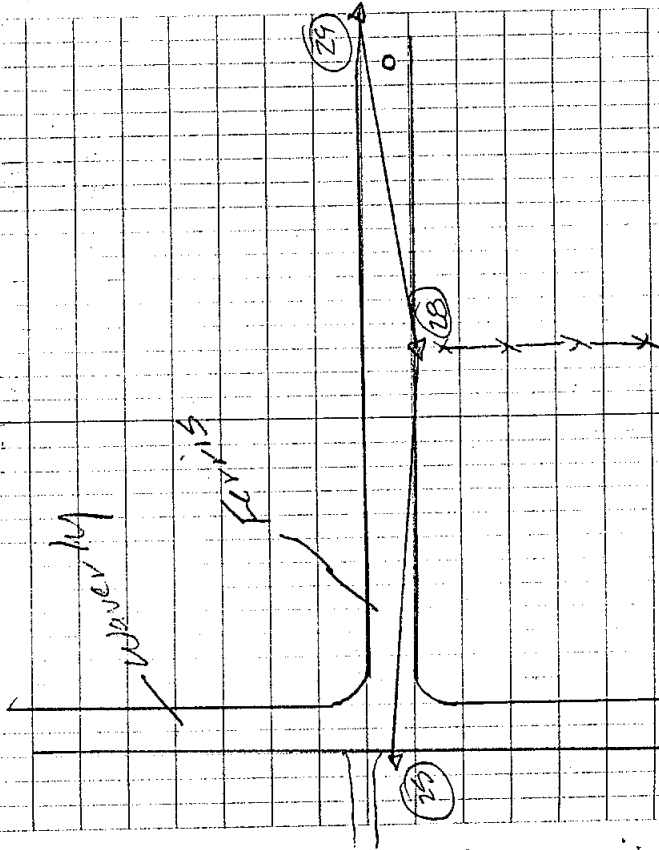

Aug

28

25

Aug - 61 - 29 (Set Boundary on N. Edge Form 101
29' E. of White Pole Box 6227
EQUINE)

00 - 00 - 20

178 - 54 - 54 178-54-34

180 - 00 - 04

358 - 55 - 01 178-54-57 178-54-455

60 - 20 - 30

239 - 14 - 59 178-54-29

240 - 20 - 20

59 - 15 - 05 178-54-45 178-54-37

178-54-41

- I_a: BS FS

FT. 1476.43 ✓ 1579.62 ✓

M. 450.017 481.469

2024 96

✓ Vikon.

62

10

88

2

Alb 1 - 10 - 31 / Set Mac Nail on E Gate Rd 13' South

13:00 - U of C-30 on, 12p.

258-51-149

181-37-41 181-77-71

180 - 05 - 74

78.51-27358512
25051752

✓ 321-22-181	45-22-18155-22-10
--------------	-------------------

11

20	20	20
----	----	----

[illegible]

7/7-77-101	61-77-101	44-44-101	10
------------	-----------	-----------	----

症


7

27

7

	✓	7036	✓	18951	73
	✓	7036	✓	18951	73

5:30.50 5:30.50

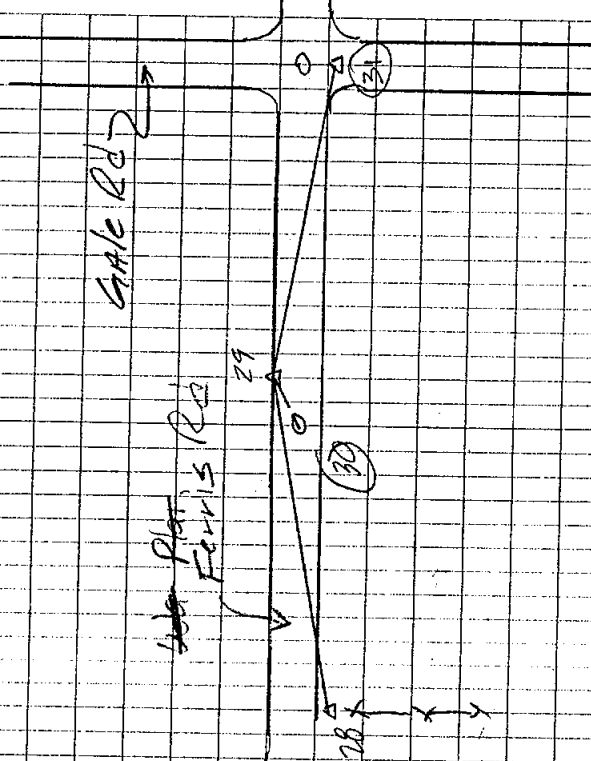

DLG T Nikon
JSL Temp. 60°

2

20 oct. 96

PZ 2145

51325

Am

M.

K

2.

51

54

2

1

1

1

7

7

7

7

1

7

1

1

31

b2

Aug 1 - 63 - 32 (C-3)

2-2	1m - 1/2
-----	----------

00-00-20

52-61-58	54-61-58
----------	----------

88-52-34 45-25 88-52-34

80-00-08

265-18-50 25-18-42 25-19-03, 51

8970-25-41 8852-33 88-52-23

00-20-30

149-12-47

040-80-18

562-2500 ac 760895-71-620

552-2588

BS

12 13

731.601

1000

25	
----	--

1213

816.007	918
---------	-----

10

1

DhC
55h

20 OCT. 96

4

Plains

Large

Ferris

All

64

1

5

52

125

1

1

5

10

10

7

1

1

100

1

1

06

31

AW - 49 - 02	1k
--------------	----

00-00-20

179-33-29	179-33-09
-----------	-----------

180-00-14	
-----------	--

359-33-33	179-33-19	179-33-14
-----------	-----------	-----------

60-20-30	
----------	--

239-53-3917-33-09

240-20-23

59-53-44 179-33-21 179-33-15

179-33-1452

BS


15

✓ 7/11/98	✓ 16/11/98
-----------	------------

816.009	820.346
---------	---------

DHL X Nikon
SIL Temp. 60°

66

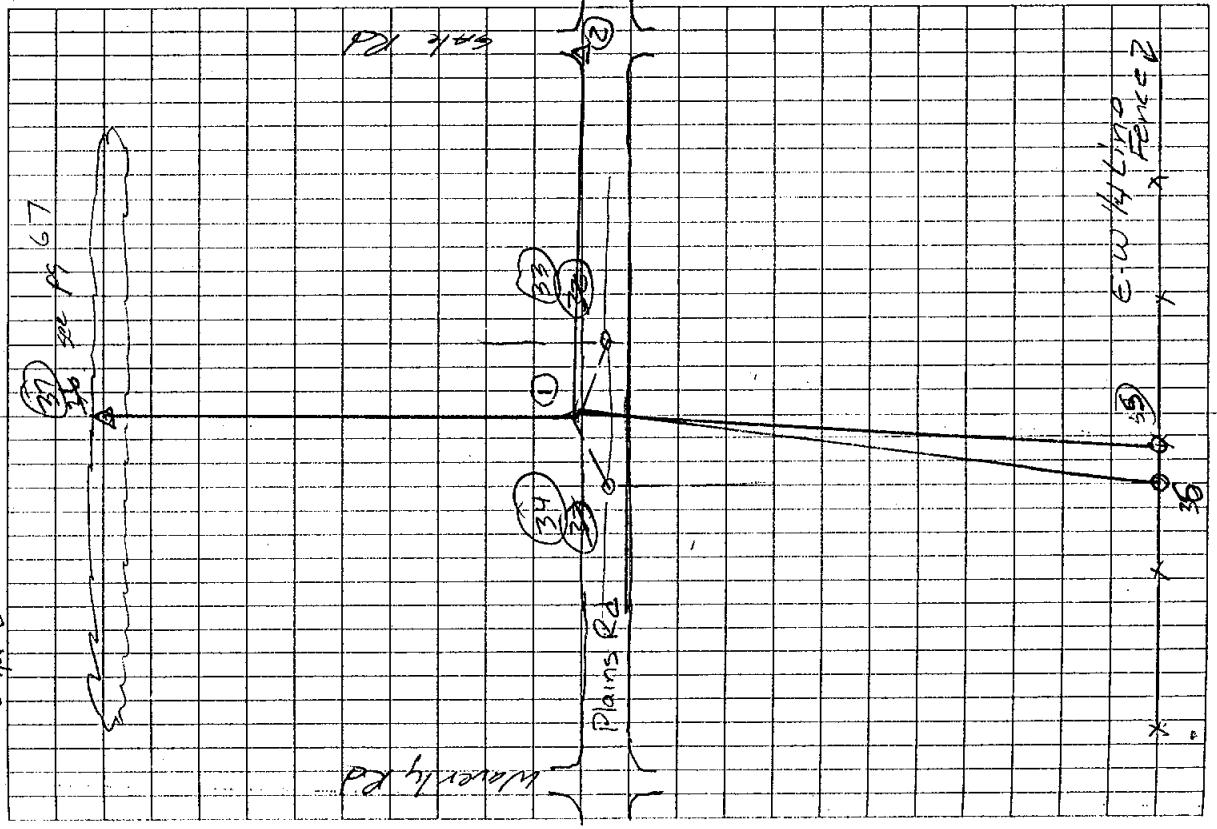

66					AU1
T					
BS		01			
FS	AU1-66-33	33	B-13?	FD 1/2 BSC IN MON BAR	
FS	AU1-66-34	34	B-1?	FD 1/2 BSC IN MON BAR	
FS	AU1-66-35	35		FD 1/2 BSC IN MON BAR	
FS	AU1-66-36	36		FD 1/2 BSC IN MON BAR	
FS	AU1-66-37	37		FD 1/2 BSC IN MON BAR	
FS	AU1-66-38	38		FD 1/2 BSC IN MON BAR	
FS	AU1-66-39	39		FD 1/2 BSC IN MON BAR	
FS	AU1-66-40	40		FD 1/2 BSC IN MON BAR	
FS	AU1-66-41	41		FD 1/2 BSC IN MON BAR	
FS	AU1-66-42	42		FD 1/2 BSC IN MON BAR	
FS	AU1-66-43	43		FD 1/2 BSC IN MON BAR	
FS	AU1-66-44	44		FD 1/2 BSC IN MON BAR	
FS	AU1-66-45	45		FD 1/2 BSC IN MON BAR	
FS	AU1-66-46	46		FD 1/2 BSC IN MON BAR	
FS	AU1-66-47	47		FD 1/2 BSC IN MON BAR	
FS	AU1-66-48	48		FD 1/2 BSC IN MON BAR	
FS	AU1-66-49	49		FD 1/2 BSC IN MON BAR	
FS	AU1-66-50	50		FD 1/2 BSC IN MON BAR	
FS	AU1-66-51	51		FD 1/2 BSC IN MON BAR	
FS	AU1-66-52	52		FD 1/2 BSC IN MON BAR	
FS	AU1-66-53	53		FD 1/2 BSC IN MON BAR	
FS	AU1-66-54	54		FD 1/2 BSC IN MON BAR	
FS	AU1-66-55	55		FD 1/2 BSC IN MON BAR	
FS	AU1-66-56	56		FD 1/2 BSC IN MON BAR	
FS	AU1-66-57	57		FD 1/2 BSC IN MON BAR	
FS	AU1-66-58	58		FD 1/2 BSC IN MON BAR	
FS	AU1-66-59	59		FD 1/2 BSC IN MON BAR	
FS	AU1-66-60	60		FD 1/2 BSC IN MON BAR	
FS	AU1-66-61	61		FD 1/2 BSC IN MON BAR	
FS	AU1-66-62	62		FD 1/2 BSC IN MON BAR	
FS	AU1-66-63	63		FD 1/2 BSC IN MON BAR	
FS	AU1-66-64	64		FD 1/2 BSC IN MON BAR	
FS	AU1-66-65	65		FD 1/2 BSC IN MON BAR	
FS	AU1-66-66	66		FD 1/2 BSC IN MON BAR	
FS	AU1-66-67	67		FD 1/2 BSC IN MON BAR	
FS	AU1-66-68	68		FD 1/2 BSC IN MON BAR	
FS	AU1-66-69	69		FD 1/2 BSC IN MON BAR	
FS	AU1-66-70	70		FD 1/2 BSC IN MON BAR	
FS	AU1-66-71	71		FD 1/2 BSC IN MON BAR	
FS	AU1-66-72	72		FD 1/2 BSC IN MON BAR	
FS	AU1-66-73	73		FD 1/2 BSC IN MON BAR	
FS	AU1-66-74	74		FD 1/2 BSC IN MON BAR	
FS	AU1-66-75	75		FD 1/2 BSC IN MON BAR	
FS	AU1-66-76	76		FD 1/2 BSC IN MON BAR	
FS	AU1-66-77	77		FD 1/2 BSC IN MON BAR	
FS	AU1-66-78	78		FD 1/2 BSC IN MON BAR	
FS	AU1-66-79	79		FD 1/2 BSC IN MON BAR	
FS	AU1-66-80	80		FD 1/2 BSC IN MON BAR	
FS	AU1-66-81	81		FD 1/2 BSC IN MON BAR	
FS	AU1-66-82	82		FD 1/2 BSC IN MON BAR	
FS	AU1-66-83	83		FD 1/2 BSC IN MON BAR	
FS	AU1-66-84	84		FD 1/2 BSC IN MON BAR	
FS	AU1-66-85	85		FD 1/2 BSC IN MON BAR	
FS	AU1-66-86	86		FD 1/2 BSC IN MON BAR	
FS	AU1-66-87	87		FD 1/2 BSC IN MON BAR	
FS	AU1-66-88	88		FD 1/2 BSC IN MON BAR	
FS	AU1-66-89	89		FD 1/2 BSC IN MON BAR	
FS	AU1-66-90	90		FD 1/2 BSC IN MON BAR	
FS	AU1-66-91	91		FD 1/2 BSC IN MON BAR	
FS	AU1-66-92	92		FD 1/2 BSC IN MON BAR	
FS	AU1-66-93	93		FD 1/2 BSC IN MON BAR	
FS	AU1-66-94	94		FD 1/2 BSC IN MON BAR	
FS	AU1-66-95	95		FD 1/2 BSC IN MON BAR	
FS	AU1-66-96	96		FD 1/2 BSC IN MON BAR	
FS	AU1-66-97	97		FD 1/2 BSC IN MON BAR	
FS	AU1-66-98	98		FD 1/2 BSC IN MON BAR	
FS	AU1-66-99	99		FD 1/2 BSC IN MON BAR	
FS	AU1-66-100	100		FD 1/2 BSC IN MON BAR	

20 oct. 916

79

Aug 1

79

K

SS

51

Aug - 67 - 37 (Set 8" spike in East/West)
Stone Ditch

2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100
---	---	---	---	---	---	---	---	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	-----

270-18-43

80-00-17

90-18-36	18
----------	----

60-70	-30
-------	-----

336-30-CH

01-06-07

111	66-031	01
-----	--------	----

4	1	7	7
---	---	---	---

A blank coordinate grid with x and y axes. The x-axis is horizontal and the y-axis is vertical, intersecting at the origin. There are tick marks on both axes, but no numerical labels are provided. The grid is intended for plotting a graph.

7

2

08.5.80

504.455

THE UNIVERSITY OF CHICAGO

[illegible][illegible][illegible][illegible]

100

○ 10

4.

五

1

1

1

1

1

1

10

68

B-13 T2N R2W

B. Searched at apparent location of corner and found $\frac{1}{2}$ " B&C 20414 in Mon Box on 4 Plains Rd. Traverse of All of Sec. 31 proved B&C to be ~~Q-870~~ Proportional Measurement to GLO Survey EXCAVATED Mon Box and Ht wood stake @ 2.5' feet. Accepted B&C as perpetuation of corner because of agreement with GLO Proportion and presence of suspected historical monument. Replaced $\frac{1}{2}$ " B&C with standard monument to tie monument.

Aug

DLC
MAB

7600

24 Oct. 96

68

DLG T600 69
MAG T NIK 24 Oct 96

Witness B-13
T Aul-49-01
PS Aul-49-02 Az 900
3/4" x 24" STEEL Bar & Yellow Plastic Cap Imprinted
PA345 PS 25837 in Mon. Box on E Plains Rd.
41 N&T N side 36" Maple - 261-07-22 278.78
45 SE Steel FA for gate - 254-28-45 266.20
46 NV cor. of House # - 730 541.36
47 N&T N side 46" Maple - 75-00-19 551.52
48 SW cor. conc block bin - 60-02-21 544.15
49 1/2" Bar & Cap in Mon. Box 270° 549.32
B. Searched at apparent location of corner
and found 1/2" Bar & Cap #20114 in Mon.
Box on Center line Plains Rd and
27.9' East of 1/2" Bar and Cap in Mon.
Box. After Traversing all o.r. Sections
31, 20122W and Section 6, T1N R2W,
Accepted 1/2" Bar and Cap in Eastern
Mon. Box as perpetuation of corner.
Based on close agreement with
government Survey measurement
proportion. Replaced 1/2" B&C with
Standard Ingham County Mon.

69
Set B-12 @ Int. 1/4 Lines Aul
T Aul-67-33 Recor. B" spk
PS Aul-49-01 Recor. 1/2" B&C
Set 200 Int. 1/4 Lines
PS D 180-18-21" Az
FS 283-16-48 17.42'
283-16-51 17.40'
FS Aul-69-38 (B-12 3/4" B&C @ Int. 1/4 Lines
BSO 0-0-20
10 103-02-08 103-01-48
BSA 180-0-26
18 283-02-25 103-01-59 103-01-53"
3/4" x 24" Bar & Yellow Plastic Cap Imprinted PA345 PS 25837
1" East-West Stone Row 9.98'
19 hole in rock - 70-47-47 1820 18.39'
10 N&T N side of Sassafras?? - 760 8.89'
10 126-15-30 10.24'
41 N&T S side 13" sassafras?? 282° 5.00'
42 N&T S side 15" ELM 260-52-54 9.10 22.40'
43 N&T S side Twin 18" ELM 220-50-30 9.50 22.93'
Searched at apparent location of Corner
and found East-West Stone & Tree Row.
Set STANDARD Mon. @ Intersection.
1/4 Lines

PLC
JJC
T500
28 Oct 196
70

70				AU1
C-12	B. Searched at apparent location of corner and found 1 1/2" Bar 2' E. of Gale Rd on very vague occupation line East & West. As corner falls in 4'-- of Road fill in a swamp chances of finding historical evidence are zero. After traversing all of Section 31 Accepted 1/2" Bar as an honest attempt at a lost corner re-establishment of corner and replaced it with standard Ingraham County Remon. Mon. and Set Mon. Bar			
C.	3/4" X 24" STEEL Bar & Yellow Plastic Cap			
	Imprinted PA345 PS25837 in Mon. Bar			
	6' x 1 1/4" Pipe	97°		39.20
	1/2" Bar & Cap PS28414	274°		33.03
NST 25837	NE Side 8" DBL. VAL.	328°		190.25
"	NW Side 12" OAK	307°		231.94
"	N Side 14" OAK	298°		257.18
"	N Side 8" Walnut	286°		225.66
NST 28414	W. Side Guard Post	17°		48.82