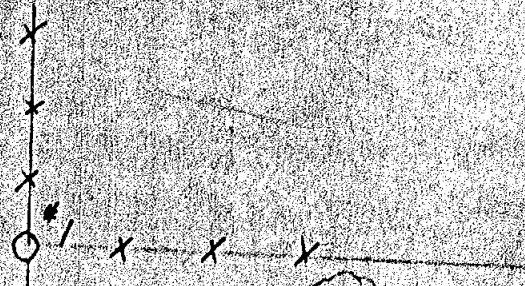
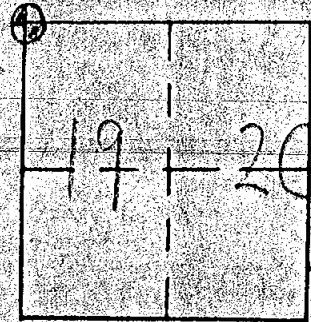



TRAVERSE POINT WITNESS REPORT

Traverse Point No. 12,099Tech. Sup'r. L. BryanTownship Bunker HillCompany PolarisRecorded
Corner
Code A-7Field Squad #2 YashinskyDate 4-26-78

Sketch and describe roads, monuments found or set, and witness established:

1) $N10^{\circ}E$ 27.03' to center 3" pipe anchor post2) $N80^{\circ}E$ 66.90' to N&R South side of Box Elder3) $S05^{\circ}W$ 252.02' to STEPHENS ENGINEERING TAG EAST SIDE LARGE MAPLE

#2

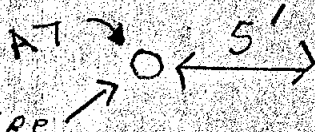

Found pipe
West of curve in Kinneville
as Recorded L1, Pg. 1

KINNEVILLE

OK
MLM
11/4/79OK
J.D. 5-8-78

#3

LEER 4 16 08

Sub #1980-77
Page 1 of 2

FAUSER & KELLER, INC.

RECORDED-REGISTERED LAND SURVEYORS

2567 W. Baseline Road

Office: (517) 783-4717

Leslie, Michigan 49251

Dianne B. Southwick

James E. Vasher, Jr.

Dennis D. Vasher

563-2812 Hanover

RONALD W. KELLER, R.L.S.

June 12, 1980

LOCATION MAP

589-3261 Leslie

GLEN A. FAUSER, R.L.S.

SECTION 19

T.1 N.-R.1 E.

Bunkerhill Township

Ingham County

Michigan

JUL 3 9 40 AM '80

REGISTER OF DEEDS

Paul Johnson

INGHAM COUNTY, MICH.

N.W. CORNER, SEC. 19

N.E. CORNER, SEC. 19

KINNEVILLE

RD.

SCALE: 1"=300'

WITNESSES:

E. 1/4 POST, SEC. 24
FOUND STONE & PLOUGH SHARE
WEST 12" COR POST 0.5'
N 85° E 10" HICKORY 14.20'
SOUTH 10" " 18.80'
S 85° W 6" " 23.55'
NORTH 24" " 47.25'

W. 1/4 POST, SEC. 19

SET CAPPED IRON IN FENCE TO EAST
S 5° E 10" HICKORY 14.50'
C 48° E 15" " 12.00'
N 45° E 6" " 25.45'
S 75° E 10" " 24.08'

E. 1/4 POST, SEC. 19

FOUND 1/2" RE. ROD IN PILE OF ROCKS
INLINE WITH FENCE E-W & 10' SOUTH LAKE E-W
SOUTH 10" ELM 4.10'
N 87° E TWIN W. CHERRY 61.88'
N 89° W 20" OAK 95.77'
WEST 6" FENCE POST 6.50'

N.W. CORNER, SEC. 19

FOUND 3/4" IRON PIPE
S 11° W 40" MAPLE 252.0'
S 85° E 1/4 KINNEVILLE RD. 82.00'
N 80° E 24" BOX ELDER 66.97'

N.E. CORNER, SEC. 19

FOUND 1" IRON ROD IN E. ROAD N-E-W
S 21° W TELE. POLE 20.62'
S 74° E 18" HICKORY 62.73'
N 2° E W. LEG OF SIGN 29.61'
IN LINE WITH FENCE GOING SOUTH

LEGEND

Found Iron = ●
Property Iron set = ○
2008 = 1413 =

E. 1/4 LINE, SEC. 19

E. 1/4 POST, SEC. 19

E. 1/4 POST, SEC. 24

T.1 N.-R.1 E.

I hereby certify this drawing to have been prepared from the field notes of a boundary survey made by me in June 1980 on order of Dianne Southwick better.

This survey was made with P.A. 132 of 1970 and the error of closure is 1 ft. in 5000 ft.



Ronald W. Keller
R.L.S. #20707

W. 1/4 POST, SEC. 19

N 89° 49' 05" E

1181.31'

E. 1/4 POST, SEC. 24


T.1 N.-R.1 E.

I hereby certify this drawing to have been prepared from the field notes of a boundary survey made by me in June 1980 on order of Dianne Southwick better.


This survey was made with P.A. 132 of 1970 and the error of closure is 1 ft. in 5000 ft.

18	17	16	15
STATE ON EFW 12" Maple 72.000 14" Maple 72.000 Cedar 115.500 10" Apple 119.00	Stone Brick, Portery 24 Oak 14.55E Walnut 16.7N	Stone, Creekery, Iron, Brick 8 Elm 48.9 NNE 12 Oak 66.9 SSE 12 Walnut 614.55W	Stone above Iron SW. Cor. 50.25E NE. Cor. 46.6 W. 115.2. 22.0 NW 10 Maple 52.0 NW
19	20	21	22
Stone Brick 18 Hickory 141.8 18 Hickory 66.55E Walnut 105.5 NE	Pointed Stone, Iron, Brick 36 Oak 28.4 NNE 27 Oak 58.0 NNE 12 Elm 58.4 SW 4 Elm 67.3 NNW	Brick, Stone, Creekery 18 Maple 23.6 WSW 15 Oak 59.3 NNE 24 W. Fence Line R.R. to Rock Post	Stone 18 Maple 23.6 WSW 15 Oak 59.3 NNE 24 W. Fence Line R.R. to Rock Post
30	29	28	27
Iron State, Creekery 14 Hickory 34.8 WNW 8 Oak 43.0 SSE 14 Oak 50.5 SW	Stone, Creekery 12 Oak 51.8 WNW 10 Oak 51.5 SW 18 Oak 116.5 E	TYPE AT Road Intersection SE Cor 45.6 NW 42.8 NW Center Wall 16 Maple 54.5 SSE 36 Hickory 106.7 WNW 6 Double Elm 85.2	Stone 18 Maple 23.6 WSW 15 Oak 59.3 NNE 24 W. Fence Line R.R. to Rock Post

(T.I.N.R.W. Leslie Twp., Ingham County)

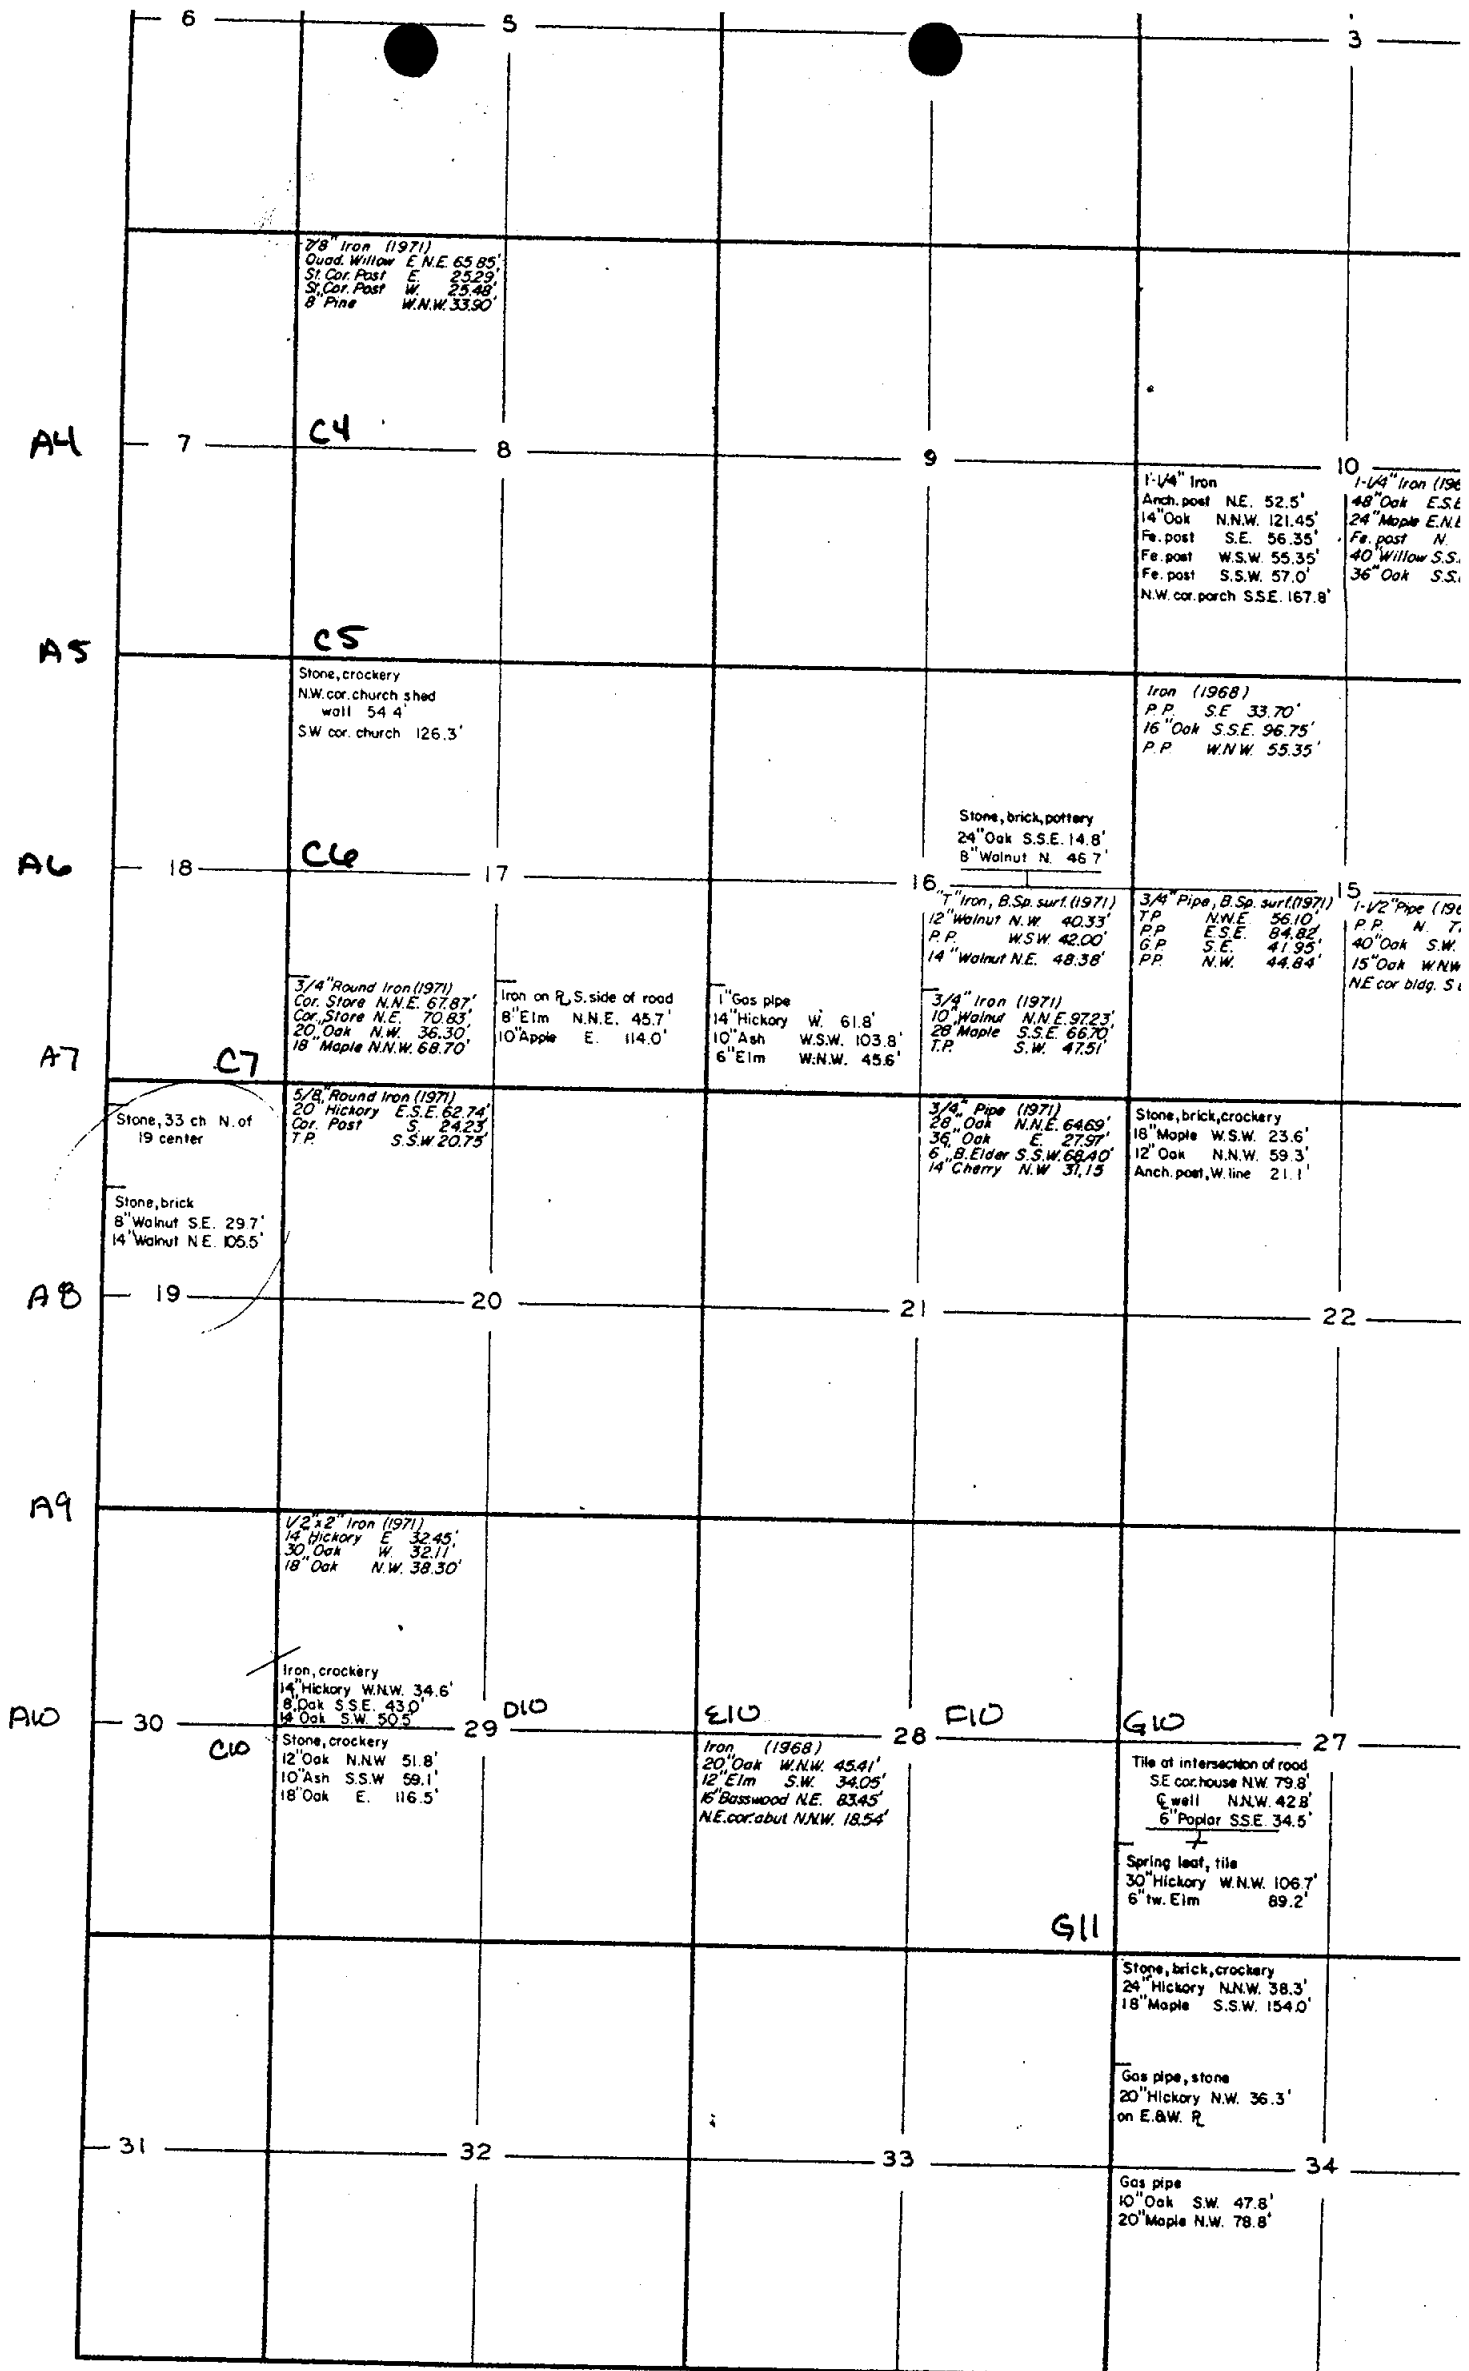

* I.C Road Commission
Bunker Hill 1/1/1972

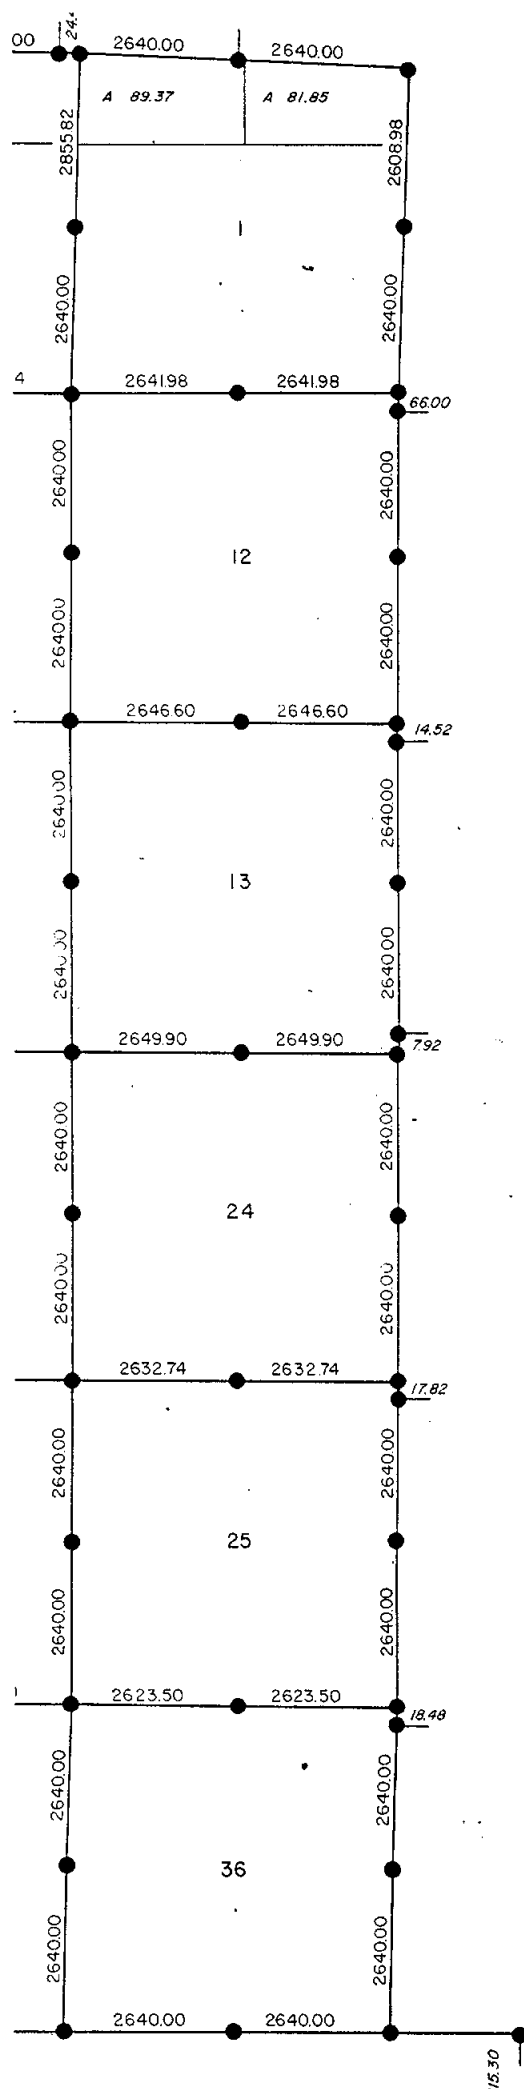

BUNKERHILL TOWNSHIP TIN-RIE

G.L.O. PLAT MAP (GENERAL LAND OFFICE)

- Corner Set
by the original survey
- Post Set
by the original survey
- A 40.00 Acreage
(from original G.L.O. plats)
- 66.00 Closing Corner Offsets

Measurements which are shown outside subject township refer to adjacent townships. All measurements shown are in feet.

1000 500 0 1000 2000 3000 4000 5000
ONE INCH EQUALS TWO THOUSAND FEET



SOURCE : GENERAL LAND OFFICE FIELD NOTES (G.L.O.)

EXTERIOR FIELD SURVEY (Township Boundary)

South Boundary

Surveyed: January 19, 1824 by J. Wampler (corrected by Wampler, January 31, 1826,

East Boundary

Surveyed: February 4, 1824 by J. Wampler

North Boundary (South Boundary of Ingham Township)

Surveyed: February 6, 1824 by J. Wampler

West Boundary (East Boundary of Leslie Township)

Surveyed: by J. Wampler, date not noted

INTERIOR FIELD SURVEY

Surveyed: January 30 to February 8, 1826

Certified: February 8, 1826

Surveyor: J. Wampler

The distances and monuments shown are from the original field notes which are held by the Michigan State Department of Natural Resources, Lands Division. Distances were originally recorded in chains and links.

Prepared by the Ingham County
Survey and Remonumentation Project
1978 - 1979
under the supervision of
Polaris Associates, Inc.
Registered Land Surveyors
Mason, Michigan

