


COUNTY SURVEYOR'S RECORD

TOWN One NORTH, RANGE One East, MERIDIAN OF MICHIGAN.

Section Thirty

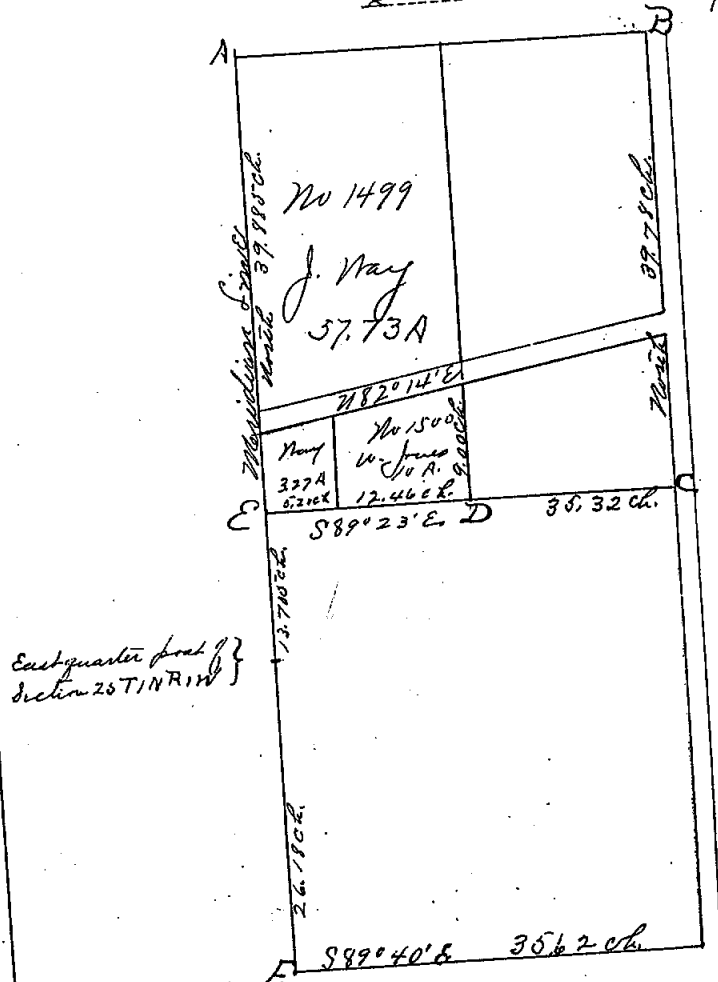

TOWN _____ NORTH, RANGE _____, MERIDIAN OF MICHIGAN.

- | | |
|----|----|
| 1 | 24 |
| 2 | 25 |
| 3 | |
| 4 | |
| 5 | |
| 6 | |
| 7 | |
| 8 | |
| 9 | |
| 10 | |
| 11 | |
| 12 | |
| 13 | |
| 14 | |
| 15 | |
| 16 | |
| 17 | |
| 18 | |
| 19 | |

Survey of the west half of the north half of section Thirty-Town One North of Range One East as represented by the plat, the scale to which it is drawn is 10 chains to one inch, in which the names of owners, the number of acres owned by each, the bearings and lengths of the lines surveyed, and the relative position in the section lines letters of reference to the corners are respectively given. The highways are shown by the red lines.

The corners are described as follows.

Found one of the bearing trees blown over and what appeared to be the remains of the other and located the corner as near as it could be from the evidence. New bearing Ironwood 5 in diam bears N64W 34 lks. dist.


B. Oak	8 "	"	"	"	S74W 22 1/2 "
B. stone for a Hickory	6 in diam	bears	N86W 49 1/2 lks	dist	
B. Walnut	6 "	"	"	"	S34 3/4 W 7 1/2 "
* a post	"	"	Drop O 8 "	"	S51W 44 1/2 "
"	"	"	B.O. 12 "	"	N56E 136 3/4 "
"	"	"	in marsh	"	No bearings
"	"	"	Lynn 24 "	"	S8 1/2 W 144 1/2 "
"	"	"	Sugar 18 "	"	N3 1/2 W 13 "
B. Wal. State.	"	"	Drop O 14 "	"	S70E 29 1/4 "

The bearing of the road was not taken but was found by calculation to be N 82° 4' E and is probably very near right.

* This corner was extinct and was reestablished according to law
Run by the true Meridian Mag. Var 1° 55' East
Surveyed Feb 12th & 13th 1877 for those named in the plat
by A.P. Drake
Co. Surveyor.
Recorded Feb. 21st 1877.

COUNTY SURVEYOR'S RECORD,

TOWN One NORTH, RANGE One East, MERIDIAN OF MICHIGAN.

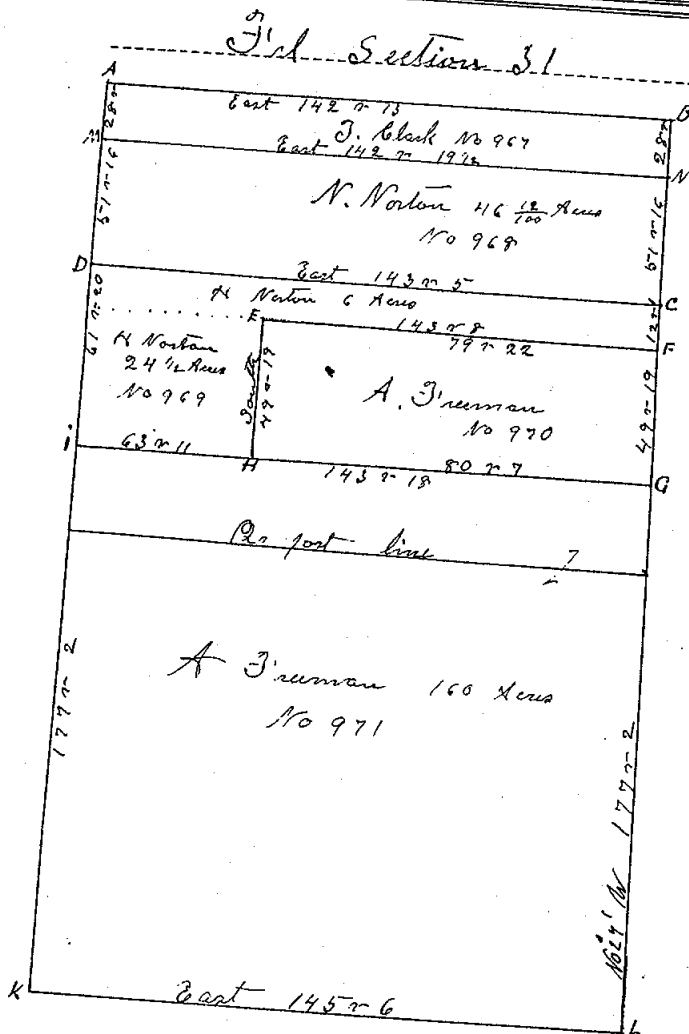

- Index Vol. 2

TOWN One NORTH, RANGE One East, MERIDIAN OF MICHIGAN.


- 24.
- 25
- Elm 15 S 61 1/2° E 20
- A Do 9 N 42° E 18
- Hickory 16 S 50° W 29
- B Elm 16 S 70° E 21 1/2
- W Oak 12 S 11 1/2° W 38
- C Do 11 N 70 1/2° W 66 1/2
- D In Marsh no bearing trees
- Elm 24 N 87 1/2° W 197
- E W Oak 15 N 8 1/2° W 145
- Elm 17 S 67 1/4° W 29
- F Do 15 N 75 1/4° W 30 1/2
- W Oak 26 N 79 1/2° W 16 2/3
- G Do 24 S 5 1/2° W 89
- H In Marsh No Bearing Trees
- Dam 4 N 61° W 46
- I Do 4 S 69° W 43
- K Dam 9 S 38° W 73 No Other Tree
- B Oak 12 N 62° E 65
- L Do 10 N 65° W 72
- B Ash 5 S 24 3/4° W 36 1/2
- Do 4 S 6 1/2° E 38
- R Oak 28 N 84° W 20 1/2
- N Elm 16 N 57 1/2° S 55 3/4
- W Oak 16 N 53 1/2° S 50 1/2
- Q Do 14 N 52 1/2° W 44

INGHAM COUNTY, MICHIGAN

TOWN *One* NORTH, RANGE *One East*, MERIDIAN OF MICHIGAN.

Run by the true Meridian Van 2 7/8
Surveyed and Recorded August 7th 1857
J. A. Jackson Co. Surveyor

SEC. 32

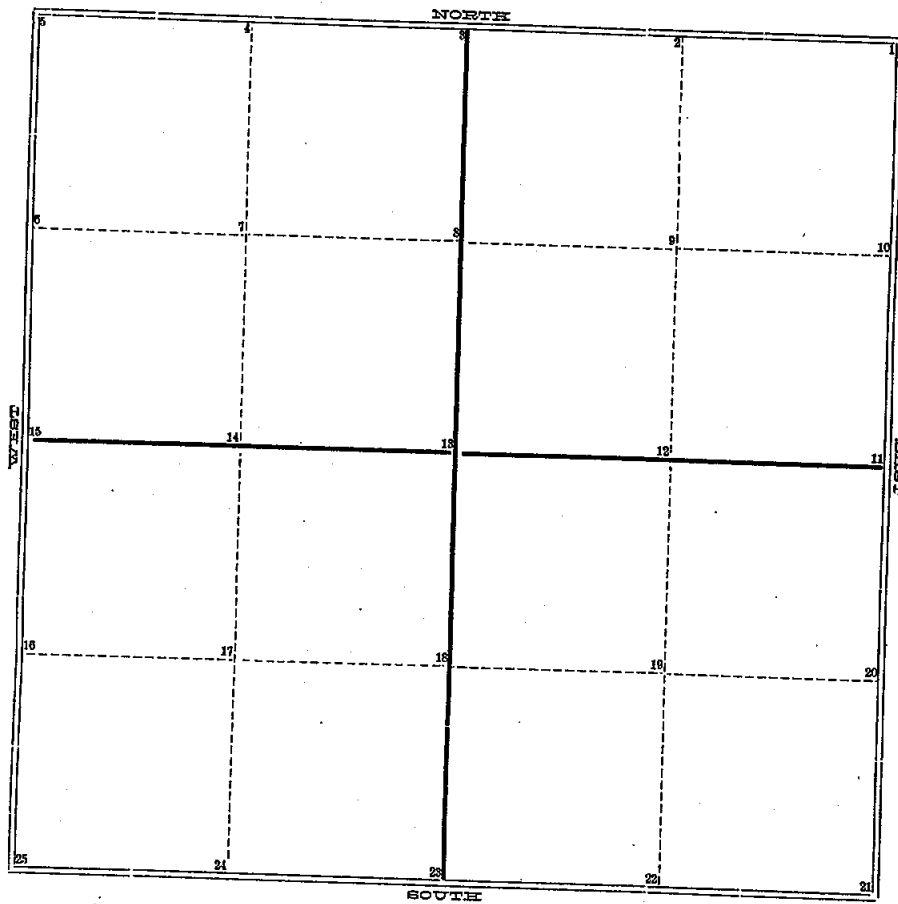

TOWN _____ NORTH, RANGE _____, MERIDIAN OF MICHIGAN.

1 Buggy axle in center of ditch 24
2 25

3 Elm stake.

4

5 Iron bar.

6

7

8

9

10

11

12

13 Well cylinder

14

15 Red in Maple 18° N-E 22 1/2
Tile Gate 24° S-E 87 "

16

17

18

19

20

21

INGHAM COUNTY, MICHIGAN.

TOWN. / NORTH, RANGE. / East, MERIDIAN OF MICHIGAN.

Survey of the N.W. 1/4 of Sec. 32 T. 17. R. 1. E.
for Ben Wood and Geo Brink.
Ben Wood } Scribe
Dan Webster } Chairman.
Surveyed Apr. 20, 1911

Dug for n.w. cor. of Sec. 32 and found old slate hole. Set iron bar for corner. Chained east on north section line. At 79.94 found N.E. corner of Sec. 32. This corner was identified by an Elm tree and Elm & Tamarack stumps. Set buggy axle with stake by side in center of ditch. Set ^{iron} ^{rod} for 10 1/4 post Sec. 32 where old slate was found. f.w.
Maple 18" N. E. 72 1/2 s Oak 24" S. E. 87 1/2 s.
Chained east on 1/4 line and found center of sec as old post. Set wall cylinder by side. Set ^{number} 4 and 14 half way and ran line between them.
P. J. Pab
C. Surveyor.