


27				LE3
2002	Remedy	ES		
X	LE3-18-50	(Recov. Str. Acc.		
BS	LE3-17-50	(Recov. Str. Acc.		
FS	LE3-27-104	(Pol. Set. Major 10.1' on Line 51.50 55.5 off 51.50 2' E of 4th place Rd.		
Dist To	BS ₅₀	FS ₁₀₄		
	2645.42	156.41		
X	LE3-27-104			
BS	LE3-17-50			
FS	LE3-27-105	(R.P. Set 2002 Spk N. of 4th Place Rd.)		
BS _D	000-00-20			
D	291-07-43	291-07-23		
BS _R	180-00-16			
R	211-07-36	291-07-20	291-07-17	216
BS _D	60-20-30			
D	351-27-46	291-07-16		
BS _R	240-20-41			
R	171-28-00	291-07-19	291-07-17.5	
			291-07-19.5	
Dist To	BS ₅₀	FS ₁₀₅		
	2488.93	1132.38		
	2488.93	1132.38		

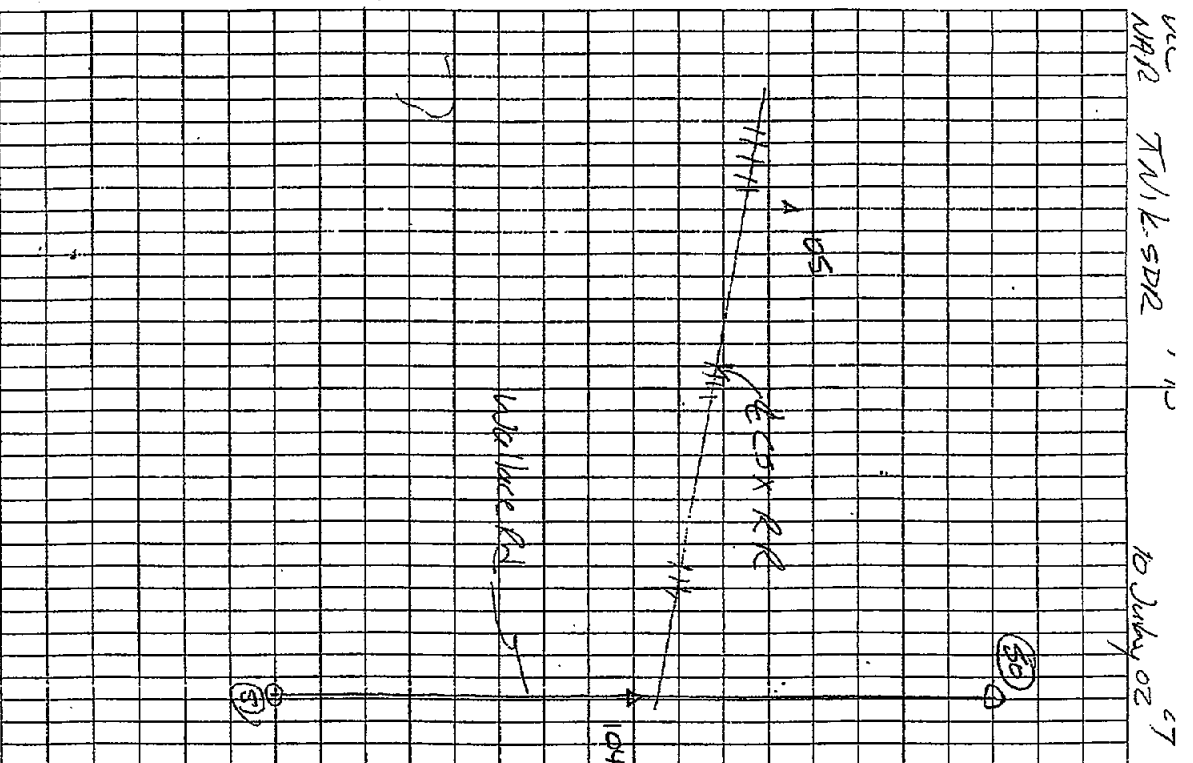

28

L-5 L&L 28-67

LEZ.

DLC
CFE:

7850

29 Aug 00

28

B. Searched at apparent location of corner and found $\frac{1}{2}$ " bar in North fence line of Abandoned Road. Could not reconcile this location with Bergman witnesses (they do not appear to be for this corner). Accepted Bar as perpetuation of corner and replaced with standard Bar & Cap. Upon further consideration decided corner needed more work and placed on hold.


Witnesses to $\frac{1}{2}$ " Bar in fence

N&T 25837 N. Side 7" Maple East 909

S. Side 7" Maple S 70 E 12.28

↓
N. Side 36" Oak S 75° W 97.33

N&T 19834 S. Side 36" Maple West 6450

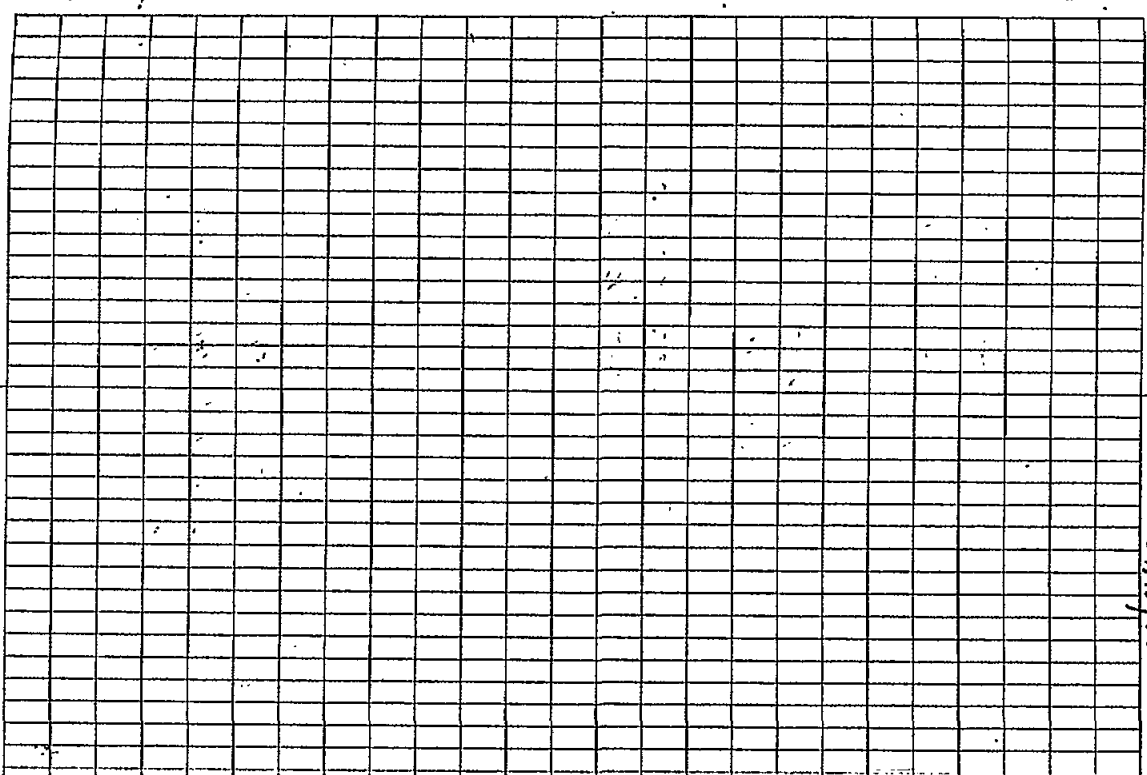

19

LE-2

L-4 LE-19-53

B. Searched at apparent location of corner and found 1/2" B&C. 16053 on 2844 @ location. Re-measured lot 3, 4 S&G. Block 1 of Fisher's Addn. To Lacey lot 22 Assessor's Plot. Not and lots 6 & 7 of HUBBARD'S. Unrecorded Plot and determined B&C was ~~the~~ perpetuation of corner in relationship to Plots. Aug 3' Dia Hole 3" Deep and found nothing more. Accepted B&C as perpetuated location of corner & replaced w/ STANDARD B&S' Cap.

NST 25837 S. Side 20' to road N84E 18.44
 NST 16053 E. Side 47L Pole SOUTH 15.36'
 NE. Cor Conc. Block 16d 515'W 08.00
 NW Cor Conc. Block 81d 553'W 99.42
 NW Cor lot 22 Asses. Plot 119'W N87W 137.02

DE

SUN

THO

18 Aug '19

L-5 LE-19-54

B. Searched at apparent location of corner. And found 1" gas pipe on E curb Road 1' West of Fence line South. Markings All of Barnman's Road Corner's & Roses. All in place. Accepted 1" gas pipe as corner and drove 3/4" bar into it and placed Alum cap on bar.

NST 25837 W Side 22" Maple 519'W 22.20'
 NST 19834 NW Side 19" Maple 558'W 30.27'
 NST 25837 NW Side 17" Maple 569'W 42.94'
 NW Side 12" Oak 579'W 53.50
 NW Side 9" Oak 578'W 65.20

18

LE-2

M-4 LE2-18-51

3. Searched & found cone. Moss
 Cap 9' W. of d. Wallace Rd.
 on Fence Line West. Accepted
 as corner. capped W/ Alum Cap

C. 4" Conc. Mon w/ 1/2" Rebar & Alum Cap
 NJT 13998 NW Side 19" W. Cherry N40°E 60.60'
 NJT 26837 SW Side 25" Cherry 538°E 51.20'
 East Side 33' Oak 515°W 121.92'
 ↓ S. Side For Post N81°W 21.08

DL
GWN

790°

18 Aug 00

18

L-4 LE2-18-52

8. Searched at original location of
 corner and found 1/2" Dec 8 Cap #17027
 at SW Side 3" steel pipe anchor
 Post. EXCAVATED 3' Dec hole around
 Post and found old sleep shoe.
 laying in stones surrounding post.
 Accepted sleep shoe = 3 1/2" Post as
 large location of corner and replaced
 by W.I.L. 3/4" x 24 steel bar.
 Alum. Cap

NJT 13037 NW Side 9' Elm N53°E 14.50'
 NJT 13034 N. Side 20" W. Oak East 27.92'
 NJT 13039 SW Side 9' Oak N58°W 13.95'
 NJT 26837 E. Side 9' Cherry N40°W 4.40'

17
M-6 LE 2-17-49 LE-2

C.
N1T 28414 Top covered 601185-1136E 31.92'
S 45.0E 31.92'
S 41.0W 31.22'
N 37.0W 32.82'
South 109.38'

3/4" Pipe in Man Box

DEC 770° 1849.2000 17
M-5 LE 2-17-50
3 Found Conc. Mon w/ cap in Conc.
Collar. Accepted as per de tution
of concuer. capped w/ 1" pipe. Cap
set 1" into surface

C. 4' Conc. Mon w/ 1/4" Aluminum Cap
N1T 25837 W. Side 16" Hic N19°E 12.180'
N1T 28414 W. Side 17" Pipe S 39.0E 49.98'
SW Conc. FIDIL HSC #2484 S 35.0E 78.29'
6.5" STEEL Pipe FCN 103N 064055.38
N1T 28414 S. Side 21" Pipe N 66°W 12.24'
Conc. Mon. (AS 13N-13E) South 97.05'