


SV BV

3-3-05

(25)

Leslie Twp K-11
 Fd. 1/2" IRON in Mbn. Box.
 Fd. previous witnesses to SW,
 Willow + NW Hickory that measured
 well. Removed IRON + CONT. ETC.
 Found 1.5 of GRAVEL thru small
 Rocks with sand below. No further
 Evidence of COR. Set Remon
 B+C #47969 in place of 1/2" IRON.
~~B+C #47969~~
 COR. Falls 1.5 ± S. of E of
 Olds Rd. + 30 ± W. of E Peacock.
 witnesses.
 Fd. P.K. NAIL W. FACE Util. pole
 NORTH, 2500
 Set NAT #31603 in N. FACE 8" MAPLE
 S 60° E, 95.57'
 Fd. NAT #25832 in N. FACE 36" willow
 S 55° W, 76.61'
 Fd. NAT #25832 in SW. FACE 24" Hickory
 N 55° W, 49.73'
 Fd. NAT #18994 in SW. FACE 24" OAK
 N 40° W, 34.20'
 E STREET POST S 45° W, 36.82'

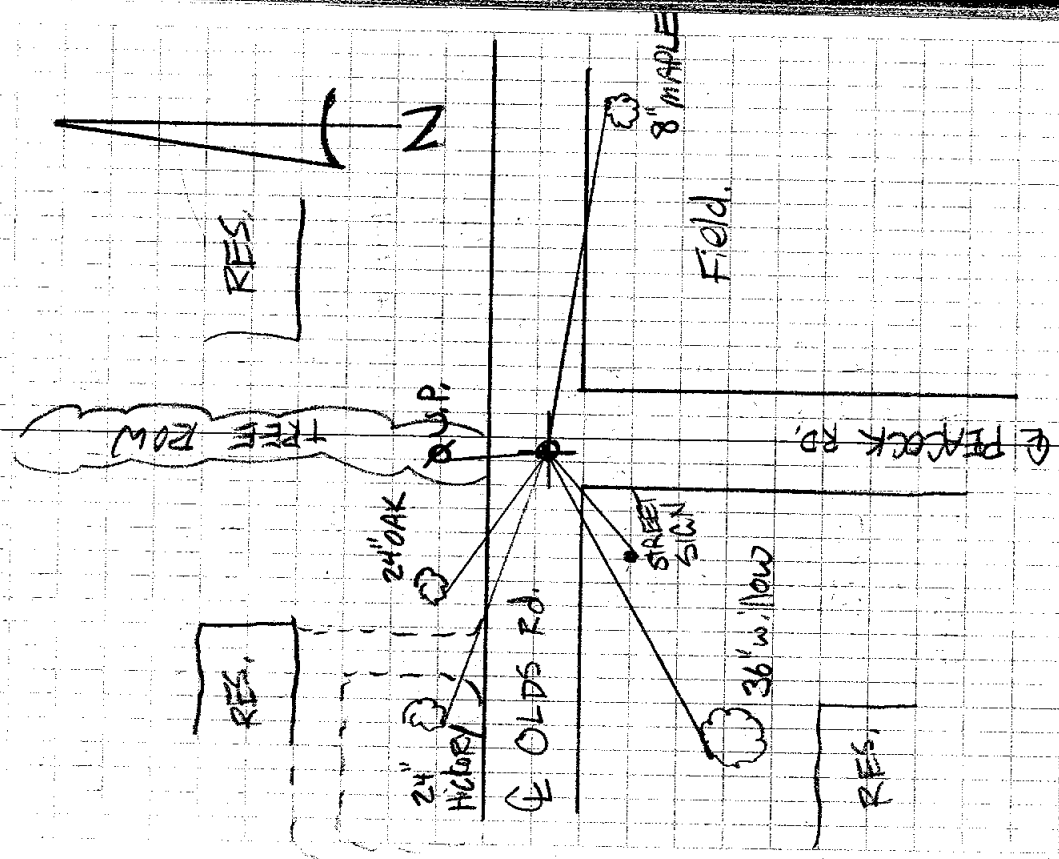

Lasie Twp. K-12

Fd. 1/2" IRON UNDER 0.30' of Asphalt, IRON Fell 1.0' E. of E Peacock Rd. witness to 36" OAK (Now 36" stump) measures well to E of TREE witness to 40" twin Hickory also measured well. Removed 1/2" IRON FROM Asphalt + CONT. EXC. Asphalt Rd. was 10" thick with Clay + Sand Below, Fd. N FURHER EVIDENCE of COR. Set man. BOX around old location of 1/2" IRON + Set Remov B+C # 47969.

Witnesses:

Fd. NAT # 28409 IN W. FACE 24" OAK S 55° E, 54.60'

Fd. NAT (unmarked) IN N. FACE, 40" TWIN HICKORY S 80° W, 33.53'


Fd. NAT # 28409 IN N. FACE 36" MAPLE N 75° W, 28.72'

Set NAT # 31603 IN NW. FACE 10" MAPLE N 30° E, 46.09'

JV BV

3-3-05

(26)

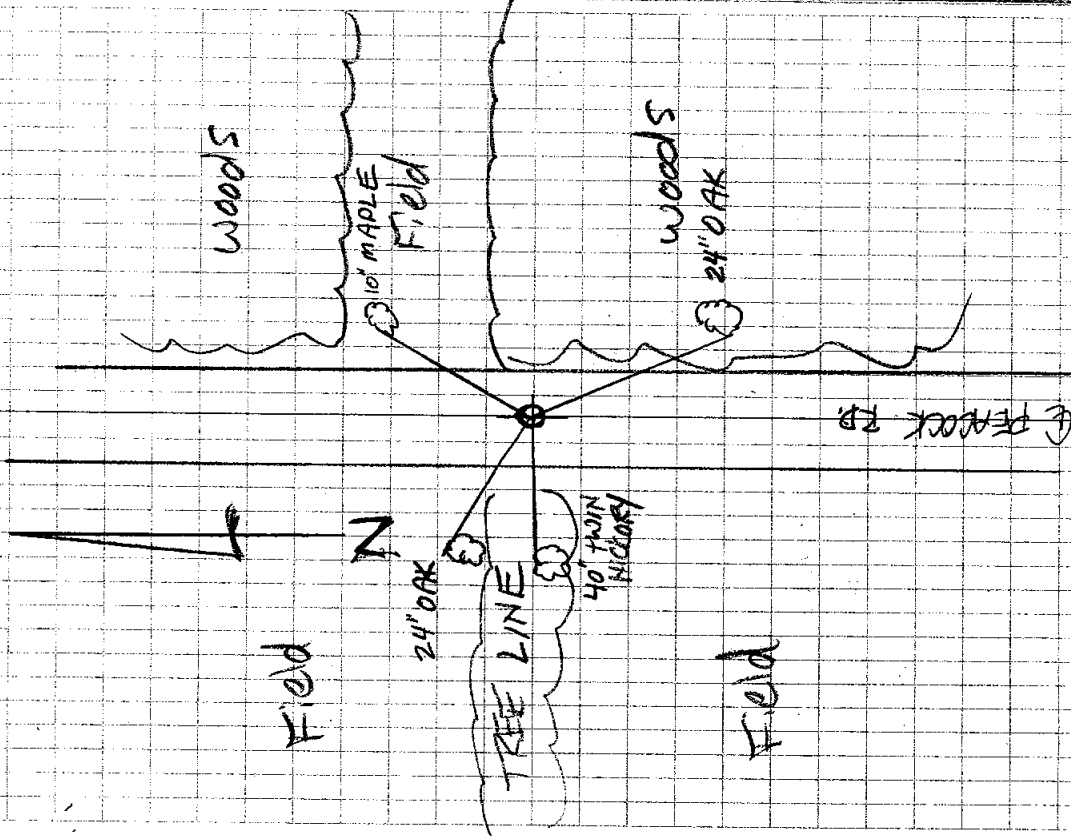

Leslie TNSD T1N R1W
 Sec. 35 SE cor. K-13

Found 1" iron in 2' of N
 brand lane, Peacock Rd.

Found E 33' I 40" 18657

Found E 4' of 2" 8' 401

Found post 17.35'

Found S 85 W, Acetate 14T

33.15' in S side dead 8" Walnut

Found N 4 T, 545 W, in SE

face of 10" Walnut.

Set N 4 T 4 816.03 in SE side

of 11" Walnut, N 10 E, 36.80

1" IRON MATCHES WITNESSES.

REMOVED 1" BAR, DUG THROUGH 4" OF

ASPHALT, FOLLOWED BY GRAVEL. AT 8' DEEP

W/TH GRAVEL, FOUND & REMOVED 2' x 2" 8' 401

3-8-05 ROTTED WOOD STAKE. 12" BELOW ASPHALT A

6' x 8" STONE WAS FOUND & REMOVED. CLAY

& GRAVEL MIX TO 2.5' BELOW ASPHALT.

SET MON BOX;

SET 3/4" x 24" BAR WITH REMOVED ONE #47969


IN MON BOX

12-16-05 K-Box Rues tw. to K-13 Leslie tw. = 1345'

5' EAST, 59.05' to S. side 12" Hickory

BS clear 30' 3-4-05

(27)

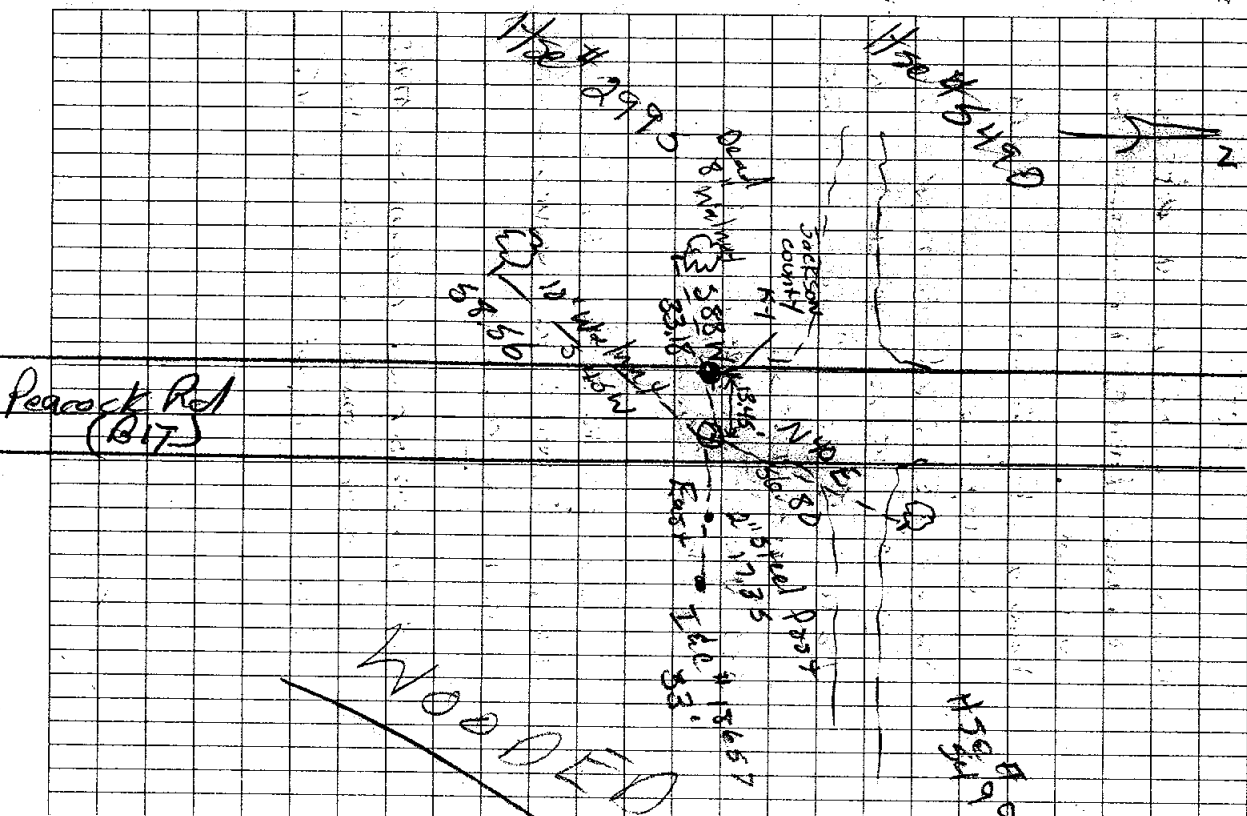

Leslie Trp.

L-11

Fd. 1/2" IRON IN MON. BOX

Oldest REMAINING WITNESS TO 36"
HICKORY MEASURED WELL. REMOVED
IRON and just below was a large
Rack. Removed MON. BOX + large
Rack and continued EXC. Fd. NO
FURTHER EVIDENCE OF COR. BELOW.
Held location of 1/2" IRON +
Reset MON. BOX w/ REMON BAC
#47969.

WITNESSES:

Fd. NAT #25832 IN E. FACE 36" ~~HICKORY~~
HICKORY
N 30° E, 71.61'

Fd. NAT #25832 IN NE. FACE 6" BIRCH
S 30° E, 69.02'


Set NAT #31603 IN SE. FACE 18" MAPLE
N 50° E, 55.13'

Set NAT #31603 about REMAINS
of old witness NAIL + RIBBON
IN SE FACE 8" maple
S 45° W, 49.65'

SV BV

3-2-05

(24)

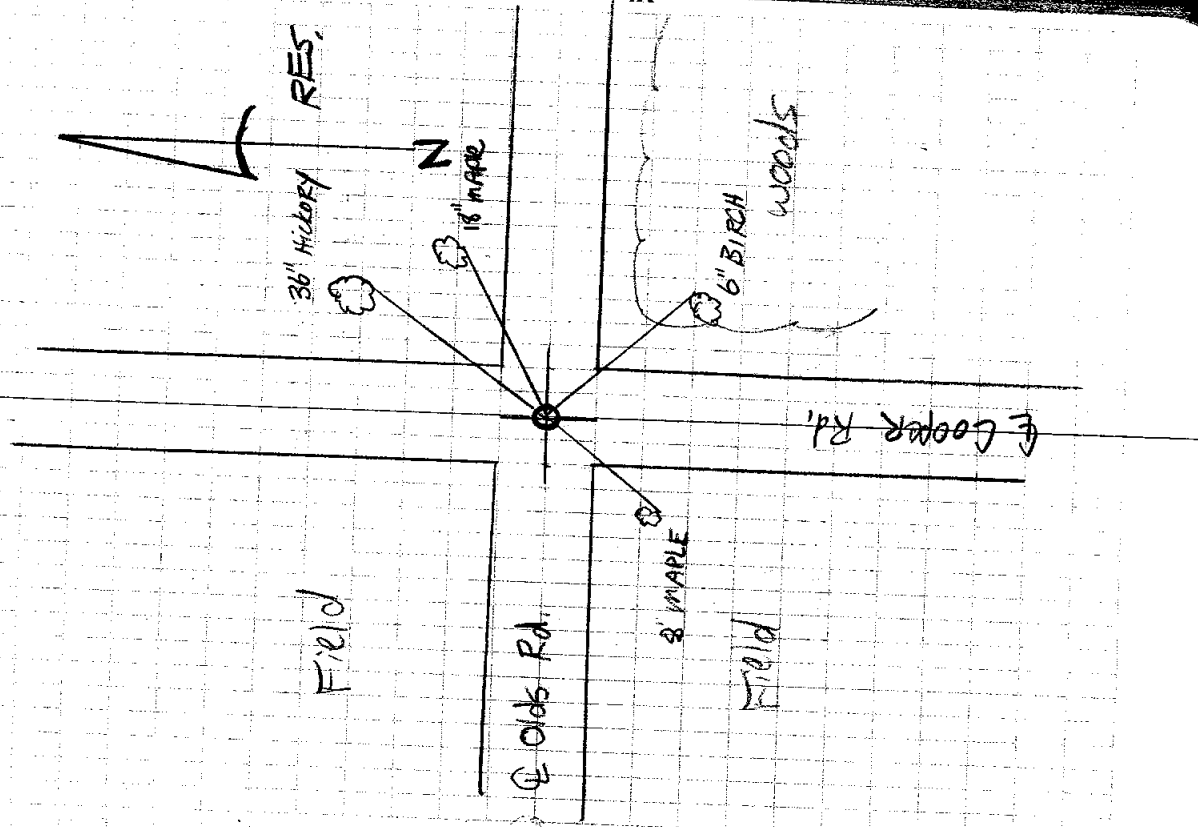


JV
BV

(22)

3-2-05

Leslie Twp, L-12
 Fd. 110' long 1/2" Rod. in Mon.
 Box 2.5' ± E. of West Edge of
 Asphalt. Fd. NAIL + Ribbon in
 N. side of 40" OAK From previous
 witnesses that measured well
 Also Found old witnesses to SE,
 maple + SW CHERRY with NO
 witness tags But distances hit
 E of TREES, Removed 1/2" IRON
 from mon. Box + cont. EXCAVATION
 Fd. NO FURTHER EVIDENCE of COR.
 Below 1/2" IRON, set REMON BAL
 #47969 IN PLACE of IRON.
 Witnesses:
 Set NAT #31603 IN N. FACE 40"
 OAK (old NAT grown over)
 N 45° E, 55.76'
 Set NAT #31603 IN NE. FACE 14"
 MAPLE
 S 45° E, 42.30'
 Set NAT #31603 IN S. FACE 14" OAK
 N 85° W, 23.45'
 Set NAT #31603 IN E. FACE 14" CHERRY
 S 60° W, 46.22'

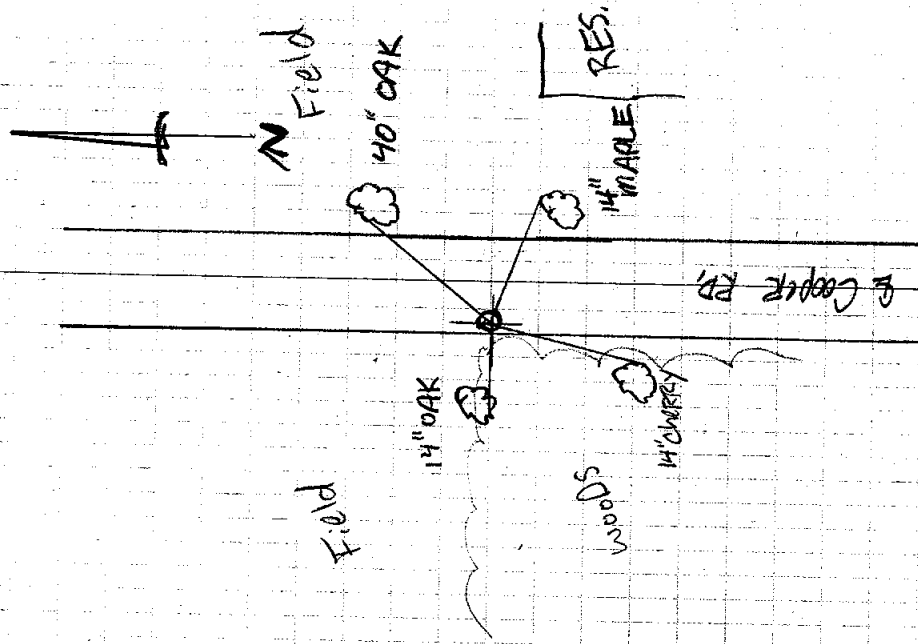

Leslie Twp. 4-13

Fd. 8 pole BARN NAIL IN MON.

BOX, Previous witness to 40"

OAK matched the Q of OAK, NO

Evidence of NAT, Removed 8"

NAIL TO Find 1/2" Pinch Pipe 18" Long.

Below NAIL. ~~Set 6" of CLAY Below~~

~~Asphalt~~ Fd. 1.5' of GRAVEL THEN

6" of Clay with sand Below.

Fd. NO FURTHER EVIDENCE Below

Pinch Pipe, Set REMON BTC #31603

in place of Pinch Pipe. 479.9

WITNESSES:

Set NAT #31603 IN N.FACE 40" OAK

S 85° E, 25.51'

Set NAT #31603 IN ESE FACE, 30" MAPLE

S 40° W, 65.37'

NW. COR. of RES. #5505 Foundation

S 50° E, 70.21'

Set NAT #31603 IN SW FACE 12" ELM.

N 45° W, 51.51'

Set NAT #31603 IN NW FACE 10" ELM


N 30° E, 46.76'

JV

BV

3-2-05

(23)

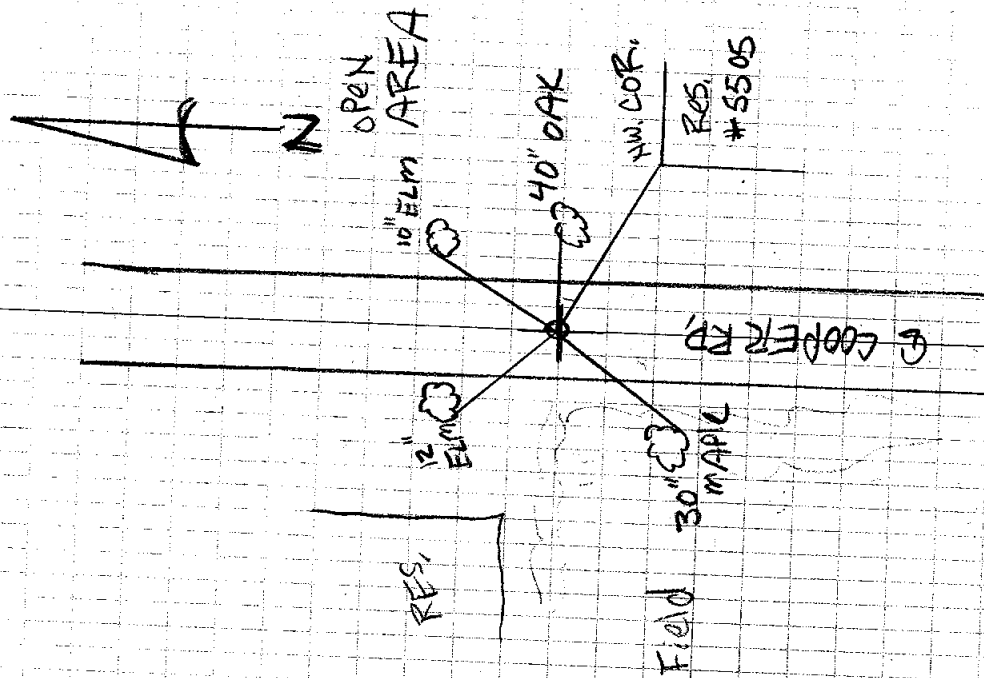

Leslie Twp.
TIN, RIW


E 1/4 cor Sec 36 M-12

ER 7-19-05

Fd Conc. Mon. w/ Rebar in Center @
Intersection of old Fencing. Fd three
witness tags All w/ # 28414, and
Found one spike w/ Remnants of tag (unknown)
* Fd NAT S 45° E 11.34' S.W. FACE 12" ASH
** Fd NAT N 60° E 24.66' S. FACE 34" Hickory
Fd NAT WEST 24.91' S. FACE 8" Hickory
Fd spike S 30° W 19.15' S.E. FACE 8" ASH

* Just below this tag is a spike that
matches southerly witnessed spike
** Just above this tag is also a spike that
matches southerly witnessed spike

SET REMON CAP ON REBAR

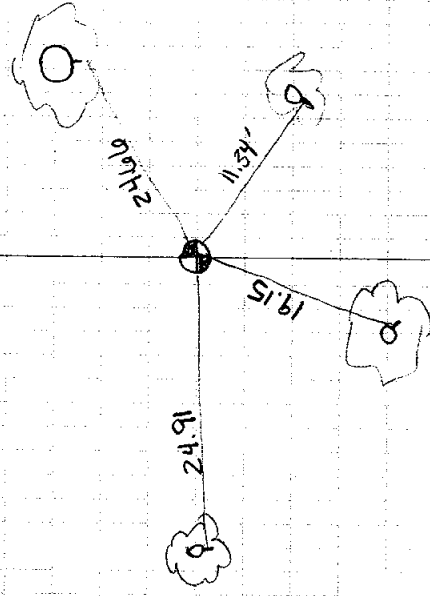

LESLIE Twp. T1N-R1W. M-13

FD. 2' Dia. Brass cap set in center of 20' Dia. concrete slab.

! FD. conc. mon., 12" Dia., 18" high N., 50.00'

! set re-mon nail 1/2" peg in S. side of 12" oakwood S. 75° W. 10.95'

! set re-mon nail 1/2" peg in E. side of 10" elm, N. 40° W. 23.20'

! set re-mon nail 1/2" peg in N. side 8" ash, S. 70° E. 20.97'

! set re-mon nail 1/2" peg in SE side of 6" elm, N. 20° E. 17.60'

Sunny, 84°
5-29-07

JJS BV

(38)

