

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY

(County)

LOCKE TOWNSHIP

1. Public Land Survey

Located In:

Corner Code #

T 4N R 2E

K-5

T R

T R

T R

T R

2. Property Controlling
in Section

S

T R

S

3. Miscellaneous
Property in Sec.

S

T R

Paula Johnson

INGHAM COUNTY

REGISTER OF DEEDS

ENGINEER SURVEYING & ENGINEERING

RECORDED

CRNR 9.00

L-10 P-162

2001-060955

2001-060955

Page: 1 of 1

11/14/2001 08:42A

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on OCTOBER 25, 2001 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826; WILLOW 4", S44W, 4; ELM 7", N32W, 60.

2. JOHN MCCREARY, COUNTY SURVEYOR, RECORDED CORNER IN INGHAM COUNTY SURVEYORS RECORDS IN VOLUME 4, PAGES 28 & 29 IN OCTOBER, 1899 AS A GAS PIPE: ELM 28 N77½W 9½

3. CLYDE K. STEPHENS, RLS 3829, RECORDED CORNER UNDER ACT 74 IN LIBER 1 PAGE 105 IN AUG., 1971 AND USED IT IN AN ACT 132 SURVEY RECORDED IN LIBER 1 PAGE 52 IN JUNE 1971 AS A FOUND BOAT SPIKE: SE CORNER OF A 1 STORY FRAME HOUSE N59°23'W, 152.8'; STEPHENS ENGINEERING TAG IN A 30 INCH ASH S83°46'W, 222.90'; STEPHENS TAG IN A 30 INCH OAK S15°12'E, 189.20', HASLETT ROAD HAVING A BEARING OF WEST.

4. OSCAR BOSS, RLS 13574, RECORDED CORNER UNDER ACT 74 IN LIBER 3 PAGE 85 IN APRIL 1974: AS 3/8" FOUND IRON WITH THE FOLLOWING WITNESSES: N53°E, 41.8' SOUTH WEST CORNER CEMENT GATE POST; S84°W, 223.31' NAIL FOUND NORTH SIDE 36" HICKORY; S12°E, 189.31' BOLT FOUND WEST SIDE 40" ASH. HE USED THE CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 1 PAGE 488 & 489 IN OCTOBER, 1972 WITH THE SAME WITNESSES.

5. KAY DON FLUKE, RLS # 18988, RECORDED CORNER UNDER ACT 74 IN LIBER 4 PAGE 159 IN MAR. 1978 AND USED IT IN AN ACT 132 SURVEY RECORDED IN LIBER 3 PAGE 227 IN FEB. 1978 AS A FOUND BOAT SPIKE REPLACED WITH 1/2" BAR AND CAP WITH STEPHENS HOUSE AND OAK WITNESSES AND A WITNESS TO THE SW COR. OF A CONC. GATE POST, N55°E, 41.79'

5. LARRY A. BRYAN, RLS 25832, USED THE CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 5 PAGE 534 & 535 IN OCTOBER, 1988 WITH THE FOLLOWING WITNESSES: FOUND 3/4" BAR IN CENTERLINE OF MORRICE & HASLETT RDS. ON FENCE EAST; SOUTHWEST CORNER CONCRETE HEADWALL, N60°E, 41.90'; SOUTHEAST CORNER HOUSE, N60°W, 152.68'; SET NAIL & TAG NORTHWEST SIDE FENCE POST, S45°W, 53.65'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 1/2" BAR AT INTERSECTION OF CENTERLINES OF MORRICE AND HASLETT ROADS. DISTANCE ALONG SECTION LINE TO WEST INDICATES CORNER SHOULD BE ABOUT 5' WEST BASED ON MCCREARY'S 1899 SURVEY. SEARCHED WITH MAGNETIC LOCATOR AND GOT GOOD READING ABOUT 5' WEST. EXCAVATED 2' DIAMETER HOLE 3' DEEP. FOUND 1" GAS PIPE AS CALLED FOR BY MCCREARY. ACCEPTED GAS PIPE AS PERPETUATION OF CORNER AND RAISED TO SURFACE WITH STANDARD BAR & CAP. MEASURED WEST 2624.0' TO J-5. MEASURED WEST 1312' TO MCCREARY'S GAS PIPE AT 1/8 CORNER. MEASURED EAST 2651.4' TO L-5. MEASURED SOUTH 2625.2' TO K-6.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E K-5

3/4" X 24" STEEL BAR WITH 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837

NW CORNER CONCRETE FENCE POST

NAIL & TAG (CLYDE STEPHENS) WEST SIDE 36" WALNUT

NAIL & TAG 25837 NORTH SIDE CORNER FENCE POST

NAIL & TAG 25837 SOUTH SIDE 26" MAPLE

1/2" BAR (PROPERTY CONTROLLING CORNER)

SE CORNER HOUSE FOUNDATION

N55°E 45.72'


S12°E 192.02'

S58°W 50.62'

N67°W 105.02'

S66°E 4.80'

N59°W 147.80'

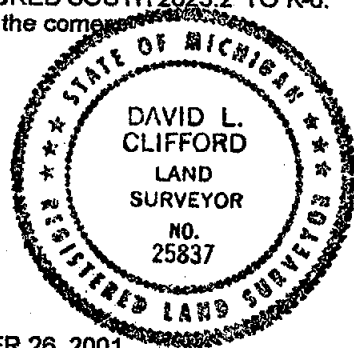

Signed by David L. Clifford

Surveyor's Michigan License No. 25837

Date OCTOBER 26, 2001

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN, 1983

REVISED OCT., 1995

P.A. 345 INGHAM COUNTY

PEER APPROVED 10/30/2001 RL

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY
(County)

Located In:

Corner Code #

LOCKE TOWNSHIP
1. Public Land Survey

T 4N R 2E

L-5

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS
ENGINEER SURVEYING & ENGINEERING

L-10 P-167

RECORDED CRNR 9.00 2001-060960



2001-060960
Page: 1 of 1
11/14/2001 08:42A

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on OCTOBER 24, 2001 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826: WHITE OAK 16, S4E, 16 1/2; WHITE OAK 11, N53E, 18.
2. WILLIAM H. RAYNER, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOLUME 1 PAGE 19, INGHAM COUNTY SURVEYOR RECORDS ON NOVEMBER 1, 1854 WITH NO MENTION OF MONUMENT AND THE FOLLOWING WITNESSES: WHITE OAK 16, S40E, 16 1/2; WHITE OAK 20, S45°50'E, 97.
3. OSCAR BOSS, RLS 13574, RECORDED CORNER UNDER ACT 74 IN LIBER 3 PAGE 85 ON APRIL 25, 1974 AND USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 1 PAGE 488 & 489 ON NOVEMBER 28, 1972 AS A 3/8" IRON SET ON FENCE INTERSECTION TO EAST WITH THE FOLLOWING WITNESSES: NAIL, EAST SIDE 18" DEAD TREE, SOUTH, 29.93'; NAIL, NORTHEAST SIDE 12" TREE, S10°W, 26.68'; NAIL, WEST SIDE FENCE POST, S56°E, 3.33'.
4. LARRY A. BRYAN, RLS 25832, USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 5 PAGE 534 & 535 ON NOVEMBER 15, 1988 AS A FOUND 1/2" REBAR WITH THE FOLLOWING WITNESSES: SET NAIL & TAG, EAST SIDE 6" ASH, NORTH 9.9'; SET NAIL & TAG, WEST SIDE 12" TRICHERRY, S10°W, 48.80'; SET NAIL & TAG, EAST SIDE 12" CHERRY, S25°W, 26.80'.
5. D. HUGHES, PS 19834, USED CORNER IN A N ACT 132 SURVEY IN JUNE 1999 AS A FOUND 1/2" BAR & CAP #13574 AT NORTH SIDE FENCE CORNER. HUGHES ALSO FOUND A 1/2" BAR ON THE SOUTH SIDE OF FENCE POST AND USED THE NORTH BAR & CAP AS IT WAS THE RECORDED CORNER: NAIL & TAG EAST SIDE 4" CHERRY, 004°, 3.15'; NAIL & TAG SOUTH SIDE 4" ASH, 101°, 6.76'; NAIL & TAG EAST SIDE 24" CHERRY, 203°, 26.94'; NAIL & TAG NORTH SIDE 10" ASH, 264°, 22.07'.
5. RON ENGER, PS 28409, USED CORNER IN A SURVEY IN APRIL, 2001 WITH NO MENTION OF MONUMENT OR WITNESSES.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT THE APPARENT LOCATION OF CORNER REVEALED A 1/2" BAR AT SOUTH SIDE ANCIENT FENCE CORNER FROM EAST AND A 1/2" BAR AND CAP #13574 ON NORTH SIDE OF SAME POST 15' NORTH OF ANOTHER FENCE CORNER FROM WEST. TRAVERSE OF SECTION 13 REVEALED NORTHERLY FENCE CORNER AND NORTHERLY BAR & CAP TO BE VERY CLOSE TO 1/2 WAY AND ON STRAIGHT LINE BETWEEN SECTION CORNERS. FROM WITNESSES IT WAS DETERMINED THAT NORTHERLY BAR & CAP WAS RECORDED POSITION FOR CORNER. ACCEPTED NORTHERLY BAR & CAP AS PERPETUATION OF CORNER AND REPLACED IT WITH STANDARD BAR AND CAP. MEASURED 2651.4' WEST TO K-5. MEASURED 2652.49' EAST TO M-5. MEASURED SOUTH 2635.25' TO L-6.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E L-5

3/4" X 24" STEEL BAR WITH 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837
NAIL & TAG 19834 (DARREL HUGHES) EAST SIDE 5" CHERRY N20°E 3.15'
NAIL & TAG 25837 WEST SIDE 9" ASH N25°E 9.16'
NAIL & TAG 19834 EAST SIDE 20" CHERRY S10°W 48.95'
NAIL & TAG 25837 WEST SIDE 19" CHERRY S20°W 26.95'
NAIL & TAG 25837 SOUTH SIDE 7" OAK S70°W 48.30'
1/2" BAR SOUTH 1.0'

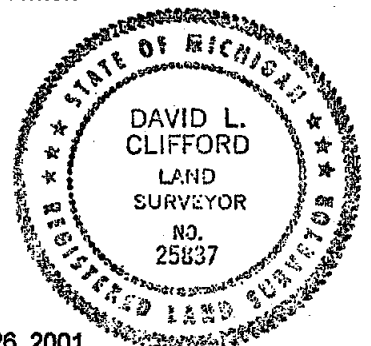

Signed by David L. Clifford

Date OCTOBER 26, 2001

Surveyor's Michigan License No. 25837

P.A. 345 INGHAM COUNTY
DEED APPROVED 10/30/2001

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY Located In: Corner Code #
(County)
LOCKE TOWNSHIP
1. Public Land Survey T 4N R 2E M-5
T R
T R
T R
2. Property Controlling S T R
in Section T R
3. Miscellaneous S T R
Property in Sec. S T R

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS RECORDED
ENGER SURVEYING & ENGINEERING CRNR 9.00

L-10 P-174

2001-060967



2001-060967

Page: 1 of 1

11/14/2001 08:42A

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on OCTOBER 25, 2001 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826; LYNN 8, S14W, 22; BEECH 13, N33W, 50.
2. CLAY W. GORDON, LIVINGSTON COUNTY SURVEYOR, PERFORMED A SURVEY ON THE NE 1/4 OF THE NE 1/4 OF SECTION 13, T4N R2E, ON OCT. 11, 1947. GORDON DID NOT MENTION MONUMENT OR WITNESSES BUT HE DOES SHOW A DISTANCE ON THE NORTH 1/2 OF THE NORTH 1/2 OF THE EAST SECTION LINE OF 1322 FEET.
3. FRED N. WHITE, RLS 12034, RECORDED CORNER UNDER ACT 74 IN LIBER 4 PAGE 310 ON AUGUST 29, 1978 AS FOUND 5/8" REBAR 6" BELOW GRAVEL SURFACE ON FENCE LINE RUNNING WESTERLY WITH THE FOLLOWING WITNESSES: NAIL & TAG, SE SIDE POWER POLE, N10°W, 143.78'; CENTERLINE ROAD SIGN POST, S88°W, 16.68'; TOP & CENTERLINE ANGLE IRON, S45°E, 71.40'
4. RONNIE M. LESTER RECORDED CORNER UNDER ACT 74 IN LIBER 5 PAGE 165 ON JANUARY 22, 1979 AS SET 4" X 36" CONCRETE MONUMENT WITH 1/2" X 38" REROD AND CAP #18998 SET IN PLACE OF A 1.2' X 9' STONE AND RED BRICK FOUND IN A 4' X 5.5' X 2.5' EXCAVATION: TOP CENTERLINE BURIED CABLE BOX, WEST, 32.03'; NAIL & TAG, #18998, EAST SIDE POWER POLE, NNW, 143.90'; TOP CENTER ANGLE IRON POST, ESE, 71.35'; NE CORNER TIN POLE BARN, 1.0' ABOVE GROUND LEVEL, WNW, 267.07'; CONCRETE MONUMENT AT APPARENT LOCATION OF A-5, CONWAY TWP., LIVINGSTON COUNTY, T4N, R3E, SOUTH, 7.84'.
5. RON HELSEL, RLS 18994, USED CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 1 PAGE 1107 & 1108 AND RE-RECORDED IN LIBER 2 PAGE 3 & 4 ON FEBRUARY 8, 1974 WITH NO MENTION OF MONUMENT OR WITNESSES. HELSEL MEASURED SOUTH 2644.77 FEET TO M-6.
6. RON ENGER, PS #28409 USED CORNER IN AN ACT 132 SURVEY IN APRIL 2001 AS A 1/2" BAR IN CONC. MON. MATCHING ALL OF LESTER'S WITNESSES.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 1/2" BAR IN A CONCRETE MONUMENT 1.5' WEST OF CENTERLINE HARRINGTON ROAD MATCHING ALL OF LESTER'S WITNESSES. ACCEPTED ABOVE DESCRIBED MONUMENTATION AS PERPETUATION OF CORNER AND CAPPED IT WITH 2 1/4" ALUMINUM CAP AND SET MONUMENT BOX. MEASURED SOUTH 2644.76' TO M-6. MEASURED WEST 2652.49' TO L-5.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E M-5
1/2" BAR IN CONCRETE MONUMENT & 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837 IN MONUMENT BOX
SOUTH EDGE STOP SIGN POST AT GROUND N75°E 63.45'
NORTH EDGE STEEL POST AT GROUND S75°E 71.45'
EAST FACE 4" STEEL PIPE FENCE POST WEST 21.50'
5/8" BAR & CAP #28409 WEST 33.0'
NAIL & TAG 18998 NORTH SIDE UTILITY POLE N10°W 143.75'
1/2" BAR IN CONCRETE MONUMENT (A5, T4NR3E) S5°E 7.85'

P.A. 345 INGHAM COUNTY
PEER APPROVED 10/30/2001 *mc*

Signed by *David L. Clifford*
Surveyor's Michigan License No. 25837

Date OCTOBER 26, 2001

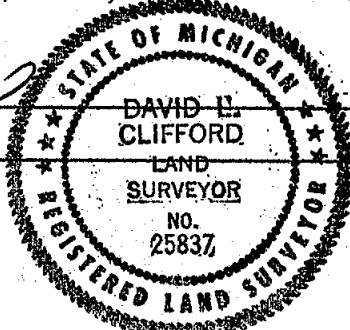

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY

(County)

LOCKE TOWNSHIP

1. Public Land Survey

Located In:

Corner Code #

T 4N R 2E

I-3

T R

T R

T R

T R

2. Property Controlling
in Section

S

T R

3. Miscellaneous
Property in Sec.

S

T R

S

T R

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS
ENGINEER SURVEYING & ENGINEERING

RECORDED

L-10 P-353

CRNR 9.00

2002-079372



2002-079372

Page: 1 of 1

12/05/2002 03:19P

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on JULY 10, 2002 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826; BO 18", S35W, 16; ASH 10", N29W, 31.

2. A. JACKSON, COUNTY SURVEYOR, USED CORNER IN SURVEYS RECORDED IN VOL.1 PAGE 263 IN OCT. 1851 AND VOL. 1 PAGE 341 IN FEB. 1854 WITH NO MENTION OF MONUMENT AND SAME WITNESSES AS GLO.

3. J. H. MULLETT, COUNTY SURVEYOR, HAS A MARGINAL NOTE IN THE GLO NOTES FOR THIS CORNER DATED JUNE 16, 1887: "TREES GONE, STUMPS STANDING, SET OLD SLAY SHOE FOR CORNER WITH STONES & POTTERY."

4. JOHN MCCREARY, COUNTY SURVEYOR, RECORDED CORNER IN INGHAM COUNTY SURVEYORS RECORDS IN VOLUME 3, PAGE 212 IN OCTOBER, 1899 AS A STONE & IRON: SUGAR 14 S5W 39½

5. E.A. CALKINS, COUNTY SURVEYOR USED CORNER IN A SURVEY RECORDED IN VOL. 5 PAGE 10 IN APRIL 1900 AS A IRON SLEIGH SHOE SET FLUSH WITH SURFACE OF GROUND WITH STONE AROUND: SUGAR 6", N2°W, 20-2/3. CALKINS PURPOSE FOR DOING SURVEY WAS TO VERIFY THE LOCATION OF THE NORTH 1/4 CORNER OF SECTION 11 AS USED IN MCCREARY'S 1899 SURVEY.

6. R.M. LESTER, RLS 18998, RECORDED CORNER UNDER ACT 74 IN LIBER 5 PAGE 122 IN JANUARY 1979 DURING THE INGHAM COUNTY REMONUMENTATION PROGRAM OF THE LATE 1970'S: AS A 36" X 4" CONCRETE MONUMENT WITH 1/2" BAR & CAP REPLACING A FOUND 1/2"X1"X12" IRON (IN OTHER WORDS A SLEIGH SHOE) UNDER A LARGE STONE IN A 3'X3'X3' EXCAVATION. NAIL & TAG 18998, NORTH SIDE 20" MAPLE; EAST, 59.31'; NAIL & TAG 18998 IN NORTH SIDE 8" WILD CHERRY; ESE, 39.65'; NAIL & TAG 18998 SOUTH SIDE ASH CLUSTER, NE, 37.24'; FOUND BENCH MARK TAG, SOUTH SIDE 5" SQUARE WOODEN FENCE POST, NORTH, 24.62'.

7. LARRY A. BRYAN, RLS 25832, USED THE CORNER IN ACT 132 SURVEYS RECORDED IN LIBER 6 PAGE 89 IN JUNE, 1989 AND LIBER 7 PAGE 317 IN JUNE 1986: FOUND 1/2" BAR IN CONCRETE IN CENTERLINE OF COLBY ON OCCUPATION LINE NORTH & SOUTH: FOUND NAIL & TAG #18998, SOUTH SIDE 8" BASSWOOD CLUMP, N80°E, 37.23'; SET NAIL & TAG NORTH SIDE 20" MAPLE, S80°E, 59.10'; FOUND NAIL & TAG SW SIDE WOOD ANCHOR POST, NORTH, 24.69'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 1/2" BAR IN 4" CONCRETE MONUMENT IN THE CENTERLINE OF COLBY ROAD ON OCCUPATION LINE TO NORTH & SOUTH. ACCEPTED MONUMENT AS PERPETUATION OF CORNER BASED ON PREVIOUS EXCAVATION AND AGREEMENT WITH CALKINS MEASUREMENTS OF 1900. CAPPED MONUMENT WITH STANDARD ALUMINUM CAP. MEASURED EAST 2634.81' (MCCREARY MEASURED 2640') (CALKINS MEASURED 2635.71').

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E I-3

4" CONCRETE MONUMENT WITH 1/2" BAR & 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837

SET NAIL & TAG 28409 (R. ENGER) SOUTH SIDE 6" QUAD MAPLE N85°E 86.78'

SET NAIL & TAG 28409 NORTH SIDE 21" MAPLE S85°E 59.32'

NW CORNER CONCRETE CORNER POST S04°E 31.82'

SET NAIL & TAG 28409 NORTH SIDE RR TIE FENCE POST N70°W 64.25'

SET NAIL & TAG 28409 WEST SIDE 8" OAK N11°W 64.25'

Signed by David L. Clifford

Surveyor's Michigan License No. 25837


Date OCTOBER 26, 2001

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS JAN 22, 1971

P.A. 345 INGHAM COUNTY

PEER APPROVED: 9/24/2002 ML

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

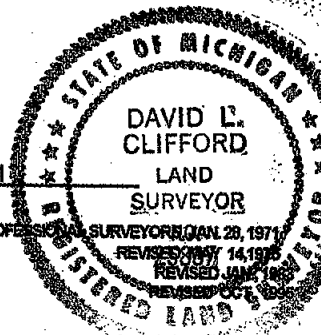

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY

Located In:

Corner Code #

(County)

LOCKE TOWNSHIP

1. Public Land Survey

T 4N R 2E

J-3

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS
ENGINEER SURVEYING & ENGINEERING

RECORDED
CRNR 9.00

L-10 P-354

2002-079373



2002-079373
Page: 1 of 1
12/05/2002 03:19P

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on JULY 10, 2002 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826; CHERRY 16", S12W, 21; WO 17", N43W, 32.

2. A. JACKSON, COUNTY SURVEYOR, USED CORNER IN SURVEYS RECORDED IN VOL. 1 PAGE 263 IN OCT. 1851 AND VOL. 1 PAGE 341 IN FEB. 1854 WITH NO MENTION OF MONUMENT AND SAME WITNESSES AS GLO.

3. JOHN MCCREARY, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOLUME 3, PAGE 212 IN OCTOBER, 1899 AS A STONE: BUTTERNUT, 6, S27-3/4W, 54.

4. E.A. CALKINS, COUNTY SURVEYOR USED CORNER IN A SURVEY RECORDED IN VOL. 5 PAGE 10 IN APRIL 1900 AS A GAS PIPE SURROUNDED BY STONES: BUTTERNUT 6", S27°W, 54½. CALKINS PURPOSE FOR DOING SURVEY WAS TO VERIFY THE LOCATION OF THE NORTH 1/4 CORNER OF SECTION 11 AS USED IN MCCREARY'S 1899 SURVEY. HE RECITES A NARRATIVE OF FINDING MCCREARY'S STONE AND VARIIFYING IT BY TESTIMONY OF WITNESSES TO LOUIS PRESTON, FORMER COUNTY SURVEYOR, FINDING THE ORIGINAL STAKE AND REPLACING IT WITH SAID STONE DURING A SURVEY PERFORMED IN 1876.

5. R.M. LESTER, RLS 18998, RECORDED CORNER UNDER ACT 74 IN LIBER 5 PAGE 81 IN NOVEMBER 1978 DURING THE INGHAM COUNTY REMONUMENTATION PROGRAM OF THE LATE 1970'S AS A 38" X 4" CONCRETE MONUMENT WITH 1/2" BAR & CAP REPLACING A FOUND GAS PIPE SURROUNDED BY STONES IN A 3'X3'X3' EXCAVATION. NAIL & TAG 18998, EAST SIDE 8" ASH; NORTH, 31.40'; NAIL & TAG 18998 EAST SIDE 10" PINE; NORTH, 95.96'; NAIL & TAG 18998 NORTH SIDE 8" TWIN POPLAR, WEST, 138.51'; SW CORNER ENTRANCE WAY, SOUTH SIDE OF HOUSE AT BLOCK FOUNDATION, NW, 70.80'.

6. LARRY A. BRYAN, RLS 25832, USED THE CORNER IN ACT 132 SURVEYS RECORDED IN LIBER 6 PAGE 89 IN JUNE, 1989, LIBER 6 PAGE 392 IN JUNE 1988 AND LIBER 7 PAGE 317 IN JUNE 1986: FOUND 1/2" BAR IN CONCRETE IN CENTERLINE OF COLBY ROAD & COREY ROAD EXTENDED; SOUTHWEST CORNER ENTRANCE WAY, SOUTH SIDE OF HOUSE AT BLOCK FOUNDATION, N60°W, 70.69'; NORTHWEST CORNER CONCRETE ANCHOR POST, S45°W, 39.15'; FOUND NAIL & TAG 18998 NORTH SIDE 10" TWIN POPLAR, N80°W, 138.35'; SET NAIL & TAG EAST SIDE 10" ELM, NORTH 31.21'.

7. MARK VANRAEMDONCK, RLS 24622, USED THE CORNER IN ACT 132 SURVEYS RECORDED IN LIBER 7 PAGE 593 IN APRIL, 1995 AND LIBER 8 PAGE 386 IN OCT. 1998: FOUND 1/2" BAR IN CONCRETE; STOP SIGN POST, N60°W, 36.62'; NE CORNER CONCRETE ANCHOR POST, S35°W, 38.75'; NAIL & TAG SE FACE WOOD POST FOR TELE. PED., N60°E, 55.50'; FDN. NAIL & TAG 25832 EAST SIDE 18" ELM, NORTH 31.07'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 1/2" BAR IN 4" CONCRETE MONUMENT AT INTERSECTION OF CENTERLINE OF COLBY ROAD AND EXTENDED CENTERLINES OF COREY ROAD TO SOUTH AND NORTHEAST. ACCEPTED MONUMENT AS PERPETUATION OF CORNER BASED ON PREVIOUS EXCAVATION AND AGREEMENT WITH CALKINS MEASUREMENTS OF 1900. CAPPED MONUMENT WITH STANDARD ALUMINUM MONUMENT AND SET MONUMENT BOX. MEASURED WEST 2634.81' (MCCREARY MEASURED 2640') (CALKINS MEASURED 2635.71'). MEASURED EAST 2643.31' (MCCREARY MEASURED 2647.26') (CALKINS MEASURED 2644.95')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E J-3

4" CONCRETE MONUMENT & 1/2" BAR WITH 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25832

SET NAIL & TAG 28409 (R. ENGER) EAST SIDE TWIN 12" CHERRY N10°E 62.92'

SET NAIL & TAG 28409 EAST SIDE 12" PINE N15°E 91.83'

SET NAIL & TAG 28409 SOUTH SIDE UTIL. POLE N80°E 61.19'

SET NAIL & TAG 28409 SOUTH SIDE UTIL. POLE S53°E 67.85'


NE CORNER CONCRETE FENCE POST S40°W 38.70'

SE CORNER HOUSE FOUNDATION N20°W 63.80'

Signed by David Clifford

Surveyor's Michigan License No. 25837

Date SEPTEMBER 21, 2002

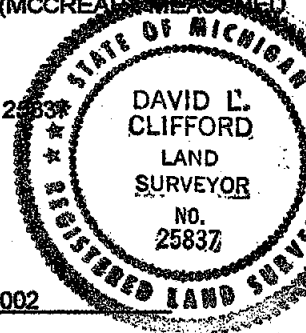

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/24/2002 MC

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY Located In: Corner Code #
(County)
LOCKE TOWNSHIP
1. Public Land Survey T4N R2E K-3
T R
T R
T R
2. Property Controlling S T R
in Section T R
S T R
3. Miscellaneous T R
Property in Sec. S T R

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS
ENGINEER SURVEYING & ENGINEERING

RECORDED
CRNR 11.00

L-10 P-342

2002-079362

2002-079362
Page: 1 of 2
12/05/2002 03:19P

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on JULY 10, 2002 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826; WO 16", S53½°W, 16; ASH 5", N43W, 26.
2. T. J. BROWN, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOL.2 PAGE 342 IN JULY 1858 WITH NO MENTION OF MONUMENT: WO 12 N63½°E, 46; WO 16 S53½°, 16.
3. W. H. RAYNER, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOL.2 PAGE 342 IN JULY 1858 WITH NO MENTION OF MONUMENT: "NO BEARING TREES AT ALL"
3. JOHN MCCREARY, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOLUME 3, PAGE 212 IN OCTOBER, 1899 AS A STONE & IRON: SUGAR, 6, N2W, 20-2/3.
4. E.A. CALKINS, COUNTY SURVEYOR USED CORNER IN A SURVEY RECORDED IN VOL. 5 PAGE 10 IN APRIL 1900 AS A STAKE DRIVEN FLUSH WITH SURFACE: ELM 7", N¼°W, 1.07½; POPLAR 4, S64½°W, 71. CALKINS PURPOSE FOR DOING SURVEY WAS TO VARIIFY THE LOCATION OF THE NORTH 1/4 CORNER OF SECTION 11 AS USED IN MCCREARY'S 1899 SURVEY. HE RECITES A NARRATIVE OF FINDING MCCREARY'S STONE AND VARIIFYING IT BY TESTIMONY OF WITNESSES TO LOUIS PRESTON, FORMER COUNTY SURVEYOR, FINDING THE ORIGINAL STAKE AND REPLACING IT WITH SAID STONE DURING A SURVEY PERFORMED IN 1876.
- 5.R.J. ROBB, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOL. 3 PAGE 221 AS A "FOUND IRON FOR CORNER WITH STONE ON TOP"
6. A.N. BATEMAN, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN MISC. FIELD NOTES, FIELD BOOK 13 IN AUGUST 1920 WITH NO MENTION OF MONUMENT OR WITNESSES.

(CONTINUED ON NEXT PAGE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 1/2" BAR & CAP 25832 4 FOOT SOUTH OF THE CENTERLINE COLBY ROAD ON A FENCELINE TO THE NORTH. EXCAVATED 3 FOOT DIAMETER HOLE 3' DEEP AND FOUND NO FURTHER EVIDENCE OF CORNER. RETRACED CALKINS SURVEY OF 1900 AND FOUND BAR & CAP TO BE IN ALMOST THE EXACT SAME RELATIONSHIP TO CORNERS I-3 & J-3 AS CALKINS FOUND THEM TO BE IN HIS SURVEY. ACCEPTED FOUND MONUMENTATION AS PERPETUATION OF CORNER BASED ON AGREEMENT WITH CALKINS MEASUREMENTS AND REPLACED BAR & CAP WITH STANDARD 3/4" BAR AND ALUMINUM CAP. MEASURED WEST 243.31' TO J-3 (MCCREARY MEASURED 2647.26') (CALKINS MEASURED 2644.95'). MEASURED SOUTH 2643.84' TO K-4 (MCCREARY MEASURED 2649.9') MEASURED NORTH 2643.06' TO K-2 (RAYNER MEASURED 2636.8) (ROBB MEASURED 2640')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E K-3
3/4"X 24" STEEL BAR WITH 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837
FOUND NAIL & TAG 18998 WEST SIDE RR TIE FENCE POST NORTH 25.62'
FOUND NAIL & TAG 24622 EAST SIDE UTIL. POLE N40°E 32.95'
FOUND NAIL & TAG 25832 NORTH SIDE TRIP. 12" OAK S68°E 41.86'
FOUND NAIL & TAG 25832 NORTH SIDE DBL. 14" OAK S45°E 21.48'
FOUND NAIL & TAG 25832 NORTH SIDE 20" COTTON WOOD S77°W 91.40'

Signed by David Clifford
Surveyor's Michigan License No. 25837

Date SEPTEMBER 21, 2002

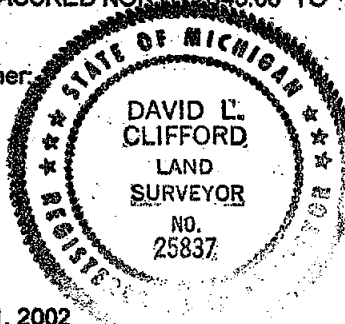

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1974

REVISED MAY 14, 1975
REVISED JAN. 1988
REVISED OCT. 1995

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/24/2002 M

7. THE INGHAM COUNTY REMONUMENTATION PROGRAM OF THE LATE 1970'S EXCAVATED A 4'X6' HOLE 3' DEEP MOSTLY SOUTH OF THE CENTERLINE OF COLBY ROAD ON A FENCE LINE TO THE NORTH IN NOVEMBER 1977. THEY FOUND A 1/2" FLAT BAR 5' SOUTH OF CENTERLINE ON THE FENCE LINE TO THE NORTH. THEY ALSO FOUND THE REMAINS OF A LARGE STUMP TO THE SOUTHWEST THAT COULD HAVE BEEN THE REMAINS OF CALKINS POPLAR WITNESS OF 1900. CALKINS WITNESS DISTANCE FIT THIS STUMP. BAR WAS NEVER VERIFIED AS CORNER PENDING MEASUREMENTS AND A 1/2 BAR WITH INGHAM COUNTY TEMPORARY CAP WAS LEFT IN ITS PLACE.

8. LARRY BRYAN, PS 25832, RECORDED CORNER UNDER ACT 74 IN LIBER 6 PAGE 325 & LIBER 6 PAGE 326 IN APRIL 1987 AND USED IT IN AN ACT 132 SURVEY RECORDED IN LIBER 6 PAGE 391 IN JUNE 1988 AS A FOUND 1/2" BAR AS SET BY INGHAM COUNTY REMONUMENTATION PROJECT OVER A FOUND 1/2" FLAT BAR. IRON WAS VARIFIED BY MEASUREMENTS NORTH, SOUTH, EAST & WEST WHICH AGREED CLOSELY WITH COUNTY SURVEYORS MEASUREMENTS. SET NAIL & TAG WEST SIDE RR TIE FENCE POST, NORTH, 25.52'; SET NAIL & TAG NORTH SIDE 10" TRIP. OAK, S80°E, 41.84'; SET NAIL & TAG, SW SIDE 10" TWIN OAK, S60°E, 21.48'; SET NAIL & TAG NORTH SIDE 14" COTTONWOOD, S80°W, 91.40'

9. MARK VANRAEMDONCK, RLS 24622, USED THE CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 7 PAGE 592 IN MARCH, 1995: AS A FOUND 1/2" REBAR & CAP 25832; ROD & CAP 25832, NORTH, 33.00'; NAIL & TAG SOUTH FACE UTIL. POLE, N35°E, 33.00'; NAIL & TAG NORTH FACE TWIN OAK, S50°E, 21.29'; NAIL & TAG EAST SIDE 6" ASH, S55°W 17.46'. NAIL & TAG WEST FACE RR TIE FENCE POST, NORTH, 25.68'



2002-079362
Page: 2 of 2
12/05/2002 03:19P

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY

(County)

Located In:

Corner Code #

LOCKE TOWNSHIP

1. Public Land Survey

T 4N R 2E

K-4

T R

T R

T R

T R

2. Property Controlling
in Section

S

T R

T R

3. Miscellaneous
Property in Sec.

S

T R

T R

Paula Johnson

INGHAM COUNTY

REGISTER OF DEEDS

REGISTER SURVEYING & ENGINEERING

RECORDED

L-10 P-349

CRNR 9.00

2002-079368



2002-079368

Page: 1 of 1
12/05/2002 03:19P

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on JULY 10, 2002 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826; WO 12", S24½E, 12½; ELM 5", S7½E, 18.

2. JOHN MCCREARY, COUNTY SURVEYOR, RECORDED CORNER IN INGHAM COUNTY SURVEYORS RECORDS IN VOLUME 3, PAGE 212 IN OCTOBER, 1899 AS A STONE: HICK. 10 N15E 198

3. DON FLUKE, RLS 18988, RECORDED CORNER UNDER ACT 74 IN LIBER 4 PAGE 159 IN MARCH 1978 AS A 1/2" BAR & CAP #18988 SET IN PLACE OF A FOUND RUSTED AWAY PIPE OR BAR THAT WAS VERIFIED BY MEASUREMENT TO THE SOUTH: N30°E, 104.72', WOOD FENCE POST; POWER POLE; S25°W, 117.43'; WEST FACE BOTTOM OF CONCRETE CORNER POST, EAST, 51.70'

4. LARRY A. BRYAN, RLS 25832, USED THE CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 6 PAGE 391 IN JUNE, 1988 AS FOUND 1/2" BAR & CAP ON FENCE LINE EAST & ON EXTENDED CENTERLINES OF MORRICE ROAD: FOUND NAIL & TAG, EAST SIDE UTILITY POLE, N10°W, 220.70'; FOUND NAIL & TAG NW SIDE UTILITY POLE, S25°W, 117.43'; 1/2" BAR IN MONUMENT BOX, N45°W, 0.60'

5. AUSTIN WILLIAMS, RLS 21275, USED THE CORNER IN AN ACT 132 SURVEY RECORDED IN LIBER 6 PAGE 349 IN JULY, 1990 WITH NO MENTION OF MONUMENT WITH THE FOLLOWING WITNESSES: W/S CONCRETE POST, EAST, 52.5'; CENTERLINE MORRICE ROAD SIGN, EAST, 18.4'; NAIL & TAG E/S T.P., SSW, 117.40'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 1/2" BAR & CAP ON FENCE LINE TO THE EAST 4' WEST OF WEST EDGE MORRICE ROAD AT PI OF SAID ROAD. ALSO FOUND A 5/8" BAR IN A MONUMENT BOX 0.60' NW. EXCAVATED 3' DIAMETER HOLE 3' DEEP AND FOUND A STONE UNDER FLUKE IRON. ACCEPTED IRON AND STONE AS PERPETUATION OF CORNER AND REPLACED IT WITH STANDARD BAR & ALUMINUM CAP. REMOVED IRON & MONUMENT BOX TO NORTHWEST AND SET MONUMENT BOX OVER CORNER. MEASURED NORTH 2643.84' TO K-3 (MCCREARY MEASURED 2649.9') MEASURED SOUTH 2638.05' TO K-5 (MCCREARY MEASURED 2640.0').

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E K-4

3/4" X 24" STEEL BAR WITH 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837 IN MONUMENT BOX

SET NAIL & TAG 28409 (R. ENGER) NORTH SIDE 6" TRIP. MAPLE N65°E 87.40'

NW CORNER CONCRETE CORNER POST S84°E 51.83'

FOUND NAIL & TAG 18988 NW SIDE UTILITY POLE S36°W 117.55'

FOUND NAIL & TAG 19834 (D. HUGHES) WEST SIDE UTILITY POLE N04°W 43.54'

Signed by D. L. Clifford

Surveyor's Michigan License No. 25837

Date SEPTEMBER 21, 2002


FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN. 1983

REVISED OCT. 1995

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/24/2002 MC

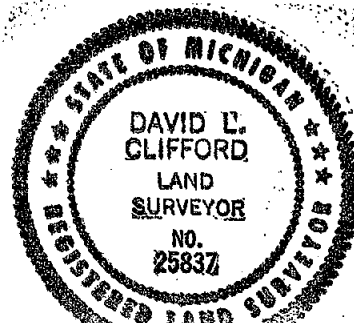

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY

(County)

Located In:

Corner Code #

LOCKE TOWNSHIP

1. Public Land Survey

T 4N R 2E

L-3

2. Property Controlling
in Section

S

T R

3. Miscellaneous
Property in Sec.

S

T R

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS
ENGINEER SURVEYING & ENGINEERING

RECORDED

CRNR 9.00

L-10 P-352

2002-079371



2002-079371

Page: 1 of 1
12/05/2002 03:19P

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on OCT. 14, 2002 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826; ASH 12", S65°W, 448; ASH 17", N84°W, 514½.

2. T. J. BROWN, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOL.2 PAGE 342 IN JULY 1858: "ORIGINAL TREES GONE SET A POST AT AVERAGE DISTANCE BETWEEN THE SECTION CORNERS"

3. W. H. RAYNER, COUNTY SURVEYOR, RESET POST HALF WAY BETWEEN THE SECTION CORNERS WHICH HE FOUND WITH OUT ANY PROBLEM IN A SURVEY RECORDED IN LIBER 3 PAGE 10 IN OCTOBER 1867: "NO BEARING TREES AT ALL".

4. W.E. ZIMMER, PE, SURVEYED THE WOLF CREEK DRAIN IN MARCH 1912. HIS NARRATIVE READS IN PART: "THENCE N2°W 9.47 CHS TO THE N LINE OF SAID SEC. 12 AT A POINT 36 LKS (23.8') EAST NORTH 1/4 POST".

5. L. BRYAN, LLS 25832, RECORDED CORNER UNDER ACT 74 IN LIBER 6 PAGE 327 IN APRIL 1987 & LIBER 6 PAGE 372 IN MAY 1988 AS A SET ½" BAR MIDWAY BETWEEN THE SECTION CORNERS IN EAST-WEST FENCE LINE: NAIL & TAG 25832 NORTH SIDE UTILITY POLE, WEST, 175.84'; NAIL & TAG 25832 SOUTH SIDE FENCE POST, EAST, 69.25'; NAIL & TAG 25832 WEST SIDE 4" BOX ELDER, SOUTH, 3.30'.

6. D. HUGHES, RLS 18988, USED CORNER IN AN ACT 132 SURVEY IN MARCH 1992 AS A FOUND ½" IRON ROD/CAP 25832: CL WOLF CREEK 90° 33'; FD. NAIL & TAG 25832 WEST SIDE 4" STUMP, 180°, 3.24'; FD. NAIL & TAG 25832 SOUTH SIDE 6" WOOD END FENCE POST, 90°, 69.20'; FD. NAIL & TAG 25832 NORTH SIDE UTILITY POLE, 270°, 176.75'; SET NAIL & TAG EAST SIDE 4" TREE, 8°, 26.33'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 1/2" BAR & CAP 25832, 33 FEET EAST OF THE CENTERLINE WOLF CREEK DRAIN AT A BEND IN SAID DRAIN. TANGENT OF SAID DRAIN TO THE SOUTH IS 24' EAST OF IRON AS ZIMMER SAID IT SHOULD BE IN 1912. ACCEPTED BAR & CAP AS PERPETUATION OF CORNER AND REPLACED IT WITH STANDARD BAR & ALUMINUM CAP. MEASURED EAST 2607.27' TO M-3. MEASURED SOUTH 2636.80' TO L-4. MEASURED WEST 2607.74 TO K-3. MEASURED NORTH 2647.40' TO L-2.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E L-3

3/4"X 24" STEEL BAR WITH 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837
2" DIAMETER STEEL FENCE POST
FOUND NAIL & TAG 25832 SOUTH SIDE FENCE POST
NAIL & TAG 28409 (R. ENGER) NORTH SIDE WOOD FENCE POST
SET NAIL & TAG 28409 NORTH SIDE WOOD FENCE POST
FOUND NAIL & TAG 25832 NORTH SIDE UTILITY POLE

EAST 4.80'
EAST 69.20'
WEST 2.80'
WEST 14.00'
WEST 175.84'



Signed by David L. Clifford
Surveyor's Michigan License No. 25837

Date OCTOBER 23, 2002

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN, 1983
REVISED OCT, 1995

P.A. 345 INGHAM COUNTY
PEER APPROVED 10/24/2002 m

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY

Located in:

Corner Code #

(County)
LOCKE TOWNSHIP

1. Public Land Survey

T 4N R 2E

L-4

2. Property Controlling
in Section

S

T R

3. Miscellaneous
Property in Sec.

S

T R

4. Lot No. , Recorded Plat

5. Private Claims

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS
ENGINEER SURVEYING & ENGINEER

L-10 P-345

RECORDED
CRNR 9.00

2002-079364



2002-079364

Page: 1 of 1

12/05/2002 03:19P

Register of Deeds Stamp & File Number

I, DAVID L. CLIFFORD, in a field survey on OCT. 14, 2002 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. POST NOT SET IN ORIGINAL GOVERNMENT SURVEY.
2. THERE IS NO PUBLIC RECORD OF ESTABLISHMENT OF CORNER BY THE INGHAM COUNTY SURVEYOR.
3. L. BRYAN, LLS 25832, RECORDED CORNER UNDER ACT 74 IN LIBER 6 PAGE 327 IN APRIL 1987 & LIBER 6 PAGE 372 IN MAY 1988 AS A FOUND 1 1/2" POST IN A CONCRETE BASE: NAIL & TAG 25832 NORTH SIDE 6" ELM, S80°W, 31.45'; NAIL & TAG 25832 SOUTH SIDE 4" HAWTHORNE, WEST, 12.70'; NAIL & TAG 25832 NORTH SIDE 10" WILLOW, S25°W, 20.00'.
3. D. HUGHES, RLS 19834, USED CORNER IN AN ACT 132 SURVEY IN MARCH 1992 AS A FOUND 2" ROUND IRON FENCE POST IN A CONCRETE BASE, SET 1/2" IRON ROD/CAP 1.2' NORTHEAST FOR RECORD FROM N 1/4 COR. AND W 1/4 COR.: SET IRON ROD FOR PL COR. 360° 331.22'; FD. NAIL & TAG 25832 NORTH SIDE 6" ELM, 280°, 31.73'; FD. NAIL & TAG 25832 SOUTH SIDE 4" DEAD HAWTHORNE, 300°, 13.11'; FD. NAIL & TAG 25832 NORTH SIDE 12" WILLOW, 228°, 20.32'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 3 STEEL PIPE FENCE POST AS CALLED FOR IN ITEMS 2 AND 3 ABOVE. TRAVERSE OF SECTION REVEALED THAT INTERSECTION OF 1/4 LINES WAS 12.25' NORTH & 6.1' WEST OF RECORDED FENCE POST. FURTHER INVESTIGATION REVEALED ANOTHER FENCE FROM THE WEST AS SHOWN IN DIAGRAM.

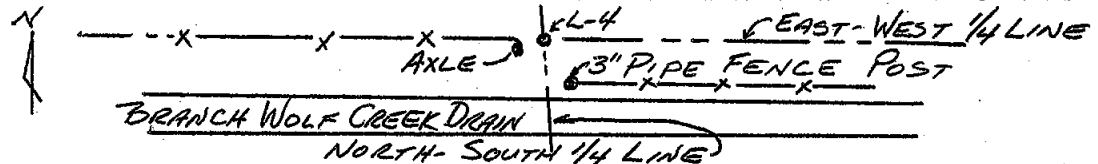

DETERMINED THAT EAST-WEST 1/4 LINE FELL ON FENCE FROM WEST AND NORTH-SOUTH 1/4 LINE FELL BETWEEN THE 2 FENCES POSTS. DID NOT ACCEPT PIPE IN CONCRETE AS CORNER POSITION. SET STANDARD 3/4" BAR & ALUMINUM CAP AT THE INTERSECTION OF 1/4 LINES. MEASURED WEST 2634.28' TO K-4. MEASURED SOUTH 2656.51' TO L-5. MEASURED EAST 2629.64' TO M-4. MEASURED NORTH 2636.80' TO L-3.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E L-4

3/4"X 24" STEEL BAR WITH 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837
CENTERLINE WEST SIDE 3" STEEL PIPE FENCE POST IN CONCRETE BASE S35°E 13.20'
CENTERLINE NORTH SIDE AXLE SHAFT FENCE POST S85°W 4.00'
SET NAIL & TAG 28409 EAST SIDE 8" ALDER N20°W 10.65'
SET NAIL & TAG 28409 NORTH SIDE 10" ALDER S80°E 15.70'

Signed by David L. Clifford
Surveyor's Michigan License No. 25837

Date OCTOBER 23, 2002

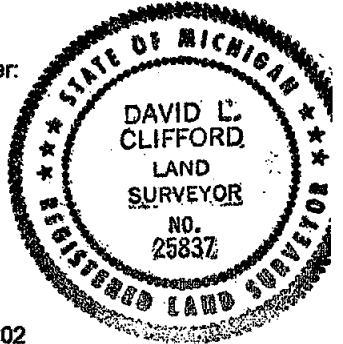

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN. 1983
REVISED OCT., 1995

P.A. 345 INGHAM COUNTY
PEER APPROVED 11/07/2002 M

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY Located In: Corner Code #
(County)
LOCKE TOWNSHIP
1. Public Land Survey T4N R2E M-3
T R
T R
T R
2. Property Controlling S T R
in Section T R
S T R
3. Miscellaneous T R
Property in Sec. S T R

Paula Johnson
INGHAM COUNTY
REGISTER OF DEEDS RECORDED
ENGINEER SURVEYING & ENGINEERING CRNR 9.00
L-10 P-344
2002-079363

2002-079363
Page: 1 of 1
12/05/2002 03:19P

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on SEPT. 19, 2002 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826; BE 5", S61W, 16; ELM 22", N44W, 21 1/2.
2. T. J. BROWN, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOL. 2 PAGE 342 IN JULY 1858 WITH NO MENTION OF MONUMENT OR WITNESSES.
3. W. H. RAYNER, COUNTY SURVEYOR, USED CORNER IN A SURVEY RECORDED IN VOL. 2 PAGE 28 IN OCT. 1867 WITH NO MENTION OF MONUMENT OR WITNESSES
4. OSCAR BOSS, RLS 13574, RECORDED A-3, T4N, R3E AS A FOUND 3" PIPE: N21°40'E, 72.0' NAIL W. SIDE 30" MAPLE; N73°40'E, 40.2', NAIL S. SIDE 30" MAPLE; S88°40'W, 21.2', NAIL S. SIDE FENCE POST.
5. THE INGHAM COUNTY REMONUMENTATION PROGRAM OF THE LATE 1970'S EXCAVATED A HOLE 21' NORTH-SOUTH X 10' EAST-WEST X 2.5' DEEP AT THE INTERSECTION OF HERRINGTON ROAD AND BRIMLEY ROAD TO THE EAST AND FOUND A 3"X 1.5' IRON PIPE 5' EAST & 1.5' SOUTH OF THE INTERSECTION OF BOSS WITNESSES FOR A-3. A 18" DIAMETER CMP WAS FOUND RUNNING NE-SW THROUGH THE INTERSECTION. THE CMP WAS DIRECTLY UNDER THE INTERSECTION OF BOSS WITNESSES FOR A-3. NO FINAL DETERMINATION WAS MADE ON THE LOCATION OF M-3.
6. LARRY BRYAN, RLS 25832, RECORDED CORNER UNDER ACT 74 IN LIBER 6 PAGE 372 IN MAY 1988 AS A FOUND 1/2" BAR IN CENTERLINE OF HERRINGTON ROAD WITH THE SAME WITNESSES AS OSCAR BOSS USED TO A-3 IN ITEM 4 ABOVE.
7. C. GARLOCK, RLS 14762, SET A 1/2" BAR & CAP AT THE GLO FALLING 6.6' NORTH OF BRYAN'S RECORDED POSITION FOR M-3 FOR A-3 T4N R3E IN AN ACT 132 SURVEY IN AUGUST 1990: S50°W, 23.0' CENTERLINE 1 1/2' ELM; WEST, 21.9', SPK S. SIDE 14" COR POST; N85°W, 17.4', CENTERLINE S. LEG ARROW SIGN; EAST 1.0' CENTERLINE ROAD.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 6" SPIKE ON CENTERLINE HERRINGTON ROAD ON A FENCE LINE TO THE WEST MATCHING 2 OF BRYAN'S WITNESSES TO CORNER. A 18" CMP WAS FOUND RUNNING NE-SW DIRECTLY UNDER THE SPIKE. A 1/2" BAR & CAP # 14762 WAS FOUND 6.6' NORTH OF FOUND SPIKE ON LINE WITH SAID SPIKE & MONUMENT AT M-2. ACCEPTED FOUND SPIKE AS BEST AVAILABLE EVIDENCE OF POSITION OF CORNER BASED ON RECENT USAGE AND AGREEMENT WITH OCCUPATION TO WEST AND DROVE STANDARD 3/4" BAR THROUGH CMP WITH JACK HAMMER AND SET ALUMINUM CAP ON BAR. MEASURED NORTH 2651.83' TO M-2. MEASURED SOUTH 2661.22' TO M-4.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E M-3

3/4" X 24" STEEL BAR WITH 1/2" BAR & 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837
FOUND NAIL & TAG 31603 (D. RICHARDSON) EAST SIDE 36" MAPLE N13°E 72.06'
FOUND NAIL & TAG 25832 SW UTILITY POLE S57°E 45.38'
SET NAIL & TAG 28409 (R. ENGER) WEST SIDE 8" TWIN HICKORY S30°E 67.65'
SET NAIL & TAG 28409 EAST SIDE 6" ASH S01°W 156.11'
FOUND NAIL & PLAIN WHITE TAG SOUTH SIDE CORNER POST S88°W 21.66'
SET NAIL & TAG 28409 EAST SIDE 36" OAK N13°W 147.84'
1/2" BAR & CAP #14762 (A-3 T4N R3E) N05W 6.60'

Signed by David L. Clifford
Surveyor's Michigan License No. 25837

Date SEPTEMBER 26, 2002

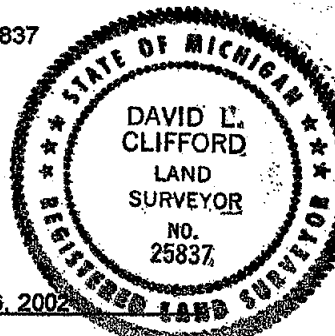

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1976
REVISED JAN., 1983
REVISED OCT., 1995

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/24/2002 MC

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

INGHAM COUNTY

(County)

LOCKE TOWNSHIP

1. Public Land Survey

Located In:

Corner Code #

T 4N R 2E

M-4

T R

T R

T R

T R

T R

T R

T R

T R

Paula Johnson

INGHAM COUNTY

REGISTER OF DEEDS

ENGER SURVEYING & ENGINEERING

RECORDED

CRNR 9.00

L-10 P-346

2002-079365

2002-079365

Page: 1 of 1

12/05/2002 03:19P

Register of Deeds Stamp & File Number

2. Property Controlling
in Section

S

T R

S

T R

3. Miscellaneous
Property in Sec.

S

T R

4. Lot No. , Recorded Plat

5. Private Claims

I, DAVID L. CLIFFORD, in a field survey on AUG. 03, 2002 Do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. ORIGINAL POST SET BY J. WAMPLER, DEPUTY SURVEYOR IN MARCH, 1826; ASH 9", S58W, 6; ASH 7", N16W, 27.

2. RONNIE M. LESTER, RLS #18998, RECORDED CORNER UNDER ACT 74 IN LIBER 5 PAGE 356 IN NOVEMBER 1979 AS A 4"X36" CONCRETE MONUMENT WITH 1/2" BAR & CAP #18998 SET IN PLACE OF A STONE FOUND IN A 7'X10'X2.5' DEEP EXCAVATION MADE DURING THE INGHAM COUNTY REMONUMENTATION PROJECT OF THE LATE 1970'S: TOP CENTER BURIED CABLE BOX, EAST, 27.85'; NAIL & TAG #18998, EAST SIDE 4" POPLAR, NW, 30.30'; NAIL & TAG #18998 SOUTH SIDE 36" OAK, NNE, 227.59'; INSULATOR ON EAST SIDE 12" OAK, NNW, 112.54'; CONCRETE MONUMENT A-4 CONWAY TWP., LIVINGSTON COUNTY, T4N R3E, SOUTH, 0.69'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FIELD INVESTIGATION AT APPARENT LOCATION OF CORNER REVEALED A 1/2" BAR IN 4" CONCRETE MONUMENT 2' EAST OF CENTERLINE HARRINGTON ROAD ON FENCE LINE TO THE WEST 0.7' NORTH OF ANOTHER CONCRETE MONUMENT AT A-4, T4N R3E. ACCEPTED 1/2" BAR & CONCRETE MONUMENT AS PERPETUATION OF CORNER BASED ON 1979 EXCAVATION & CAPPED WITH STANDARD ALUMINUM CAP. MEASURED NORTH 2661.22' TO M-3. MEASURED SOUTH 2651.74 TO M-5.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

T4N R2E M-4


1/2" BAR IN 4" CONCRETE MONUMENT WITH 2 1/4" ALUMINUM CAP STAMPED INGHAM COUNTY PA 345, PS 25837

SET NAIL & TAG 28409 (R. ENGER) WEST SIDE 36" OAK	N15°E	227.85'
SET NAIL & TAG 28409 EAST SIDE 5" MAPLE	S15°W	84.00'
SET NAIL & TAG 28409 SOUTH SIDE 5" BASSWOOD	S80°W	29.62'
SET NAIL & TAG 28409 NORTH SIDE 6" OAK	N75°W	21.15'
SET NAIL & TAG 28409 NORTH SIDE 12" OAK	N50°W	21.78'
1/2" BAR IN CONCRETE MONUMENT (A-4 T4N R3E)	SOUTH	0.70'

Signed by David L. Clifford
Surveyor's Michigan License No. 25837

Date SEPTEMBER 23, 2002

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 23, 1971
REVISED MAY 14, 1975
REVISED JAN. 1989
REVISED OCT. 1995

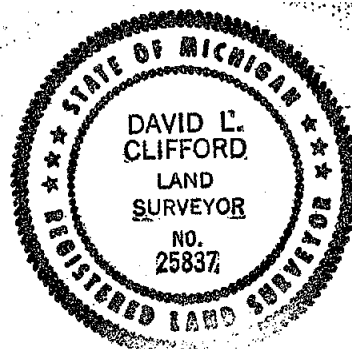

P.A. 345 INGHAM COUNTY
PEER APPROVED 9/24/2002 PC