


5-25-01 00-1
RM-FS (39)

ON-1			
39			
Δ 45-1-34-16		15-74 (1701.635)	
B/S 45-1-33-15		FROM 45-1-34	
F/S 01-1-39-100		FIELD (BONE)	
850 12-59-45			
850 193-22-45			
850 57-57-00		16700	994.685
FSE 238-19-55			994.680
850 120-26-30			994.680
F3B 300-49-30		Δ 1	994.685
852 57-34-15		100-701	
FSE 231-31-15			1647.095
Δ 180° 23' 59"			1647.100
Δ 01-1-39-100	SHINE AS		1647.095
B/S 01-1-39-16	(45-1-34-16)	M	1647.095
F/S 01-1-39-101 4-1		100-7102-7	
850 4-05-05			1687.846
F/S 183-38-10	5705	100-7103-7	1647.1835
850 24-09-30	57-00	2012.360	1667.845
F/S 183-06-30		2012.360	1667.835
850 42-42-45	57-05	2012.360	M-1667.84
F/S 220-59-45		M 2012-360	
B/S 113-09-55	57-10		
FSE 292-01-05		Δ 01-1-39-100	
Δ 178° 57' 05"		B/S 01-1-39-16	
Δ 01-1-39-100		F/S 01-1-39-103	
B/S 01-1-39-16		850 06-00-00	
F/S 01-1-39-102 4-13		850 194-17-00	
B/S 01-1-39-100		850 01-29-40	
B/S 01-1-39-100		850 180-46-45	
F/S 292-01-05		850 14-52-25	
F/S 292-01-30		850 197-09-20	
852 91-43-15			
FSE 210-43-50			
850 02-55-10		B/S 21-03-30	
F/S 185-02-40			
B/S 00-00-00		F/S 200-20-30	M 179° 17' 00"
F/S 178-59-40			
Δ 178° 57' 35"			

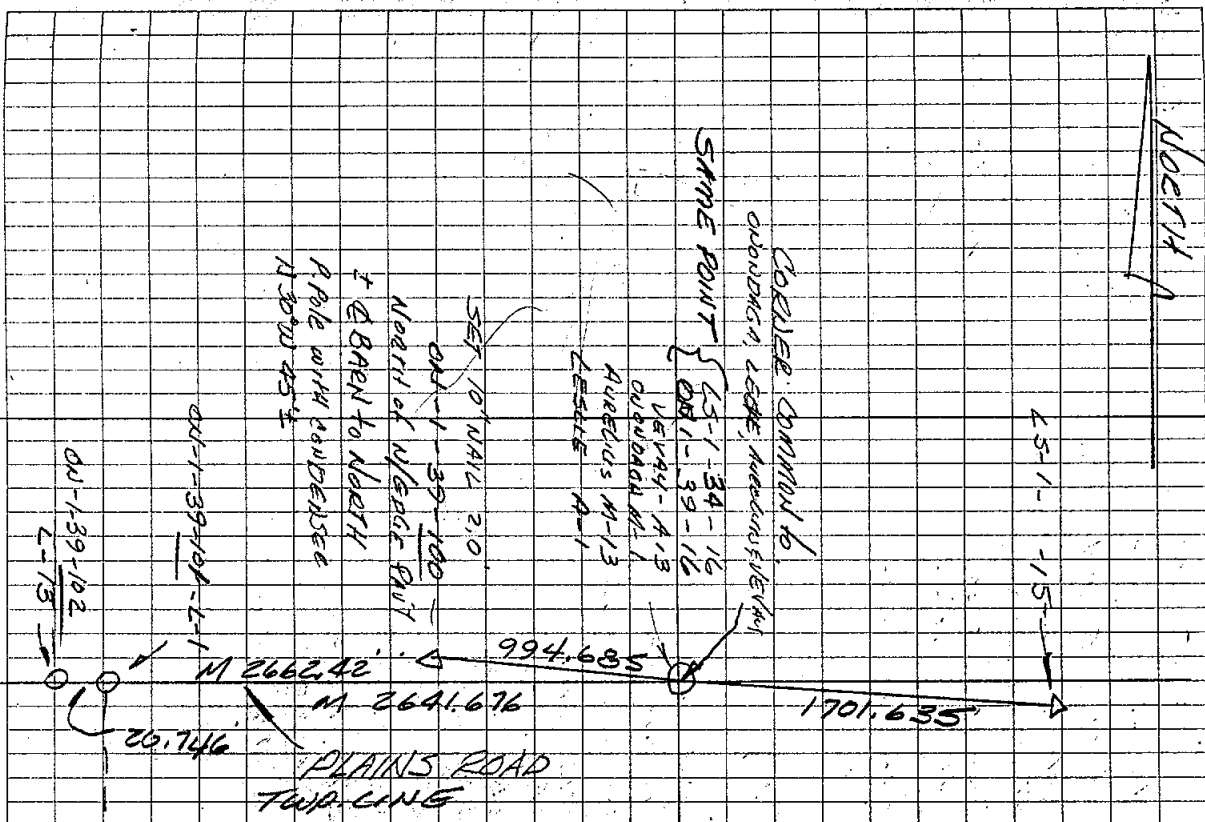

00-1
40.

100-1-39-103

103-1104 (2.1/1000)

B/S 00-1-39-100

973.610

F/S 00-1-40-104

973.605

B/S/D 00-1-40-105

973.610

F/S/D 252-03-30

M 973.605

B/S/E 67-51-50

32-15

B/S/D 46-52-25

32-15

F/S/D 226-25-40

32-15

B/S/E 01-23-00

32-10

B/S/E 180-55-10

32-10

M 1 19032' 13"

103-1105

100-1-39-103

1556.040

B/S 00-1-39-100

1556.045

F/S 00-1-40-105

1556.045

B/S/D 00-1-40-105

M 1556.045

F/S/D 179-16-15

179-15-10

B/S/E 124-25

15-00

B/S/E 192-01-25

14-50

F/S/D 214-35-10

14-50

B/S/E 12-36-15

14-45

F/S/E 251-51-10

14-45

M 4 179°14'59"

5-25-01

00-1

40

~~00-1-39-103~~

NORTH

00-1-40-105

PLAINS ROAD

WEST 1/4 002
30014 522.36
T2U, E2U

00-1-40-104

56

00-1-39-103

SET 10" NAIL 0.5' WEST OF
EDGE OF PAVT 10' WEST OF W END
OF H56 # 5550

00-1-39-102-1-13

2-1

00-1-39-100

ON-1
41.

ON-1-40-105

BS ON-1-39-103

713 ON-1-41-106 (K-1)

BS/D 00-27-00

FS/D 18-19-15

BS/E 06-26-55

FS/E 188-19-10

BS/D 78-46-10

FS/D 260-38-25

BS/E 00-00-00

FS/E 181-52-20

ON-1-40-105

BS ON-1-39-103

AS ON-1-41-106 (K-13)

BS/D 04-06-45

FS/D 185-30-25

BS/E 35-26-80

FS/D 216-49-50

BS/D 32-14-05

FS/D 213-37-40

BS/E 83-17-50

FS/E 270-41-30

ON-1-41-108

BS ON-1-40-105

FS ON-1-41-108

BS/D 20-14-10

FS 108-39-20

BS/E 06-25-45

FS 134-50-50

BS/D 166-25-45

FS 254-80-45

BS/E 20-54-25

FS 109-19-30

105 → 106

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

720.555

5-25-01
RH-KS

ON-1
(41)

NORTH

ON-1-39-103

ON-1-40-105

SET 10' ANGLE 3.3'

SOUTH 1/2 S. EDGE OF PAVT
9' WEST OF CREST AND
5' WEST OF CENTER WITH
METAL DOOR.

PLAINS ROAD

ON-1-40-106 K-1

ON-1-41-108 K2

2863.85

EDGE ROAD

ON-1-40-107 K-13



NA 882505"

001 42	Aurelius	7-23-01 EYES
	A-13	
	SET 3/4" BAE & EXTOD SO. STANDARD	
	DIST 5.81' North of Cove AS	
	REC 10 LIME & RE 117 by R. LESTER'S	
	COOKED AS A LOST COVE (I DID	
	NOT AGREE THAT IT IS LOST & DISSED	
	FOUND CLOSING COVE FEE	
	ABANDON TOP (K-1) AS AN ACCESSORY	
	TO THE COVE AS REC 10 L 5 PS 4E.	
	COVE SET 00 TRUP LIME AS EXTENDED	
	FROM EAST, USING FOUND & RECOVERED	
	WEST 1/2 COVE R. of Sea 36.720, 224,	
	Aurelius Trip, which is an old berated	
	COVE.	
	END N.E.T #25832 (L. Bryan) SE/SIDE Cove Pole	
	N.H. 330, 81.31	
	END N.E.T #18998 (E. Lester) N/SIDE of 15"	
	N. Cherey of Grand Cherey	
	N.H. 110, 128.46	
	EAST 1980 GLO Filling L-1-ABANDON	
	TOP TIV, ECU	
	SET N.E.T #18994 E/SIDE Cove Pole	
	N.H. 190, 131.31	
	NE COE FUB. 6 HSE #200 N.H. 218, 161.42	

001 42	Aurelius	7-23-01 EYES
	A-13	
	SET 3/4" BAE & EXTOD SO. STANDARD	
	DIST 5.81' North of Cove AS	
	REC 10 LIME & RE 117 by R. LESTER'S	
	COOKED AS A LOST COVE (I DID	
	NOT AGREE THAT IT IS LOST & DISSED	
	FOUND CLOSING COVE FEE	
	ABANDON TOP (K-1) AS AN ACCESSORY	
	TO THE COVE AS REC 10 L 5 PS 4E.	
	COVE SET 00 TRUP LIME AS EXTENDED	
	FROM EAST, USING FOUND & RECOVERED	
	WEST 1/2 COVE R. of Sea 36.720, 224,	
	Aurelius Trip, which is an old berated	
	COVE.	
	END N.E.T #25832 (L. Bryan) SE/SIDE Cove Pole	
	N.H. 330, 81.31	
	END N.E.T #18998 (E. Lester) N/SIDE of 15"	
	N. Cherey of Grand Cherey	
	N.H. 110, 128.46	
	EAST 1980 GLO Filling L-1-ABANDON	
	TOP TIV, ECU	
	SET N.E.T #18994 E/SIDE Cove Pole	
	N.H. 190, 131.31	
	NE COE FUB. 6 HSE #200 N.H. 218, 161.42	

44

OLONDAGA

K-04 FOUND CONCRETE MONUMENT
IN MOUNT BOX, LID GONE

ROAD HAS APPARENTLY SUNK
A FEW INCHES, TOP OF IRON
IS EXPOSED, AND BENT OVER

WITH BOLT CUTTERS, REMOVED TOP
4" OF BENT IRON, STRAIGHTENED
2" PLACED YELLOW PLASTIC CAP
REYNOLDS 31602, THEN
PLACED ALUMINUM CAP OVER
THAT

FD NAIL 18998 TAG W SIDE
S' most TOWNK TRIP 14" MAPLE

NAZ 05° 236.32'

SET NAIL & CAP W SIDE 12" CHEERLY

NAZ 11°30' 133.035'

SET COR S HIGH WALL CONC CURV

NAZ 12°30' 94.535'

FD 2 N & T W SIDE 8" APPLE

LESTER 17°40' NAZ 88.175

RLS 18998 17°40' NAZ

BZ.

CLOUDY

5-01-2002

44

D.D.

50°

MODERATE

A.K.

SET NAIL & CAP IN NW SIDE
16" CHEERLY

NAZ 215°15' 120.025

SET NAIL & CAP W SIDE 2" MAPLE?

CLUSTER OF SEVEN

NAZ 194°45' 151.685

45	5-01-2002	MAINTENANCE	
		ONONDAGA	
K-05	FOUND	MONUMENT BOX	
	AT INTERSECTION OF		
	ROADS.	BOX RISER WAS	
	APPARENTLY SUGGESTED BY		
	PAVING MACHINE, IT WAS		
	OFF CENTER	SSE	0.3' ±
	IRON IN NON BOX OBSERVED BY		
	RISER. EXCAVATED WITH POWER		
	DIGGER. REMOVED RISER RING		
	FOUND 2ND RISER RING		
	FOUND PIPE CAP INSIDE		
	INSERTION UNDISTURBABLE		
	TOP OF PIPE 6"-8" BELOW GRADE		
	SET OFFSET PK NE	3.01'	
		SE	2.99'
	REMOVED BOX & PIPE EXCAVATED		
	2' X 2' HOLE THROUGH 8" OF BIT		
	PIPE APPROX 18" LONG BROKE OFF		
	AT 2' DEEP STILL DIGGING AROUND		
	REMAINDER OF PIPE FOUND SEVERAL		
	PIECES OF CROCKERY, SEVERAL		
	SMALL & MEDIUM STONES	AT 3' DEEP	
	FOUND PLOW POINT	2.97 TO PK SE	
		3.13 TO PK NE	

ACCEPTED PLOW POINT REPLACES									
WITH STANDARD REMOVED ROAD & CAP									
FD	NAILED TAG #1137	PP	NAZ	69930'	6158'				
FD	USGS BENCH	ELEV	966						
	NOV 107'E		199.145						
FD	2 NAILS & TAGS	(LESTER & RLS 18998)							
	W SIDE OF WALNUT								
FD	NAILED TAG #28414	S	SIDE						
	16' WALNUT	NAZ	292	6111'					
	TAG READS "SUNVEY POINT DO NOT								
	DISTURB	PS	28414"						
FD	2 NAILS & TAGS	E	SIDE	14" WALNUT					
	TAG LESTER 18998	NAZ	332'30"	61485'					
	TAG RLS 18998			61510'					
FD	2 NAILS & TAGS	SW	SIDE	WALNUT					
	TAG LESTER 18998	NAZ	138'30"	5984'					
	TAG RLS	18998	FELL OUT						
	SE SIDE								
SET	NAILED CAP	PP	NAZ	225	99205				
	#526								

46 5-01-2002 AFTERNOON

M-05 OONDAGA

FOUND CONC MOUNT IN
GOOD CONDITION IN MOUNT
BOX CONSISTENT WITH
PREVIOUS RECORDINGS
FOUND CORRESPONDING
CLASING COVER CONC
MON IN BOX IN GOOD
CONDITION, AS DESCRIBED
IN PREVIOUS RECORDINGS

ACCEPTED BOTH AS FOUND
AND PLACED YELLOW PLASTE
CAP ON 1/2" IRON IN CONC.
THEN PLACED IN CHAM
ALUMINUM CAP STAMPED
"31602" OVER THAT

FD NAIL & TAG PLS #18998 S SIDE
NAZ 62°30' 79.74 24" DIVE

FD NAIL & TAG PLS 18998 W SIDE
P. POLE NAZ 105°29' 51.53'

46

FD NAIL & WHITE SHANKER
S SIDE OF POWER POLE
NAZ 106°35' 51.42

FD NAIL & KEYS TAG IN 3" WOOD
FWD POST NAZ 348°42' 26.51'

FD NAIL & TAG IN S SIDE 24"
W. DIVE NAZ

SET PK W END 8" CULVERT CHD
NAZ 07°24' 22.20'

SET PK E END 8" CULVERT CHD
NAZ 47°30' 35.35'

FD NAIL & TAG PLS 18998 IN PP
NAZ 43°48' 69.72'

47

L-05 OUNDAGA

FD 1/2" IRON IN MON BOX

IRON BADLY BEAT CAP ALTERATED

DUG AND PROBED IN MON BOX

TOP 8-10" OF CONCRETE ARE

BROKEN

STRAIGHTENED IRON PLACED

1/2" YELLOW CAP "REYNOLDS 31602"

THEN PLACED ALUMINUM

REMOVED CAP OVER THAT

28414

FD NAIL & TAG "WEBB" IN 10" SPURCE

NAZ 358°42' 42.02

FD NAIL & TAG LESTER 18998

IN POWER POLE

NAZ 40°15' 27.70

FD NAIL & TAG LESTER 18998

IN POWER POLE

NAZ 178°05' 63.09

SW COR HOUSE FDU

NAZ 323°17' 106.43

SE COR HSE FDU

NAZ 342°53' 88.73

HOLE TOP CENTER IRON TRIM

ON MILLSTONE

NAZ 215°28' 48.95

47

48
B.D.
A.K.

4-3-02

Morning

L-04 - Onondaga

End 3 inch steel Enc Post,
placed strapped survivor #31602
in North side of post.
(post strands 4 feet tall)

End N+T #28414 side 12" Bedrock
NAZ 125°, 16.11"

End N+T #28414 NW side 18" Basswood
SW., 1.8'

End N+T #18998 N. Side 12" Bedrock
NAZ 110°, 5.73'
NAZ 110°, 5.73'

End N+T #18998 N. Side 12" Maple Logcut
NAZ 270° 74.65'
N+T RLS NAZ 270°, 74.65'

End N+T #28414 side 6" Walnut
North, 35.2'

48.

Set N+T #31602 E. side 18" Basswood
South 1.47'

End N+T #18998 N. side 24" Basswood
East, 23.9'

50 4-3-2002 Astoria

M-4 ONONDAGA TIN RAY

FD 5/3 REAR & CAP #28409

Fence line west of south Iron

appears to be set on the east

side of Flat stone but so

that the cap is over the

stone. We tried to remove stone

but only busted off top portion

The stone is uneven in these roots.

set standard between Iron & Cap

over stone, stone is about 15'

Deep

FD 1/2" Iron & Cap #18998 south

Naz 160° 4.81'

FD NBT 18998 E/S 20" Tin 11 M/11c NAZ SW

NAZ 195° 1.84'

FD RMA IR + Cap NAZ 0° 13.25'

(A-4 Leslie)

FD N+T #28409 E side 30" Basswood

NAZ 177° 35' 5.70'

50

FD N+T #18998 N. side 16" Basswood

West Yard AK

51 A.K.
D.O.

4-3-2002

Afternoon

A-04 Leslie

Found 5/8" rebar with

Plastic cap #28409.

Replaced w/ standard

English country Roman

Iron + Cap.

FD 1/2" IR + Cap #18998 south

N42 180°, 18.10

FD NAT #18998 E. side 20" twin

maple N42 184° 14.75

FD Roman IR + Cap (m-y on road)

N42 190°, 13.25'

FD NAT #28409 E. side 30"

Basswood N42 179°, 18.96

FD NAT #18998 N. side 16" Basswood

N42-241°, 28.44

4-3-2003

M-07

FD conc. man with 1/2" x 3/8" rebar

w/1/4" cap #18998 with man box & lid

FD NAT #18998 in w/1/5 15" twin (new)

N42 342-22-50 73.505

5th NAT #3602 w/1/5 15" spire

N42 196-49-25 127.42'

FD NAT #18998 w/1/5 24" w/Alum +

N42 187-33-15 232.12'

TOP center 4" steel fence post +

N42 201-41-50 66.645'

4" conc man. A-7 Leslie north 3.82'

8.5'± w/1/4" cap E/w

4.5'± east of north/south

K06

FD 1/2" iron in & dug 2'x2'x3' hole

AT 1.3' Found side of large stone opened

hole up to 3.5' & continued to dig around

stone & found north/east stone is 14" thick

2.3 N/S and 20' E/W Tunnels under stone

it was all sand Found Nothing Found Best

Spot for center of stone and set a 10' piece

of Roman Iron + Cap with Box

M-26 4-3-2003

FD Conc. Man w/ 1/2 x 3/4" Retrod in Man Box w/ cover
 FD N+T #18998 Sw/S 20" Oak N+Z 113-51-30 27.05'
 FD Iron #17640 N+Z 80-06-25 33.270'
 FD N+T #25832 E/S V.A. N+Z 349-01-30 134.705'
 FD N+T #25832 SE/S U-Pole N+Z 145-12-00 101.015'
 FD N+T #25832 Sw/S U-Pole N+Z 161-55-40 107.440'
 FD 4" Conc. Man A-6 Leslie North S-900'
 SE S of E/W Fence Line
 1' west of N/S
 Chisled away part of mount cut 2' off Retrod.
 Placed yellow cap #31602 over road w/stand
 Ingham County cap #31602 over that

54

DD/54/CN 53°RAIN 6-12-03

K-07

FD 1/2" IRON DOG 2'X2'X4' HOLE
 RAN INTO BLACK MUCK AND WATER
 FOUND NO TRACE OF STONE, CREEPER, ECT
 REPAIRED IRON WITH STANDARD
 REMON IRON + CAP + BOX

SCT PK NAIL IN W/S OF CONC. CATCH DRAIN

NAC 107.1815 88.17'

FD NAIL AND OLD TAG IN W/S 6"X8' FENCE

POST NAC 233.4128 47.15'

FD NAT #28414 IN W/S 10" ELM CLUSTER

NAC 11.4550 139.87'

FD NAT E/S MAPLE CLUSTER

NAC 266.5749 75.645'

Set tolerance of 1.5' X 3' RISE BOX

NAC 45.25.00 48.39'

DD/54/CN 53°RAIN 6-12-03

55

L-07 FD 1/2" IRON DOG 2'X2'X4' HOLE

FOUND TRACE OF STONE, CREEPER, ECT
 AT 3' THE HOLE FILLED WITH WATER
 SCT STANDARD REMON IRON, CAP AND BOX

FD PK TAG #39100 W/S 40' OAK

NAC 237.0844 39.65'

SCT NAT W/S 6" MAPLE CLUSTER

NAC 03.0045 28.72'

SCT NAT 5/5 8" MAPLE NAC 260.2558

26.155'


SCT NAT W/S 8" MAPLE

NAC 177.0505 33.135'

SCT NAT 5/5 20" HICKORY

NAC 117.4422 52.095'

56			6-12-03
N	LS2-12-33-M7		
B5	LS2-12-33-M6	0	8657.75
F5	0N1-56-42-TP	869-03-31	1964.045
F5		89-03-30	
B5		180-00-04	
..		869-03-29	
N	0N1-56-42-TP		
BS	LS2-12-33-M7	0	
F5	0N1-56-43-L7	181-49-64	659.265
FSR		01-49-06	
BSR		180-00-03	
..		181-49-03	
BS	LS2-12-33-M7	0	
F5	0N1-56-44-TP	181-42-41	953.15
FSR		01-42-42	
BSR		180-00-06	
..		181-42-39	
N	0N1-56-44-TP		
BS	0N1-56-42-TP	0	
F5	0N1-56-45-TP	178-06-57	1141.937
FSR		358-07-07	
BSR		180-00-07	
..		178-06-58	

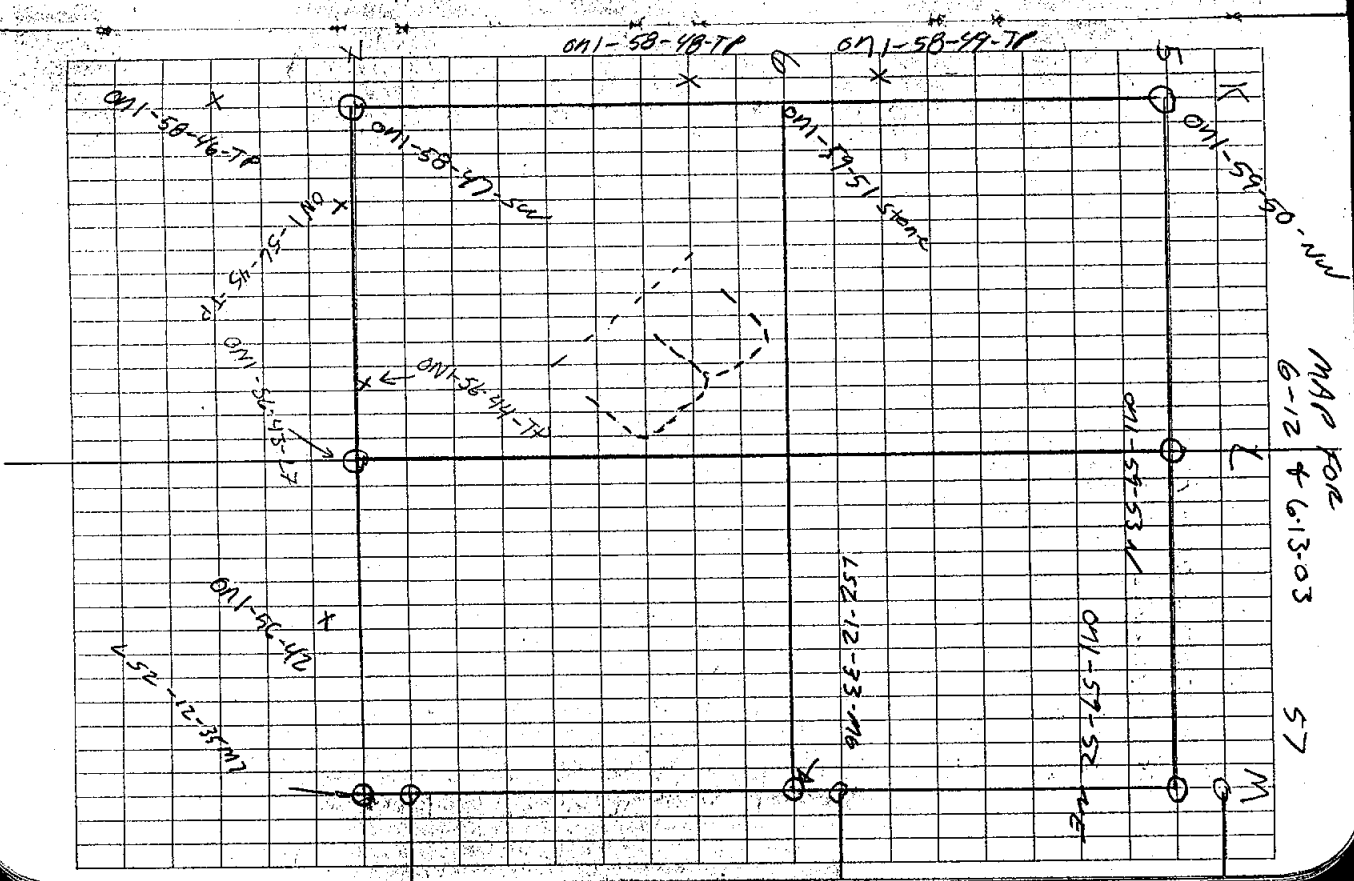

58	JR/DD/CN	60° Overcast	6-13-03
T	0M1-58-45-TP		
BS	0M1-58-44-TP	⊖	114.930
FS	0M1-58-46-TP	165-40-08	1850.715
F5R		345-40-04	1250.715
BSR		180-00-04	1141.94
T	0M1-58-46-TP		
Q	0M1-58-45-TP	⊖	1250.725
F5	0M1-58-47-52	286-44-44	336.225
T	0M1-58-46-TP		
Q	0M1-58-45-TP	⊖	1250.725
F5	0M1-58-48-TP	285-27-17	2036.135
F5R		105-27-18	2036.135
BSR		180-00-04	1250.73
∴			
T	0M1-58-48-TP		
Q	0M1-58-46-TP	⊖	2036.135
F5	0M1-58-49-TP	180-03-10	981.635
F5R		0-03-06	981.64
BSR		180-00-00	2036.145
∴			

DD/SR/CN	6-13-03	59
T 0M1-58-48-TP		2036.135
Q 0M1-58-46-TP	⊖	
F5 0M1-58-50-44	180-10-56	3585.21
F5R	0-10-53	3585.21
BSR	180-00-06	2036.14
∴		
T 0M1-58-49-TP		
Q 0M1-58-48-TP	⊖	981.63
F5 0M1-58-51-stone	346-24-13	41.47
F5 0M1-58-50-TP		
Q 0M1-58-48-TP	⊖	3585.24
F5 0M1-58-52-269-2541		3252.685
F5 0M1-58-53-269-1749		2623.615

60.	DD IREN	6-16-03	80° sunny
K-08	FD 1/2" pipe with PK + EILING		
	in crypted DUS 2'x2'x4.5' hole		
	The whole dig was Haded clay		
	Filled hole and set Limon		
	TEEN CAP AND BOX		
	FD NAT #28409 N/S 36" NAAC		
	NAC 265-4348 26.635		
	FD NAT #18416 TRS 5/5 6" x 8" POST		
	NAC 270-2934 20.65		
	FD NAT #18998 E/S 30" NAAC		
	NAC 310-3704 58.23		
	SET NAT 5/5 8" OAK		
	NAC 90-5245 31.73		
	CE RD EAST 7.5		

60	DD IREN	6-16-05	80° sunny	61
K-08	FD 1/2" IRON 5' x 6' x 6'			
	DUS 2'x2'x2' more found nothing set			
	BOX TEEN & CAP			
	FD NAT 5/5 2d' walnut			
	NAC 40' 53.23			
	FD NAT #18998 W/S 25' walnut			
	NAC 1470 45.19			
	FD 1/2" IRON NAC 2 145 4.305			
	SET NAT 6/5 36" NAAC			
	NAC 310-0647 82.095			
	FD NAT 5/5 #16105 12' NAAC			
	NAC 298-5308 42.075			

G2. DD CALLED 70° OVER CAST 6-17-01

TRE old w/ 1/4

T 001-58-49-TP

Φ 001-58-48-TP Φ

F5 001-62-54 old west 345-35-59 39.92

L-09

FD 1/2" IRON 5'± south of

E Bellevue Hwy. Dog down 1'±

and found 1/2"± of the old Awnath

to Dog Pass The old rd 4'±

did not find anything Filled hole

and set Permon Iron CAP & Box

SET NAT 6/5 24" PRC NAT 185° 45.06

SET NAT 5/5 24" PRC NAT 291° 48.96

SET NAT 5/5 30" BOX ELITE NAT 128° 94.87

McLoone House 5271 NAT 175° 64.22

McLoone OF BAEN NAT 167° 162.325'

SET NAT 4/5 6" X 8" POST NAT 28° 41.35'

6-18-03 DD 85° SUNNY 63

CN

M-09 FD BOAT SPIKE 1.5'±

KEEN OF E BELLEVUE RD

DIG A 2' X 2' X 4.5' HOLE IN

CEMENT RD THERE WAS ABOUT

14" OF BITUMINOUS THIN SAND

THAN HARD CLAY. SET PERMON

IRON CAP & BOX

FD NAT 4/5 24" PRC NAT 185° 45.06

NAT 329-23-20 53.21'

FD NAT 4/5 24" PRC NAT 291° 48.96

NAT 329-12-03 52.815'

FD NAT 4/5 30" NAT 128° 94.87

NAT 72-16-53 108.04

FD NAT 4/5 30" NAT 175° 64.22


NAT 109-37-27 88.665

SET NAT 5/5 30" NAT 128° 94.87

NAT 295-21-20 67.635

IRON FOR A-09 SOUTH 312.9'

64	64/8403	DD SR CN	85° Sons C	146715
T	001-58-46TP			
B5	001-56-45TP	Φ	1250.7	
F5	001-64-55TP		105.0804	215.57
FSR			285.0804	215.57
BSR			179.5954	1250.7
..				
T	001-64-55TP			
B5	001-58-46TP	Φ		2156.57
F5	001-64-56TP		180.0150	2786.71
FSR			01-0149	278.71
BSR			180.0000	
T	001-64-55TP			
B5	001-58-46TP	Φ		2156.57
F5	001-64-57-465T		186.5331	246.675
T	001-64-56-TP			
B5	001-64-55-TP	Φ		2786.97
F5	001-64-58-TP		68.4313	2707.43
FSR			268.4313	2707.43
BSR			179.5958	2786.31
..				

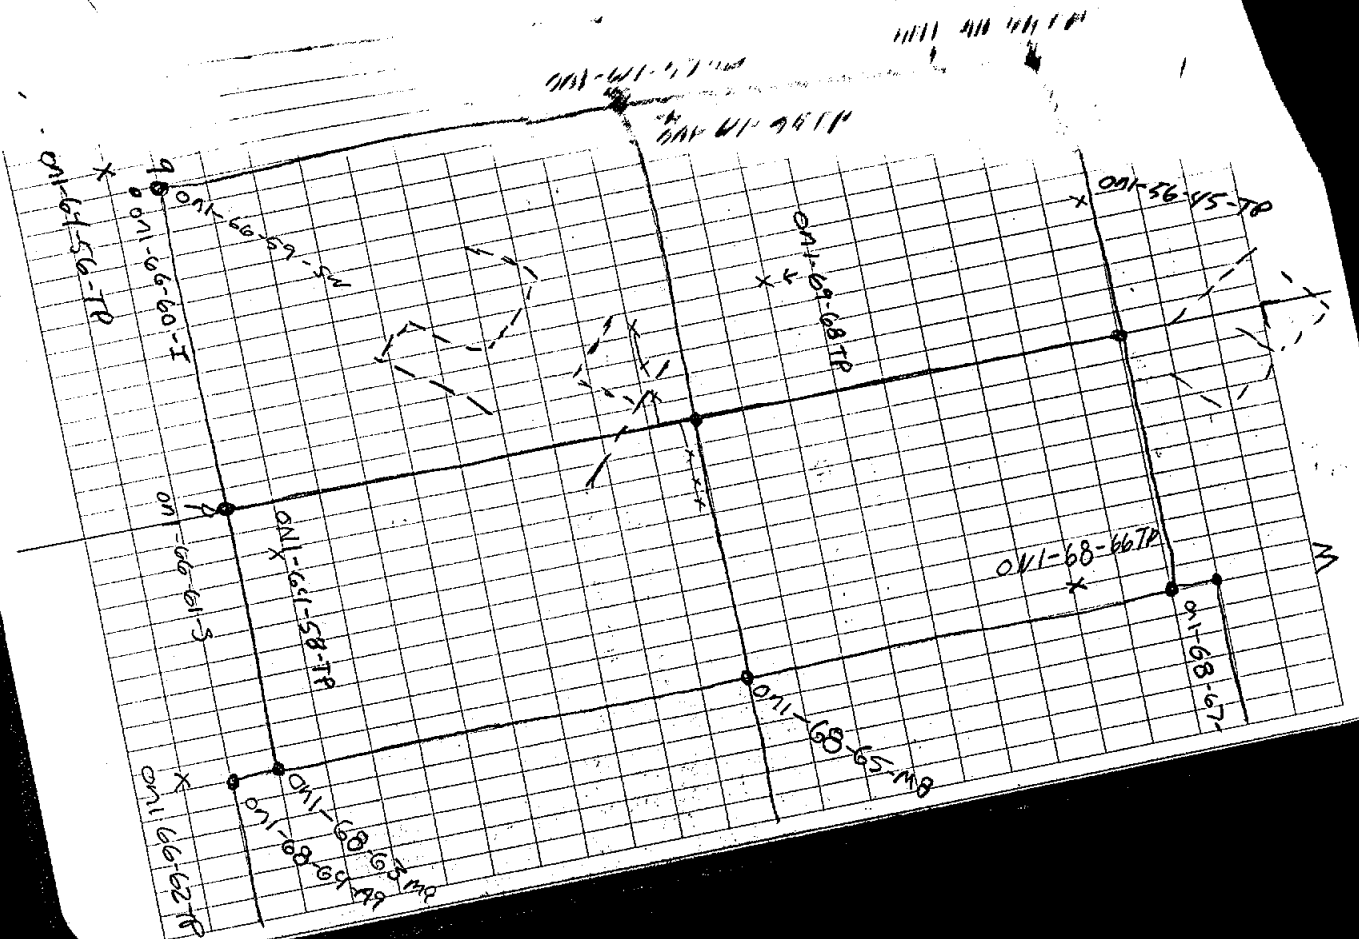

NOTE 6-19-03

67

DURING TRAIL OF SEE 24 FOUND
Double cornered AT K-09
checked all w.t. They all point
TO OUT AT #01-66-59-SW
we found the other iron #01-66-60S
ON 48-86413 called Ingham Tramp Point
Fred both of them

AT THE CAS THERE IS 1/2 COPPER IRON
THIN 2" SOUTH IS FENCE CORNER W/ FENCE
going EAST THIN 2" SOUTH IS THAT
IF another fence corner w/ fence
WEST

AT THE CAS IS FID 1/2" IRON
AT FENCE CORNER

	DO	JR CN	6-19-03	650	Cloudy	
X	01-64-56TP					
BS	01-64-55TP					
FS	01-66-59SW					2786.96
						34.0932 71.59'
X	01-64-56TP					
BS	01-64-55TP					2786.96
FS	01-66-60-S					80.3312 6.17
X	01-64-58TP					
BS	01-64-56TP					
FS	01-66-61-S					2707.435
						347.1459 67.45
X	01-64-58TP					
BS	01-64-56TP					
FS	01-66-62TP					2707.43
						181-0904 2369.865
FS						01-0908 2369.865
BS						179.5953 2707.43

08	DD - Jra - CN	65°	sunny	6:19.03
T	001-66-62 TP			
B5	001-66-58 -TP	0		2569.86
F5	001-68-63-M09	86-39.35		11.99
F5	001-68-64-A-09	85-31.58		8.71
T	001-66-62-TP			
B5	001-64-58-TP	0		2569.90
F5	001-68-65-M08	89-26.59		2668.37
F5R		269.26-51		2668.37
B5R		179-59.54		2569.88
T	001-68-65-M0			
B5	001-66-62-TP	0		2668.38
F5	001-68-66-TP	179-33.38		1635.23
F5R		353-33.49		1635.23
B5R		180-00-08		2668.38
T	001-68-66-TP			
B5	001-68-65-M0	0		1635.23
F5	001-68-67-M7	181-30.30		1614.875

	DD, CN, SR	6:19.03	70°	sunny, wind 20mph	69
T	001-66-45-TP				
B5	001-58-46-TP	0		1250.73	
F5	001-68-60-TP	241.2156		2358.74	
F5R		81.2158		2358.74	
B5R		180.0001		1250.73	
T	001-69-60-TP				
B5	001-56-45-TP	0		2358.78	
F5	001-69-69-TP	163-04.57		602.96	
F5R		343 0455		602.965	
B5R		179-59.59		2358.78	
T	001-69-69-TP				
B5	001-69-68-TP	0		602.99	
F5	001-69-70-TP	142-18.17		677.85	
F5	001-69-71-TP	144-22.54		677.85	
F5	001-69-72-TP	146-10.36		67.54	

70					
A	011-57-53	✓			
B	011-58-50	20		2023.64	
C	011-70-25	TP	265-0151	2022.805	
D	011-70-25	TP	85-01-48	2092.86	
E	011-70-25	TP	79-59-58	2023.65	
F	011-70-25	TP			
G	011-70-25	TP			
H	011-70-25	TP			
I	011-70-25	TP			
J	011-70-25	TP			
K	011-70-25	TP			
L	011-70-25	TP			
M	011-70-25	TP			
N	011-70-25	TP			
O	011-70-25	TP			
P	011-70-25	TP			
Q	011-70-25	TP			
R	011-70-25	TP			
S	011-70-25	TP			
T	011-70-25	TP			
U	011-70-25	TP			
V	011-70-25	TP			
W	011-70-25	TP			
X	011-70-25	TP			
Y	011-70-25	TP			
Z	011-70-25	TP			

70					
A	011-70-25	TP			
B	011-70-25	TP			
C	011-70-25	TP			
D	011-70-25	TP			
E	011-70-25	TP			
F	011-70-25	TP			
G	011-70-25	TP			
H	011-70-25	TP			
I	011-70-25	TP			
J	011-70-25	TP			
K	011-70-25	TP			
L	011-70-25	TP			
M	011-70-25	TP			
N	011-70-25	TP			
O	011-70-25	TP			
P	011-70-25	TP			
Q	011-70-25	TP			
R	011-70-25	TP			
S	011-70-25	TP			
T	011-70-25	TP			
U	011-70-25	TP			
V	011-70-25	TP			
W	011-70-25	TP			
X	011-70-25	TP			
Y	011-70-25	TP			
Z	011-70-25	TP			

72	9-29-03	Sunny 50°	DD/cw
	CO5 13		
	Found 1/2" team in fence line E/W/S		
	Replaced with 3/4" x 3/4" team + Runner		
	CAP stamped 31602 course post		
	IS gone		
	FD Nail + Plastic TAG # 231		
	1 The 5/5 8" Tripper marble		
	N 30°W 9.45'		
	SET Nail + CAP # 31602 E/S 15" oak		
	North 17.02'		
	SET Nail + CAP # 31602 E/S 8" marble		
	South 50 West 14.19'		
	SET Nail + CAP # 31602 S/S 24" checker		
	N 45°W 28.78'		
	SET Nail + CAP # 31602 W/S 10" Hickory		
	N 70°E 37.43'		

	9-29-03	50° Sunny	DD/cw	73
	K-06			
	SET 1 1/2" R.R. 10' long with Runner			
	CAP stamped 31602 in man box			
	in E Rd RTRN to Page 51 M.S			
	Book			
	FD NUT # 28414 E/S 36" Elm			
	N42 302° 2860'			
	FD NUT # 28414 E/S 20" marble			
	N42 199° 61.76'			
	N4/cane of 2' x 2' conc nail box			
	N42 136° 17.01'			
	SET Nail + CAP # 31602 S/S PP			
	N42 273° 52.01'			

6-19-03	DD 5 ^{PM}	
L-8		
		SET STANDARD REMON CAP ONE 3/4" X 24" PIPE
FD		Nail & Tag in South Side 15" Maple N/AZ 310° 8.3'
FD		Nail & Tag in West Side Railroad Tie Post N/AZ 205° 2.20'
FD		Nail & Tag w/ 5 36" OAK N/AZ 150° 44.44"
FD		Nail & Tag w/ 5 10" OAK N/AZ 175° 48.50'
		Fence TO THE EAST SOUTH 2.2' Fence TO THE WEST 50 FT 4'