

740 31 27 14 APR 05

27				ON-7
A-13				
B	Field investigation at apparent location of corner revealed a 1/2" Bar at corner location with Jackson County Monument lying on ground Next To it, Fenced area was been bulldozed and Monument was taken out. Checked witnesses and House Corner Maple To West and Ash To North All check. Fnc. Post To EAST is leaning EAST and measures 0.2' Long. Power Pole has been replaced Raser Monument at position of Bar. Accepted Found monument as perpetuation of Corner			
N5T19998	N.S. d Fnc Post			22.50
N5T25837	N.S. d Uric Pole			25.66

30, 31
7-50-
4-11-68
14 APR 68
28

7.99-50 43
4-11

6th 6th 9th

242

265-2.32

12.21.11
 12.21.11
 12.21.11

2652.53

NO 22-28-72

4-17

242.83

West on 5712. Line

US 28414	W. 4, de 13" dmk	1520°E	108.05
----------	------------------	--------	--------

15200

NSF 28414 W. Side 8" Hict

NS50E

NS-T Z5857 NW Side 14' A/c

1560°E

WT 25037 S. Side 16" OAK

3585

3/4" Box & 2 1/4 Alum. Cap (19-2 TNR30)	North	12.25
---	-------	-------

North

14 Apr 05

30.41

30.41

ON-

C-10

Field investigation at apparent location of corner revealed a 1/2" Bar in Conc. Monument in Mon. Box at E inter section Gale & Rossman roads. Accepted found monumentation as perpetuation of corner and CAPPED IT WITH 3/4" ALUM. CAP

C. 1/2" Bar 3/4" Alum Cap in Conc Mon.
STAMPED

NBT 25837 E ROOT 73 MAPLE N 08° W 1965
NBT 25837 W SIDE 28 HICKORY N 05° E 2382
NBT 25837 W SIDE 48 S 10° E 18173
NBT 25837 E ROOT BIRCH S 20° W 7138
NBT 18998 SW SIDE 48 N 60° W 6135
Ingham County Survey Center Mon. 545° 45.40

C-11


Field investigation at apparent location of corner revealed a 1/2" Bar in Conc. Monument in Conc. Collar on E Gale road on occupation line to East. Matching LESTER WITNESSES

C. Core Mon With 1/2" Bar & 2 1/4" Alum. Cap
NBT + N. END CMP CULV. N 50° E 40.90
NBT + N. END CMP CULV. S 80° E 20.60
NBT + S. END CMP CULV. S 70° W 21.30
NBT + N. END CMP CULV. N 40° W 24.54

33

18 May 05

31 12 13 3

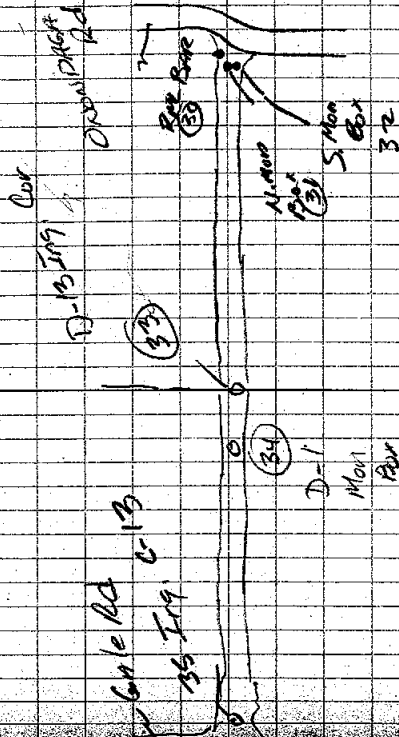

39 11th 1895 20 July 05

13 Found 1/2" B&C 18998 3' South of L
Baseline Road 148.90' East of Conc.
Mon. with Jackson County Remon.
CAP. Accepted Found Monumentation
as Perpetuation of Corner Based
on Previous Excavation and Agreement
with GLO Felling. Replaced iron
with STANDARD Box & PA345 CAP
and Set Mon. Box

39 C-12 4" in Conc. Mo
B. Found 1/2" Box & CAP 18998
in Mon. Box on CENTERLINE G&E
ON Tree Line To EAST. Accepted
Found Monumentation as Perpetuation
of Corner and CAPPED 17 3/4" A
Aluminum PA345 CAP

C, 4" Conc. Mon. with 2 1/4" Alum. Cap
STAMPED PA345 INGLEHART CO. PA345
NET 25837 N. Side 60" OAK 545°E 36.5
" " W. " 21" OAK 515°E 88.8
" " E. " 11" Taper Walnut 520°W 147
" " E. " 7" Hickory 110°W 113

18998 W. Side 40" OAK N 35°E 79.17'
25837 NE Side J.P. 558°E 36.91'
18998 E. Side 30" OAK S 67°W 184.12'
25837 S. Side 10' WALNUT WEST 120.48'
re Monument with Jackson Co Remon Cap (C-175226)
West


41

T	0152-41	-43	E-12	Sac P ₉₄	
BS	00-2-41	-42	R P	FD 1/2	13a-66
FS	0152-41	-44	(E-11)	Sac p ₉	36
BS	000-00	20			
	180-44	08	180-43-48		
BS	180-00	25			
R	00-44	13	180-43-48		
BS	60-20	35			
D	24-04	23	180-43-48		
BS	240-20	36			
	01-04	26	180-43-50		
R					180-43-48

Dist T6	B5 ₄₂	F3 ₄₁
	2062.08	2677.56
	2062.08	2677.58

65-100

21 July 05

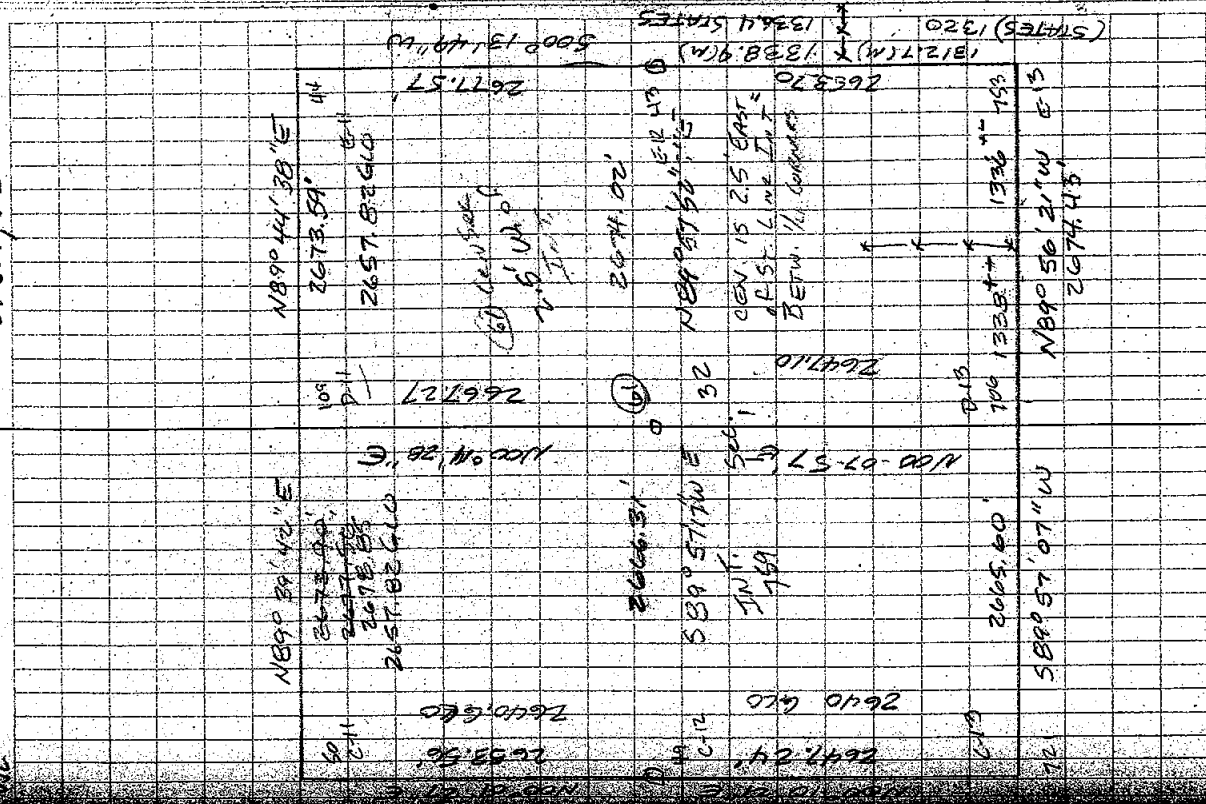

45

T 3839-06-21 C-13 See Pg 39

BS 3839-06-20 C-1

FS 012-45-49 C-12 See Pg 39

00-00-20

90-12-40 90-12-20

180-00-26 175

270-12-41 90-12-15

60-20-30

150-32-43 90-12-13

240-20-33 "

330-32-42 90-12-09 90-12-14

Dist 10 BS 20

FS 49

148.90

2647.24

148.90

2647.24

45

T 200 21 July 05

T 200

T 200

T 200

T 200

T 200

T 200

T 200

T 200

T 200

T 200

T 200

T 200

T 200

T 200

T 200

T 200

31.22

0.40

0.40

Grave Rd

h

BASELINE Rd.

h - Haperoff Rd

ON-2

K

53

for

12

SS ON 1 - 46-50 (C-11 Sec pg 31

02-00-00 552

21-15-641 179-51-12

179-51-02

7 359-51-72 179-50-52

03.02.09

240-11-45 179-56-15

257 240-70-35 179-51-10

5	60 - 11	- 40	179-51-08	179-51-0
---	---------	------	-----------	----------

DIS-10 35A

FS 50

52.2792

715 23012

52.792

1535

1900

 $\pi_{N,k}$

46

21-July-05

25

9

1000

५

10

①

1 Eagle Rd

10/2/20

49

T ONZ-46-50 (C-10 See Pg 31)

BS ONZ-45-49 (C-11 See Pg 31)

FS ONZ-49-51 (B-10 See Pg 47)

FS ONZ-49-52 (R, P ^{SET NAT IN CIL GREE RD} ON 5TH WALL LINE MSE 4500)

BS 000-00-20

51D 179-50-57 89-47-15 89-46-55

52D 179-50-57 179-50-37

BS 180-00-20

51R 269-47-23 89-46-57 89-46-58

52R 359-51-03 179-50-37 179-50-37

BS 60-20-30

51D 150-07-33 89-47-03

52D 240-11-09 179-50-36

BS 240-20-37

51R 330-07-33 89-46-56 89-46-59 89-46-57 89-46-57

52R 60-11-16 179-50-39 179-50-37 179-50-37

DIST

BS 60

FS 51

FS 52

2665.07

2666.40

1617.31


2665.06

2666.41

1617.30

DLC SWN

7-16-05

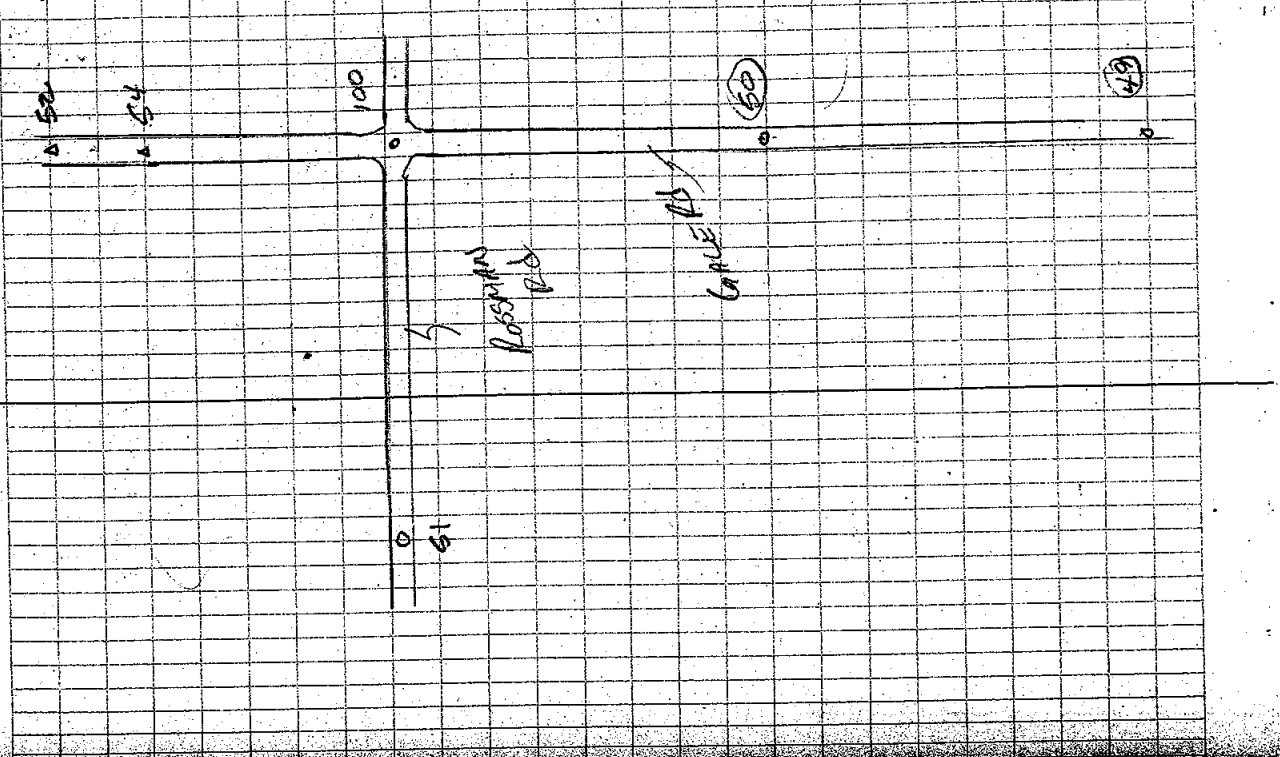

9-16-05

DLC
SWN

Beile Rd

GALE Rd

1055 MA N 140

GO

T 002-44-52

BSON 2-40-8100

FS ON 2-50-53 (E-9 Sea P 47

- 54 (POL B PNC line

B50 000-00-20

S30 179-54-07

B50 180-00-28

S30 359-55-15 179-54-45 179-54-47

B50 60-20-30

S30 240-15-21

B50 240-20-41

S30 60-15-26 179-54-45 179-54-47 179-54-47.5

B50 60-15-26

S30 1617.29

B50 1617.29

Dist To

B50 179-54-45

S30 1035.35

B50 1035.35

S30 631.01

B50 631.01

FS 53

FS 54

FS 55

FS 56

FS 57

FS 58

FS 59

FS 60

FS 61

FS 62

FS 63

FS 64

FS 65

FS 66

FS 67

FS 68

FS 69

FS 70

FS 71

FS 72

FS 73

FS 74

FS 75

FS 76

FS 77

FS 78

FS 79

FS 80

FS 81

FS 82

FS 83

FS 84

FS 85

FS 86

FS 87

FS 88

FS 89

FS 90

FS 91

FS 92

FS 93

FS 94

FS 95

FS 96

FS 97

FS 98

FS 99

FS 100

S3	ONZ	DLG SWN	TUNIK	TUES	S3
T	57				9-16-05
DS	55				
FS	ON2-53-58	(A-9	AND	Dec	Pg
DSO	000-00-20				
S8D	177-30-00	177-29-46			
DSK	180-00-27				
S8R	357-30-09	177-29-42	177-29-44		
DSO	00-20-30				
S8D	237-50-16	177-29-46			
S8R	240-20-38				
S8R	57-50-25	177-29-47	177-29-46	177-29-45	
Dist To	BSSS	FS 58			
	2327.52	485.41			
	2327.52	485.41			

S3


TUES

TUNIK

DLG SWN

ONZ

S3

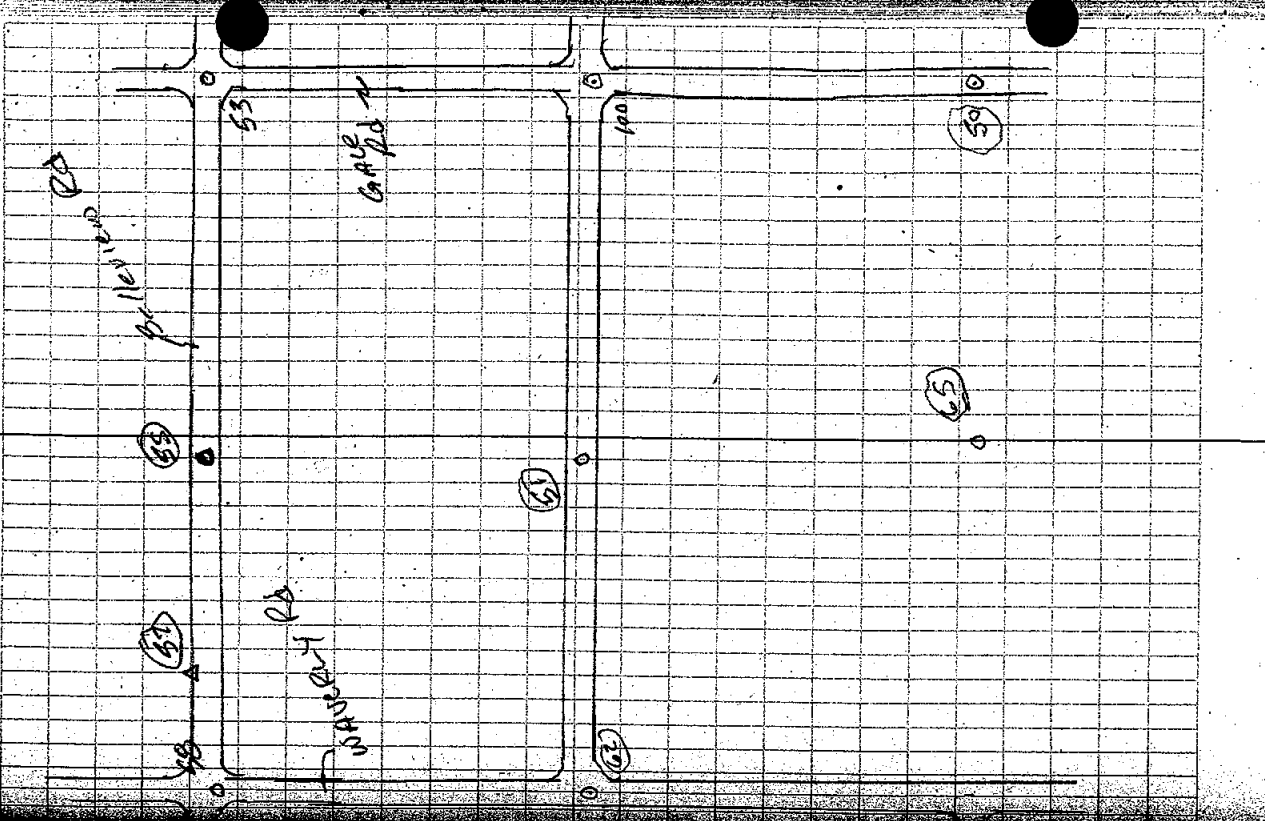

18

B-13

Field investigation at apparent location of corner revealed a 16" Bar & CAP in E-W Fence 1 mi. on Old Fence & Stone Row To North 11' East of CAR FRAME FENCE POST. ACCEPTED FOUND MONUMENTATION as perpetuation of corner Based on Old Roman Traverse and Lester Reasonings of 1979. CAPPED Iron with PA345 Alum. CAP.

C. 1/2" Bar 5 PA345 CAP

NBT W. Side	8" Mult-Chang	N 5° E	10.52
-------------	---------------	--------	-------

N 51° W	74766
N 51° E	74767
N 51° E	74768
N 51° E	74769
N 51° E	74770
N 51° E	74771
N 51° E	74772
N 51° E	74773
N 51° E	74774
N 51° E	74775
N 51° E	74776
N 51° E	74777
N 51° E	74778
N 51° E	74779
N 51° E	74780
N 51° E	74781
N 51° E	74782
N 51° E	74783
N 51° E	74784
N 51° E	74785
N 51° E	74786
N 51° E	74787
N 51° E	74788
N 51° E	74789
N 51° E	74790
N 51° E	74791
N 51° E	74792
N 51° E	74793
N 51° E	74794
N 51° E	74795
N 51° E	74796
N 51° E	74797
N 51° E	74798
N 51° E	74799
N 51° E	74800

AST W. Side	11220	2100
AST W. Side 7" OAK	11220	3400

1047 N. Side	15" Cherry	N 89° W	2800
--------------	------------	---------	------

Jackson County Reman	Pipe & Cap West	149.16
----------------------	-----------------	--------

57

Sum

18-11

Field investigation at apparent location of corner revealed a 5/8" x 24" B3C "MAG 39079" at East-West-South Fence INTERSECTION. ACCEPTED FOUND MONUMENTATION as perpetuation of CORNER and replaced it with 5/8" Bar 3C.

C. 3/4" x 20" STEEL BOLTS PA 345 Allen Co.

W57 25837 W.S. de Quinville Maple N11°WS8.38

11 5:55 P.M. 17" Maple N70°E Z 486

[illegible]

"	"	17" Maple	N55W	63.60
"	"	17" Maple	N55W	63.60
"	"	17" Maple	N55W	63.60

SB

π

BS

FS

FS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

BS

C4

C3

C2

C1

C0

C-1

C-2

C-3

C-4

C-5

C-6

C-7

C-8

C-9

C-10

C-11

C-12

C-13

C-14

C-15

C-16

C-17

C-18

C-19

C-20

C-21

C-22

C-23

C-24

C-25

C-26

C5

C6

C7

C8

C9

C10

C11

C12

C13

C14

C15

C16

C17

C18

C19

C20

C21

C22

C23

C24

C25

C26

C27

C28

C29

C30

C31

C32

C33

C34

C35

C36

C37

C38

C39

C40

C41

C42

C43

C44

C45

C46

C47

C48

C49

C50

C51

C52

C53

C54

C55

C56

C57

C58

C59

C60

C61

C62

C63

C64

C65

C66

C67

C68

C69

C70

C71

C72

C73

C74

C75

C76

C77

C78

C79

C80

C81

C82

C83

C84

C85

C86

C87

C88

C89

C90

C91

C92

C93

C94

C95

C96

C97

C98

C99

C100

C101

C102

C103

C104

C105

C106

C107

C108

C109

C110

C111

C112

C113

C114

C115

C116

C117

C118

C119

C120

C121

C122

C123

C124

C125

C126

C127

C128

C129

C130

C131

C132

C133

C134

C135

C136

C137

C138

C139

C140

C141

C142

C143

C144

C145

C146

C147

C148

C149

C150

C151

C152

C153

C154

C155

C156

C157

C158

C159

C160

C161

C162

C163

C164

C165

C166

C167

C168

C169

C170

C171

C172

C173

C174

C175

C176

C177

C178

C179

C180

C181

C182

C183

C184

C185

C186

C187

C188

C189

C190

C191

C192

C193

C194

C195

C196

C197

C198

C199

C200

C201

C202

C203

C204

C205

C206

C207

C208

C209

C210

C211

C212

C213

C214

C215

C216

C217

C218

C219

C220

C221

C222

C223

C224

C225

C226

C227

C228

C229

C230

C231

C232

C233

C234

C235

C236

C237

C238

C239

C240

C241

C242

C243

C244

C245

C246

C247

C248

C249

C250

C251

C252

C253

C254

C255

59
13 OCT 05


7650

301 201

DLC
SWN


ON-2

59					
π	66				
BS	64				
FS	ON-2-59-67	RP SET SPRAT N. EDGE			
	BSN	000-00-20	ANCHOR POST		
67D	89-54-41	89-54-21			
BSN	180-00-22	89-54-20			
67D	268-54-41	89-54-19			
0151 To	FS				
	246.88				
	246.88				

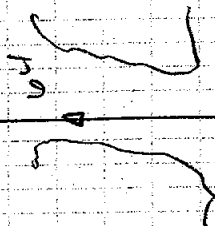

Field Line 66

DRAIN

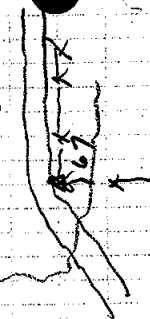

62

T 0N2-2B-69

BS 0N2-60-68

FS 0N2-62-70 (14-12-71 N 232W 570
PA 345 89C 284.4)

00-00-10

180-00-15 180-00-09

180-00-10 07.5

00-00-20 180-00-10

00-00-00

180-00-10 180-00-10

180-00-00 15

00-00-20 180-00-20 180-00-11

Disco

BS

1409.49

1409.49

FS

1242.78

1242.78

DL

X 50K

TGS 30.2

14 OCT 05

62

PA 345

69

68

70

2- WAVELEY

DLG
SWN

31, 32, 33


10-17-05

T 60°

63

X 3839-03-06 (1706) (17345 Day in Mon Bay
 BS 3839-03-06 (1706) (E-I Jackson Co. 8 Apr 10
 FS 3839-06-24 (1706) (500 B&C in Mon Bay E-13
 FS ON2-63-771 (1706) 6-21 Ser NHT 850
 BS 000-00-20 (Base line on W. Wall 60
 Hse # 6221
 710 179-51-05 179-50-45
 BS 180-00-27
 712 359-51-12 179-50-45 179-50-45
 BS 60-20-30
 710 240-11-15 179-50-45
 BS 240-20-39
 712 60-11-25 179-50-46 179-50-45
 179-50-45-25

011776 BS FS 71
 2518.58 2665.76 FS 72
 2518.57 2665.76 2167.64
 2167.64

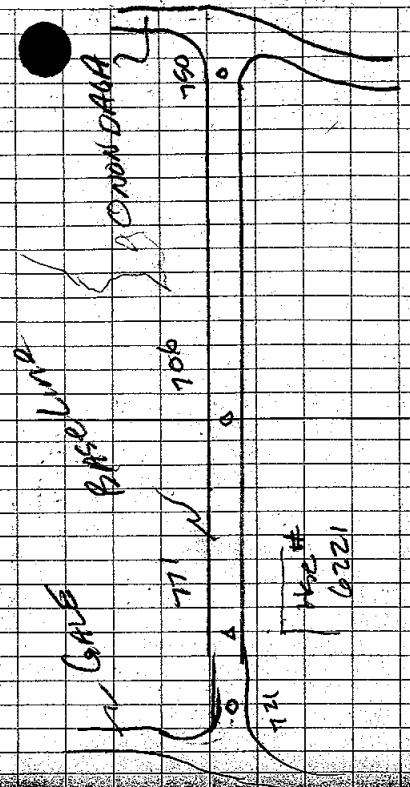

64

T

BS

FS

BS

490

BS

490

BS

490

BS

490

D1570

BS

498.14

498.14

3039-06-721

0N2-43-71

0N2-45-49 (C-12)

000-00-20

270-10-29 270-10-09

180-00-33

90-10-30 270-10-03 270-10-06

60-20-30

330-30-41 270-10-11

240-20-39

150-30-49 270-10-10 270-10-15

270-10-08.25

FS49

2047.23

2047.22


PCC

SND

T.N.K

T60 3,32

17 OCTOS

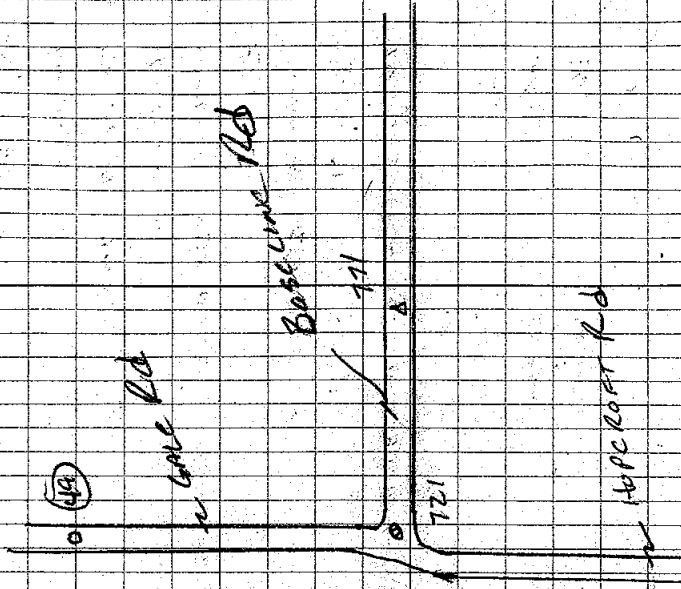

5

X ONZ-48-100'50

BS 012-45-5049

$$P5 \text{ } 002-46 \times 100 \text{ } ^{151}$$

059 000-000-20

1000	180-02-39	180-02-19
------	-----------	-----------

B5c 180-00-77

1000	000-02-49-180-02-22	180-02-20.5
------	---------------------	-------------

60-20-30	
----------	--

52-20-081 55-22-042 0001

350	240-70-91
-----	-----------

1000	60-23-01	100-02-20	100-02-22.5
------	----------	-----------	-------------

1013710	BS 49
---------	-------

1013710	BS 49
---------	-------

2653.56

2653.55

5

59

FS	0N2-65-72	(R.P. Set 8" Spk 11)	Bamford
----	-----------	----------------------	---------

BSO	000-00-00
-----	-----------

F2D 180-40-76

B50	120-00-13
-----	-----------

722	100-40-37	100-40-24	180-40-25
	100-00-13		

216470 FS 72

1042, 48

1042.48	1042.48
---------	---------

DLC Swm

02-2

SWAN TADIE

7606

17 Oct 05

205-1177

研

050

14

67

B-12

Field investigation at apparent location of corner revealed an Anchor Post on Fence From Spur 10' South of E Drain. Trv. of Station revealed That Post was 2' East 88' South of Intersection 1/4 Lines. Tied Good 1/8 Line Occupation East West And This Locates Corner 10' North of Anchor Post. Set Location of corner in E Drain 10' North of Anchor Post. Set STD. BULL CAP as Witness Monument 10' South of Corner at Edge Anchor Post

ON Review of Traverse Witness Mon.

15 7.76' South of Actual Corner

N 37° 26' 37" S. Side 12" Ash	N 81° 0' E	28.83'
" " " E. Side 14" Ash	S 12° 0' E	16.46'
" " " " 40" Maple	S 41° 0' W	6.07'
" " " S. " 10" Ash	N 69° 0' W	35.90'

DCC
90° N

ON-12

T400

17 OCT 05

67

(99)

of E Drain. Trv. of Station revealed

That Post was 2' East 88' South

of Intersection 1/4 Lines. Tied

Good 1/8 Line Occupation East

West And This Locates Corner

10' North of Anchor Post. Set

Location of corner in E Drain

10' North of Anchor Post. Set

STD. BULL CAP as Witness

Monument 10' South of Corner

at Edge Anchor Post

ON Review of Traverse Witness Mon.

15 7.76' South of Actual Corner

89-52-25

2815.68

65

2649.99

89-54-09

2649.99

2815.68

300.3

1925.9

+1193

2815.68

(100)

2649.99

1325.54

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

2649.99

108

2005

ESE

DLL

WJL

SWN

Engg. R.

Engg. Surveying & Engineering

DAVE CLIFFORD PS 25837

JARRAD LA ROSE SURVEY TECH

SAM NORDER SURVEY TECH

Surveying Contract

PS 25837

LA ROSE SURVEY TECH

SURVEY TECH

BEC

NAT

SEN 1/2" BAR CLAP - TRAV. PR.

SEN 200 NO. 12 TAG 25837

SEN 1/2" BAR CLAP - TRAV. PR.

SEN 200 NO. 12 TAG 25837

28409

ON 2

29 Nov 05

68