

SOKKIATM

TRANSIT
FIELD BOOK

No. 8152-00

Index

1	G-3 Summary	record info & recovery report
2	G-2	Do
3	G-1, G-13, T2N, R2E	Do
4	F-3	Do
5	F-2	Do
6	F-1, F-13, T2N, R2E	Do
7	E-3	Do
8	E-2	Do
9	E-1, E-13, T2N, R2E	Do
10	D-3	Do
11	D-2	Do
12	D-1, D-13, T2N, R2E	Do
13	C-3	Do
14	C-2	Do
15	C-1, C-13, T2N, R2E	Do
16	G-3 Cont.	Do
17	The Occupation to verify F-1	
18-26	Trav. Sec. S T1N, R2E	
27	Check Trav. Distances	
27	Tie Fd. 1/2" B&C @ D-3	
28	Tie C-3	
29-30	The Occupation lines S line	
	Sec. S.	
31	1994 Contract	Monument to town Surv.
	Notes & Abbreviations	

①

STI

G-3 X

Original Post Set By Joseph Mungler

Nov. 17 1825

B. Oak 14" SGE 17 1/2

B. Oak 5 11/12 W 39

2 John Young - Supposed Co. Surv. Surveyed

Sec. 3 in 1878 - Unmarked G-3

Y.O. 6" 1/25 14W 5345 (35.0')

Y.O. 6" 11/12 96 " (63.4')

COENNE RECORDED B. George Young

T. 17640 in Jun 1872 L 1 P 627

as Set 5/8" Steel Bar on E Bush Rd

same Line East and West after

Excavation and finding nothing.

SGE 44.54 spike in 18" Walnut

WWD 21.67 spike in 8" Oak

East 39.75 spike in 18" Oak

DLC 740° 16 APR. 94 ①

Corner used in survey recorded in

L 1 of Survey pg 342 By G. Young

with same man & witnesses as

A-2

George Young again used in Surv.

Recorded L 2 pg 319 Same man

as witnesses as A-2

Corner used by A. Williams L 5 = 21275

in Surv. Rec in L 3 pg 369 Same as A.

George Young L 2 pg 346 same as A-2

Ben Enon RECORDED for in L 7 of same pg 352

as a found 3/4" 3/4" proved to correct

same for as corner recorded by

George Young by using 2 of Youngs

witnesses - Field work performed by

John Surayer

W. F. Cap 25.37 in 8" Hick. N 40° E 40.0

W. F. Cap 25.37 in 18" Oak East 39.68

W. F. Cap 25.37 in 18" Walnut 53.05 44.55

W. F. Cap 25.37 in 14" Oak 52.05 33.85

Cont on Page 16

ST1

G-2 -					
ORANGE POST	Set E	Joseph			
Wander D's in Nov. 1885					
7 Oak 20" S&E	50				
W Oak 3 5735	55				
2 Corner Use By T.J. Brown	Co. Surr.				
10 Oak 1879					
3. J. Yocum Surr. in 1878 - Unrecorded					
Iron W.O. 12" N49E	3745	(244'			
W.O. 20" 572W	5545	(363			
74 - 60' Young 2	533	601 76.			
- F.J. Anchor Post					
Spk in 24" OAK	5.E. 49.60				
Spk in 30" OAK N.E. 23.70					
Spk in 8" Cherry	CHUCK 23.25				
5 Ht 132 G. Young	L1 R 34Z	5000	Handed		
	L2 R 819	"	"		
	A. Williams L3 R 309	"	"		
7 Cor. Recovered R. D. Clifford	During Super				
Collides Project Fd Copied from #1657422	Arch				
Spk in Birch	W.W. 22.25				
Spk in Birch	W.O. 20.75				
Spk in 30" Oak	Stump N.E. 23.70				
Spk in 24" OAK	SE. 50.00				

DLC

JP

740

16 APR 94

(2)

18 Apr 132 E. Antelope	Super Collar	Post
45 Apr 790-793	812-831, 840-845	
Oct 1983	Some place of witness as in Iron?	
R Helsel Oct 93	47P 23.24	
Some place of witness	Witnessed in Iron?	

Searched @ Apparent Location of Corner and Found 1/2" Box w/ cap #13574 @ South Base of Anchor Post WITH ALL of My 1988 witnesses still standing. The 36" OAK Stump in The N.E. Quad is almost certainly Yocum's 1878 witness. Pulling 24.4' from the point that would have been the face of a 12" Tree whereas the Post @ The South Base. EXCAVATED all around Post and found only staves. Excavated Post as Camp and replaced 1/2" B&C w/ STAMPED B&C Set N4T #25837 in W. Side 18 28 Cherry 320 20.62 in N. Side 18 4.7 OAK 116 50.50 3. 14 3.75 Cherry 296 22.70 5. 14 6.35 24" OAK 274 44.25

NC
PIN

3 Sep 94

(3)

ST1

4-1 Post Set by Joseph Wampler DS.
 Olegno 1825 with the following
 in NW. 1825 with the following
 Tnt. N. Bdy. 1744k (W. of Post
 Aspen 10" 55701 143
 6-13 White Oak DS
 Original Post Set 5
 18
 Tnt 9 1704k 103
 " 15 14001 229
 1) Corner Used By T. Brown Co. Saw in
 Jan. 1858
 Aspen 12" 55701 143kts - No dir
 W. of Post Co. Saw. Found old Post in
 Oct 1895 and proved from S. W. Cor
 Sec. 34 White Oak.
 1800 Witness W. Oak 8" N 80° E 8534
 4-13 Tnt R 2E 3/4" Pipe 5 18345 Cap
 3 25837 in S. Bank Drainage ditch
 3 N 41° in E. Side 18" Maple STUMP 225 12.3'
 N 41° in W. Side 12" Maple 168 6.15
 N 41° in S. Side 18" Maple 90 34.65
 N 41° in N. Side 8" Maple 134 35.25
 3/4" Pipe 4 18345 18337 (4-1) 268 114.81

6) 4-14 R. Engr. 184. 55 67 1875
 I did find work for this reservation
 Set 3/4" Pipe on Township line using
 Fence corner 6.65 S. of Lin =
 4 1/4 Con fo South to East. Post.

N 41° 25837 in 26" Oak 1830° E 34.65'
 N 41° " in 24" Twp. Map. S. 37.15'
 N 41° " in 26" Oak W. 10.00'
 1/4" Iron Pipe S. 6.65'
 3/4" Iron Pipe (6-13 Tnt 1825) East 114.81'

7) At 132 N. Ant 1/4" at 88 L-S 18316-83,
 183 330-331 183 800-803
 Some Run built across as Iron &
 B. Searched 3' Ed. 3/4" Pipe. Accented
 1 183 Cor 4 Capped 1842

N 41° T 25837 in S. Side 26" Oak 270° 10.00'
 S Side 27" Oak 50° 30.90
 E Side 30" T. Maple 182° 33.45
 1/4" Iron Pipe in Fen Cor S 180° 6.65 S
 3/4" Pipe 4 18345 1835837 Cap 88° 114.81'
 at Drainage Ditch East 95'

← 5' S. & Drainage Ditch
 20° E " " "

ST-1

F-3 X

Original Post by J. Olmstead AS

in No. 1825

TAM 4 S88 1/2 E 5

TAM 11 N5 E 9 1/2

Covey Used By A. T. Drake Co. Survey

in Jan. 1882

TAM 4" N88 3/4

TAM 5" N84 1/2

DCC
JP

16 APR. 94

(4)

R. H. H. 1825 May 1892 26 pg 1287

No mention made of witnesses

G) 1844 Sept 93 27 pg 28

No mention made of witnesses

Searched APPARENT Area of Corner

Found 3/4" Pipe Buried in Drain Spoil

Bank in Very Very Old E-S Fence Line

Probed entire Area (All Dry Muck) & Found

Nothing More. Accepted Pipe as Repetition

of Corner & Set STANDARD Board Cap on Top.

Set N 47° 25837 in E Side 5 1/2" Maple 346 8.57

" N.W. 11° 11" Cherry 47 19.25

" N. 11° 24° Oak 86 13.31

" E. 11° 7" Cherry 136 19.57

North To E Drain 15'

West To E Drain 10'

A-774 D.C. H. Wood Dec 88 27 pg 72

Ed 3/4" Pipe at Very Old E-S Fence Co.

Spike in 8" Cherry NE 19.5'

Spike in 24" Oak East 13.5'

Spike in 6" Cherry SE 19.3'

A-132 E. Arnold 22 Jan 39 23 pg 788-791

Same Mon. & Dist. as Item 4

⑤

F-Z X

0167 Set in Original Government Survey

ST1

② Corner Set by T.J. Brown's Co. Survey, 1907

in Oct 1879


Row 20 N85° 25' W

West Parallel

8.16 chs.

SKETCH OF
Brown's Survey

NORTH

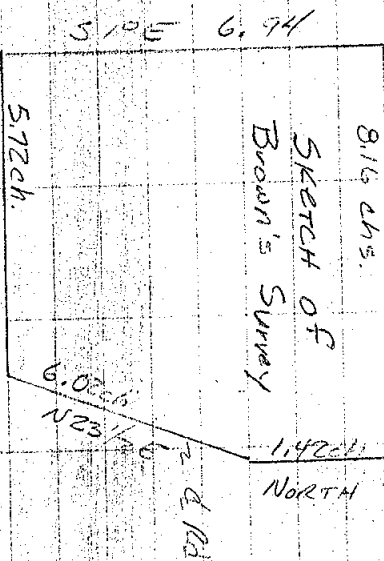

N89 1/4 E

③

② Act 74 O. Boss Aug 72 L2 pg 29

Ed 1/2" Iron

S 20° E 6.47' N. Side 12" Cherry

S 67° W 7.61' N. Side 12" Db. Oak

N 85° W 34.86' N. Side 16" Hickory

DL
SP

740

16 APRIL 94

⑤

⑦ Can recover by this Surveyor during
Superior Collision Report - Jun 1988
Ed 1/2" Iron w/loop 13574 ed 34.95
Some witnesses as item 4 except allow
to 1/4" 25837

⑤ Act 132 O. Boss Aug 72 L1 pg 465

Survey more full - 135 items 4

⑥ O. Boss Apr 73 L1 pg 742 Same as item 4

⑧ E. Act 132 Oct 188 LS 812-815 Super Coll.

Survey more full as item 4

⑧ M. McKen L6 pg 321 Nov 1890

no marker, more on witnesses

⑩ R. Helser L6 pg 1207 Nov 1892, 17929 ed 13

Some more witnesses as item 4

Searched Area of Corner & Ed 1/2" Bar Flag #
1367 in rotted off base of Anchor Post
Excavated around & accepted B&C and Set

STANDARD B&C on Top.

Ed. N.T. #25837 in W Side 16" Cherry Stump 180° 6.47'

Set " " in N. Side 575 22" Db. Oak 120° 6.81'

" " " " 45" Hick 276 34.91'

" " " " 89 2 1/2" Hick 335 31.37'

" " " " 8" Oak 86 50.25'

F-1 4

ST 1

PLC
J.P.

23 APR 94

⑥

①) NOT SET IN ORIGINAL Government Surveys

②) CORNER SET BY T.J. E. 1853

HOLBY 10" 574 1/2 1946
W. CORN 22" N21W 44 1/4 1/2

③) SET BY R. ENGEL JUNE 88 17 1/2 71

FIELD WORK BY MYSELF during 1985.

SET COR. IN PLOWED FIELD MIDWAY BETWEEN

Sec. BOUND on TOP LINE

1 1/4" PIPE

N4T #18998 IN 15" OAK EAST 113.43

N1- #25837 IN 15" ASH NDBE 178.3

N4T #25837 IN 12" OAK 545E 201.35

ICSE CONC. MON (F-13, 724 (P3E)) E06+151.80

④) SET 132 B. ANTILLAS 0+93 45 1/2 314-315,
0+0-321 FOR SUPER C&H. SAME MON 4 WITH
25 1/2 MON 4

SEARCHED AROUND F-1 1 1/4" PIPE ON
FIELD SEPARATION LINE AS RECORDED
TIED ONLY EXISTING OCCUPATION (N-S
1/4 LINE FROM WHICH ENDS FRACTIONAL
1/4 MI SOUTH OF TOWNSHIP LINE)
OCCUPATION AGREES WITHIN 2' EQU
OF MONUMENT. ACCEPTED 1 1/4" PIPE
AS CORNER AND CAPPED WITH #3345
PS #25837 CAP.

SS N4T #25837 IN	S. SIDE 21" OAK	92°	118.50
" "	" " N. SIDE 18" OAK	179.15	
" "	" " N. SIDE 17" OAK	117°	202.00
CONC. MON - F-13 - WHITE OAK		92°	151.80

F-13 WHITE OAK

FD. CONC MON IRON BENT 8" OUT OF ROAD

CUT OFF TOP 10" & CAPPED

N4T #25837 IN S. SIDE 21" OAK 270° 33.40

N4T #25837 IN W. SIDE 17" OAK 189.49 91.65

N4T #25837 IN N. SIDE 18" ASH 166° 24.41

N4T #25837 IN N. SIDE 18" ASH 164° 50 76.44

1 1/4" PIPE F-1 STOCKBRIDGE 272° 151.80

ST 1

E-3 k

Original Post Set By W. D. Humphreys in Nov 1825

W. OAK 22 586 E 30

E. OAK 17 546 W 30

② Corner Used By A. Jackson Co. Surv.

in Jan 1854 Vol 2 Page 209

W. OAK 22 586 E 30

W. OAK 17 546 W 30

③

② At 74 A. Williams Jan 80 66 P 50

Fd. 1 1/2" iron rod @ N-E-W Anchor Post

N 1/4 T 10" W. H. Cherry 505° E 14.39'

N 1/4 T 30" OAK 545 W 25.28'

N 1/4 T 14" W. H. Cherry East 25.52'

③ On Recovered By D. C. 1/2" rod during Super

3011 Project + 1/2" iron @ Anchor Post

Some witnesses except they are the

N 1/4 T #25837

DLC
PJM

TDP

30 May 94

⑦

② At 132 M. Hopkins July 81 65 pg 1136

Some more 4 witnesses as item 5

⑦ At 172 R. H. H. Co 493 47 pg 29

Some more 1 witness as item 5

Fd. 1/2" Iron @ N. Post Teller Down

Anchor Post - EXCAVATED All around

and found Much Broken Drain Tile

Replaced 1/2" Bar w/ STAINLESS STEEL

N 1/4 T #25837 in W. Side 13" Cherry 165° 14.19'

" " " N. Side 8" Twp. Cherry 84° 35.14'

" " " S.E. Side 36" OAK 238° 25.38'

" " " North Side 22" OAK (DB) 292° 29.95'

ST 1

E-2 4

① Original Post set by J. Wampler DS in

Nov. 1825

B. Oak 9 356 ± 8

" " 5 N 40 26

③ Corner Used by A. Jackson Co. Survey

10 Aug 1846 with some witnesses

as 640

③

③ Act 74 D Clifford Jul 83 LT 70 65 (approx. coll)

FD 3" Pipe @ fence corner - mooting

probably remains of 640 by fence

NET #25837 in 15" Cherry Post 28320

" " 20" B. Oak 5450 7.50

" " 30" B. Oak 4845 8.45

LARGE Swamp 14900 14.0 (Prob. 640 by Tree)

③ Act 132 R. H. Hise Oct 93 LT 70 28

Some more witnesses as 14900 4

RLC

P. 11

T 80

30 May 94

③

Sounded at area of corner and FD

2" Pipe @ 4 way Fern Tree - Swamp

Sounded at 640 by corner, 14900

Also almost entirely determined

Excavated all around and found

general map of the mill fence Post

Stone. Excepted 2" Pipe as corner

Set STORMED B3C HP in Pipe.

Set NET #25837 in BWS 140 20" Oak 2360 7.46

" " " " 5 Side 14" Hick 2500 11.09

" " " " 5 Side 38" Oak 270 7.46

" " " " W. Side 11" Hick 0 25.56

5" " " " S. Side 18" Cherry 90 27.83

ST1

E-1

Original Post Set By J. Wampler D.S. in

Nov. 1855

Int. N. Bdy 296 LKs (1944) W. of Post

TAM 7 557W 19 1/2

" 8 546E 41 1/2

DE-13 White Oak

Original Post Set By

18

TAM 5 N58E 17

TAM 6 N43 1/2 W 38

E-13 White Oak used By A Jackson

in June 1854 with same

witnesses and Cite

W.A. Lowe Found old Post at E-13 White

Oak in Oct 1895 and used 17

(9)

16474 114" Pipe 27m E

1 1/4" Pipe Set @ Base of first corner Post
to South - actually no 1st post here

Just remains of 1st to South

15" Pipe 58T E 33.3'

20" Maple 113.5E 13.5'

18" Maple 114.5W 29.15'

1 1/4" Pipe (E-13, T21-R2E) East 195.3'

Copped (Geo Felling)

Copped Pipe

NAT

104T in Top 24" Maple Swamp 34° 15.60

104T E. Side 12" Maple 330° 32.66

104T S. Side 14" Maple 82° 30.05'

E-13 T21 R2E

Copped Pipe @ E-13 N Wampler Post

24" Maple 1755

T21 15' Maple 170° 32.15

E-1 14 1/2' 290° 28.90

Copped Pipe (E-1 T21 R2E) 268° 195.36'

NST N. Side 8" Maple 240° 31.55

NST W. Side Top 18" Maple 170° 32.15

NST N. Side 10" Maple 100° 31.9

ST1

D-3

Original 1 Post Set By J. Wampler DS in

Nov. 1825

W. Oak 16 N88 1/2 W 22

W. Oak 12 N72 E 17

Cover Used By A. Jackson Co. Surv.

in Jan 1854 1st & P. 207

W.O. 18 N88 1/2 W 22

W.O. 12 N72 E 17

B

3. Searched at apparent location
of Cor. 2 Fed. 1/2" B&C (Guttenkunst)

in drainage ditch. Traversed

all of Sec. 5 and tied in all

occupation lines that could

notably be related to position

of corner and found that B&C

was best possible location for Cor.

DC

PM

3 Sep 94

(10)

A. 1 1/4" x 5' GALV. Pipe for PASSUS cap


AS 25037 in drainage ditch

NET 25837 in N. Side 20" Willow 219° 1170"

E. Side 9" Oak 249° 1685"

E. Side 19" Poplar 317° 1320"

S. Side 14" Poplar 82° 2160"



D-2

Not Set in Original Government Survey

ST1

2) NEVER SET By A. Jackson Co. Survey,

in Aug 1846 Vol 1 pg 207

V. ONE 6 N56 1/2 W 28 1/2 (14.85)

Y. ONE 8 N13 1/2 W 16 1/2 (10.91)

Searched @ Apparent location of
 Cor & Ed squared off wood post
 in Depression 2' S. of E-W Fence
 on tree line E-W, EXCAVATED
 and found ring of stones around
 post. Accepted wood post as
 perpetuation of corner & set standard
 1941 on N.S. side

C. 3/4" x 24" steel bar and PP345
 Cap PP25037 @ Railroad Post

NRA

1941 25837 N. Side 22" ONE 271012.85

N Side 18' ONE 89° 2.7

E. Side To 8" Maple 380° 30.09

S. Side 5" Maple 36° 43.86

(11)

ST 1

D-1

Nbr Set in Original Government Survey

② Corner Set By U.H. Rouse Co. Surveyor

in Oct 1895 Run on an

UNRECORDED Survey in the NW 1/4

1/4 of Section 5 - Field Book 15 pg 36

See Iron Skirt or Gate Pipe 2.8 chs (1953)

West of S 1/4 Post - Sec 32 White Oak

W. Oak 30" N25E 301 lbs (198.6)

Hick. 8' S16 3/4 E 284 lbs (187.44)

Roue also set Gate Pipe at S 1/4 Cor

Sec 32 White Oak

W. Oak 30" N31 3/4 W 32.4 lbs (211.88)

W. Oak 24" S88 3/4 E 453 1/2 lbs (299.31)

Roue also set Gate Pipe at the S 1/8 Cor

of S 1/4 Sec 32 White Oak 20.1 chs (132.26)

East of S 1/4 Cor Sec 32

③ Cor. Used By J. V. Kearns Timberland Surv.

in 1880 with No Man Mon or witnesses

Measured East 195.36' To Standard Cor

(STANDARD Bar in Ave. Post Hole)

Measured N25E 198.6' To Oak Slump Bar

Measured N32W 211.9' To Oak Slump Remains

From Standard Cor

PC
DIN

14 May 1994

12

④ At 74 R. Lester Jun 73 L2 pg 471

Set 1/2 Cor on Township 17 N Range 10 E

N 1/4 10" side 10" Cherry 154.4' 56.53'

N 1/4 11" side 5" Cherry 155.0' 76.20'

N 1/4 E 5" side 8" Cherry NE 46.12'

⑤ Corner re-recorded by D. Clifford Dwyer

Super Civil project Aug 83

Fd. Fern Post - Hole Dist To NW 1/4

N 1/4 5" Cherry NW 1/4 53.8' 273.05'

N 1/4 15" Cherry NW 1/4 56.53' Dist To S 1/4

N 1/4 12" Cherry NE 46.12' 158.55'

N 1/4 14" Tree SW 1/4 6.2'

⑥ PA 132 R. Lester Jun 73 L1 pg 337

Gate Post 1/4 1/4 1/4 1/4 1/4 1/4

⑦ PA 132 N. Fairly Aug 83 L2 pg 35 same w.t.

⑧ Fd. Apple Post Hole Set Bands Cap

Set N 1/4 25.837 in S 1/4 8" Cherry 318.5' 53.80'

Set N 1/4 25.837 in E 5" 12" Cherry 190° 16.20'

Set N 1/4 26.837 in S 1/4 5" 20" Apple Cherry 38° 46.12'

Set N 1/4 25.837 in E 5" 18" Cherry 0° 56.58'

Set N 1/4 25.837 in E 5" 10" Thompson 314.31'

Set N 1/4 25.837 in W 5" 6" Cherry 28.57'

Set N 1/4 25.837 in W 5" 6" Cherry 270°

Set N 1/4 25.837 in W 5" 6" Cherry 270° 8.63

Set N 1/4 25.837 in W 5" 6" Cherry 270° 11.20

ST1

C-3

① Original Post Set By Monoplar D.S. in Nov 1925

W. OAK 12 N29E 44
W. OAK 8 S8W 54

②

③ Act 74 O. Boss 13 pg 117 May 74

Ed. H. Iron
N75W 21.10' No. 1 S/S 40' Oak
S70E 31.21' No. 1 S/S 14' Oak
N15E 77.35' No. 1 W/S 10' Oak

④ Act 132 O. Boss No. 1 73

Same mon & witnesses as item 3

⑤ Act 132 A.W. Monro Jul 79 13 pg 482

Same mon & witnesses as item 3

⑥ Act 132 C. Young Jul 82 14 pg 588

Same mon & witnesses as item 3

DC
PN

21 May 94

(13)

⑦ Act 132 A.W. Monro Jul 80 15 pg 1137

Same mon & witnesses as item 3

⑧ Act 132 R. Helsel Nov 91 16 pg 828

Same mon & witnesses

1 Boss witness Remaining

Set Wood Hub on Fen Line, Mid Rd & One Remaining W/S

Acclade N1T in S.S. side 18" Oak No. 110° 31.21'

" " in N.S. side 5" Oak No. 220° 32.58'

" " S.S. side 7" Elm No. 282 33.12'

" " W.S. side 6" Hick 160 63.27'

30 May 94

Witnesses of R. Helsel to Bld. Stone Marking, location of Boss Ed. Iron

Ed. Stone & replaced w/strawmarked Bld. Acclade N1T in SW side 20" Oak N42 110° 30.71'

" " W side 8" Hick, N42 185° 62.26'

" " N.S. side 6" Oak N42 285° 32.10'

" " S.S. side 10" Elm N42 290° 33.43'

DL TOS 23 April 94 14
 3P

C-2

① Original Plot Set By Humphreys D.S. in

Nov. 1825

W. OAK 16 N45E 39

W. OAK 36 South 3

② No mention in records of County Sur. Use Pl. W.A. Kame Co. Surv. makes reference to an old unrecorded

Survey in the N.O. 1/4 of Sec. 1

in field notes found in Field Book.

is page 26 in Oct 1845

③ J. Yocum in "J. Yocum's Book" Used Corner in 1878 with no mention of

probably the old unrecorded Survey mentioned by ROWE

④

⑤ Act 74 J. Ross Apr 74 L3 pg 117

Set 1/2" Iron 2 Fen T. 17.

East 14.89 Nov. 1 5/5 10' OAK

North 12.42 April 1 10' OAK

West 25.72 Nov. 1 5/5 12' Hick

⑥ Act 132 O. Ross Nov 75 L2 pg 123

Same corner 5 witnesses 1 found

⑦ Act 74 R. STEADMAN May 1900 L6 pg 6

Set 1/2" pipe of a found piece of

date found surrounded by bookers

crackling.

12" Hick North 10.21'

8' Cherry West 26.26'

10" Hick East 14.07'

(Doc cites Ross's L&R but we didn't find 1/2" iron and says it seems to be 3/4" diameter D.H. location.

FD. STEADMAN 1/2" Pipe & Cap

As.

FD. Acoblade 195 in S. Side 14" Cherry 270° 26.44

" " " " E Side 13" Hick 40° 13.30'

" " " " W Side 24" OAK 28° 34.21

" " " " N Side 11" Hick 83° 14.29

671

C-1

Original Post Ser By J. W. Langley DS

17 Nov. 1895 Int. N. Eddy 323 W. of Post 1

17 562 W 34

53
66
108

C-13 White Oak -

Original Post Set By

148
217
21.44

17 18

W. Oak 30 N 57 W 6

106
6 396

Maple 9 N 58 E 2 1/2

132
132
14.85

W. 14

6 Surv. USE 1452 Corner

1895 (Field Book 15 p. 26) as

Old Post found with no mention of witnesses.

④ J. Yocum in "J. Yocum's Book" used

Corner in 1878 w/ no more trees

1895 in N. side 36" W. O. N. 16.85

1895 in N. side 10" Hick. W. 31 16.49

1895 in N. side 8" W. O. 50 16.09

1895 in N. side 10" Hick. W. 31 16.49

1895 in N. side 8" W. O. 50 16.09

DC

23 Apr 94

15

② Act 132 R. L. L. L. Jun 73 41 p. 277

Sound near of post. 100 ft from S

③ Act 132 R. L. L. L. Jun 73 41 p. 277

Sound near of post. 100 ft from S

④ Act 132 R. L. L. L. Jun 73 41 p. 277

Sound near of post. 100 ft from S

FD 1/2 "Pine @ E-W-N Fan Cor

EXCAVATED all around

Found NOTHING More.

Set Standard Bar 5' Cap on Top

Set NIT # 25837 in W. side 26" Sup Oak 270 16.85

Set NIT # 25837 in NE side 10" Hick 300 16.49

Set NIT # 18993 in N. side 8" Oak 259 6.11

Set NIT # 25837 in W. side 8" Hick 158 14.15

SW Cor. Sec 32 T 2 N R 2 E

Set Standard Bar 5' Cap in Post Hole

Set NIT # 25837 in S. side 12" Hick 98 40.41

Set NIT # 25837 in W. side 8" Hick 190 39.41

Set NIT # 25837 in W. side 36" Hick 217 49.43

Set NIT # 25837 in SE side 22 Sup. Oak 230 27.54

NW Cor. Sec 5 T 1 N R 2 E West 213.00

G-3 CONT.

ST1

B. ANTCHY At 132 SURVIVUS 1888, 1889

L

P

776, 777, 782, 783, 784, 785
786, 787, 788, 789, 790, 791,
791, 792, 793, 794, 795, 796,
797, 798, 799, 802, 813, 822, 823
824, 825, 826, 827, 828, 829

DC
J.P.

T40

16 APR. 94

(16)

WITNESSES	to Found	1" Pipe	4" Pipe	40.02
Set No. 1/4" # 25837 in	13"	Hick	34°	40.02
Set No. 1/4" # 25837 in	23"	OAK	88°	39.60
Set No. 1/4" # 25837 in	58"	W. 61.	152°	44.55
Set No. 1/4" # 25837 in	18"	OAK	164°	39.93
1/2" Box w/ cap # 27456 JHM	90°			35.00
OLD LARGE STUMP	20°			63.6

EXCAVATED 8' x 3' x 3' Hole 30 MAY 94
Found nothing more

The 1/2 1/4 Line Occupation To 1919
 1/4 Cor. as Monumented (F-D)

CT 1


T	51-36-F13	
BS	51-37-F12	
FS	51-17-01 (50' B ⁹ 50' 4' Farm Lane often Li. South)	
BS D	000-01-28"	
ID	189-50-52 189-49-24	
BS R	180-01-28	
IE	009-51-05 189-49-33	
	Merri 189-49-28.5	
Dist To BS		FS
20	28-01-50	90-05-50
E	269-58-00	269-53-50
M	90-01-45	90-05-50
FT	2657.98/.99	114.95/.95
M	810.158/.154	355.077/.077
SD		
HD		1164.94
T	51-17-01	
BS	51-36-F13	
FS	Fen Line South	
BS D	000-00-13	
ID	173-36-42 173-36-29	
BS E	180-00-21	
IE	353-36-45 173-36-24	
	Merri 173-36-26.5"	

DLC
 JP

T 60°
 P 100°

23 Apr 94

(17)

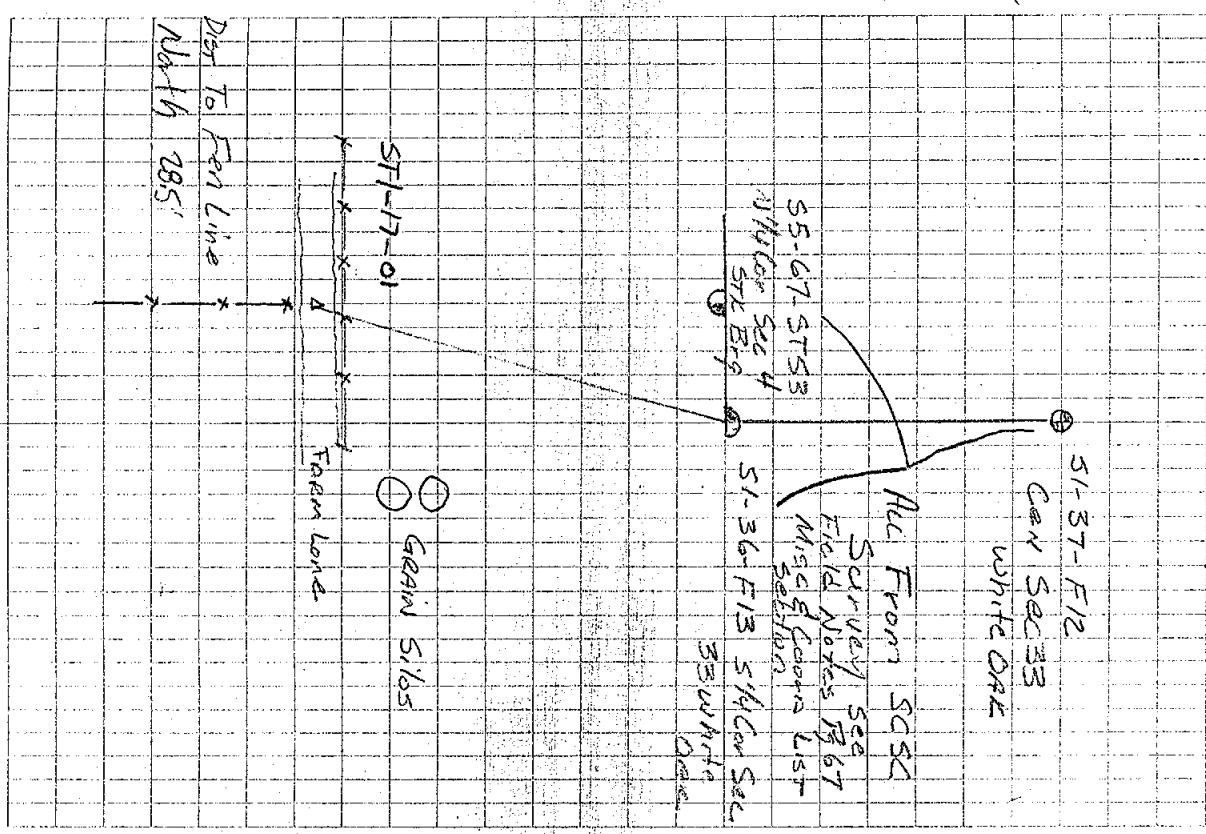

Search for all Trans. PS
521-64-DC7 (Person 604 apt repl
from 52c subd)

for a/c 1901. 173
521-64-DC7 (from God Spk repl)

571

DEC

25

ppat 14 May 94

10

Dasr To 521-63-DC6 (from SSC 5000)

675.97

2131 To 521-65-088 (64 396)

1327.75

1327.15
Rec'd 603 4' 3" Eq Dr.
(205. 4' 2" Dr To 3203"
Rec'd 112" 3' 5" Eq Dr
1 Rec'd 112" 3' 5" Eq Dr

RS	521-65 - DCB	1 RP set Boot splice
----	--------------	----------------------

ST-18-501 (2' long)

ST-18-002 Occupancy Unit

B5 0 60° 00' 00"

CS 7 150° 05' 25" 150-05-25

125 2 180° 00' 05" ✓ 25

330° 05' 30"	150-05-25
--------------	-----------

90-00-08

240-05-33 150-05-43

B5 R 290-00-25 ✓

60-05-40	130-05-13
110-05-150-05-22.5" ✓	

1940-1941

350 90-00-08

249.91-12 207-31-83

~~135 & 276-08-19~~

114-51-23 201-51-01.5"


MEAN CO = 269°58'00" HD =


96° 01' 30"

$$H_D =$$

721.05

ed w/1/2" Bol & RS55837. Two. R cap

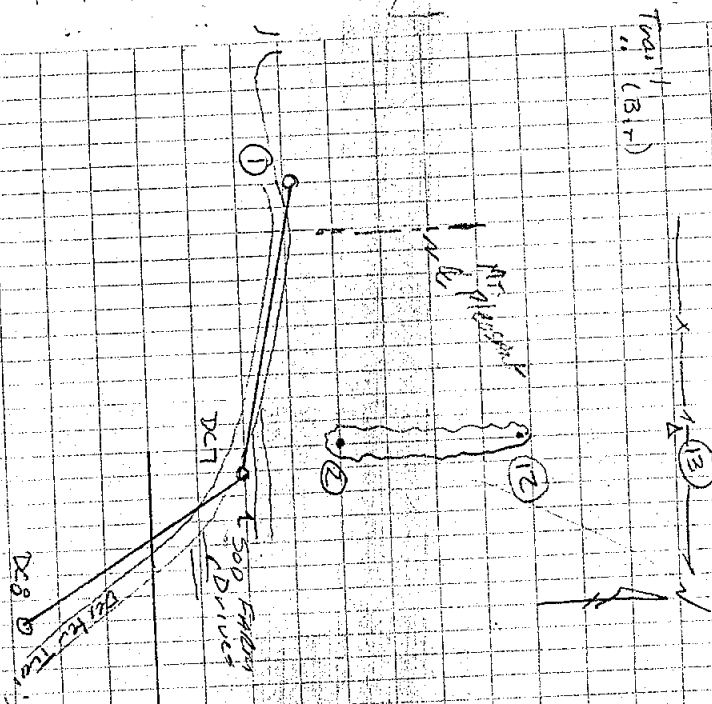

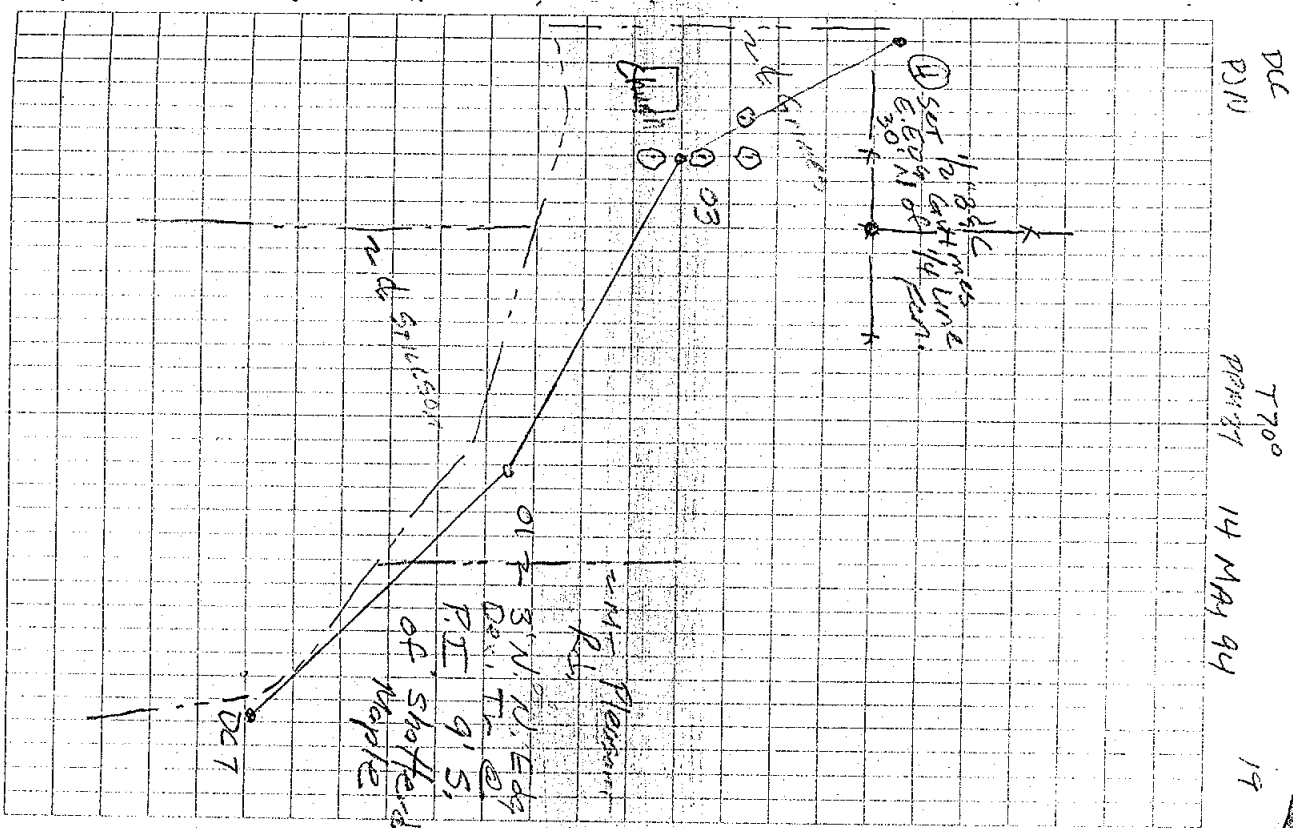
[illegible]

ST 1

DLC
PIN

TPD
14 May 1994 20

ST-19-03		
ST-18-01		
ST-20-04		
BS D	0° 00' 00"	
FS D	225° 21' 16"	225° 21' 10.0" ✓
BS R	180° 00' 00"	21' 08.1" ✓
FS R	45° 21' 06"	225 21' 08.1" ✓
BS D	90° 00' 26"	
FS D	315° 21' 06"	225 21' 24" ✓
BS R	270° 00' 20"	21' 22.15" ✓
FS R	135° 21' 41"	225 21' 21" ✓
MEAN	225-21-15 ✓	

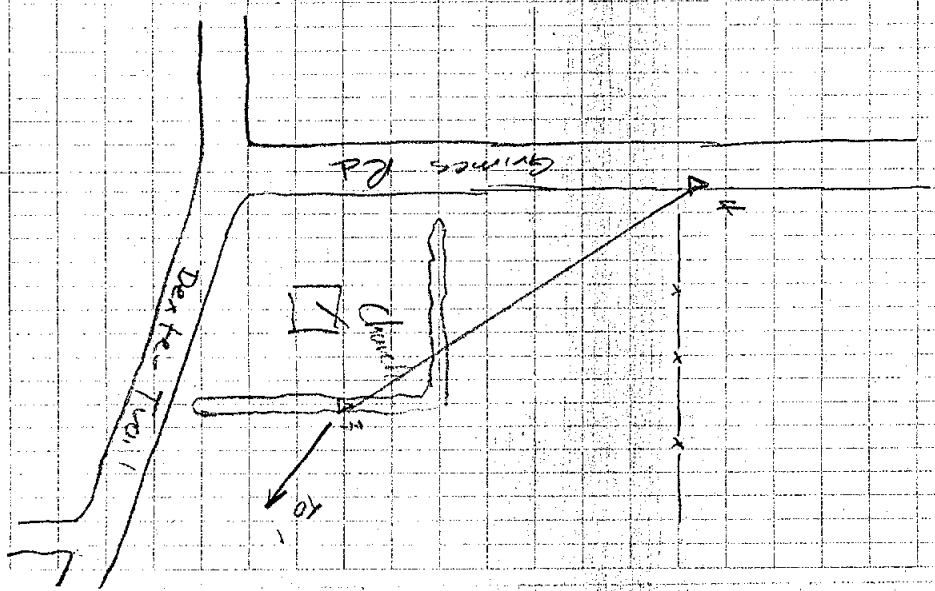

ST1

AE ST-20-04

BS ST-19-03

FS ST-21-05

FS ST-21-06

(5' x 1/2" B&C 4" E. of Grimes Rd.
P.I. Grimes Rd.
C-2 W/4 Cor. S&S 5 T1M R2E)
1/2" Pipe & Cap 11570 See 19 12

BS D 00-00-14

FS D 196-17-01 196-16-44

FS D 299-15-17 299-15-03

BS R 180-00-15

BS R 16-17-17 196-17-02 196-16-54

BS R 119-15-25 299-15-10 299-15-06

BS R 60-00-14

BS R 256-17-11 196-16-57

BS R 240-00-01 196-16-58

BS R 76-17-00 196-16-59

MEANES, 196-16-56 299-15-03

DIST 3 BS 700.54 .35 213.525 .527

Z 270-32-40 84-27-20

SD HD 700.51

DIST 3 FS 337.87/.86 102.03/.081

Z 269-59-25 90-00-35


SD HD 337.86

DIST 3 FS 1027.81/.82 557.122/120

Z 269-41-48 90-13-12

SD HD 1027.78

DLC
TKO
APR 17
AC 22-MAY-1994
21

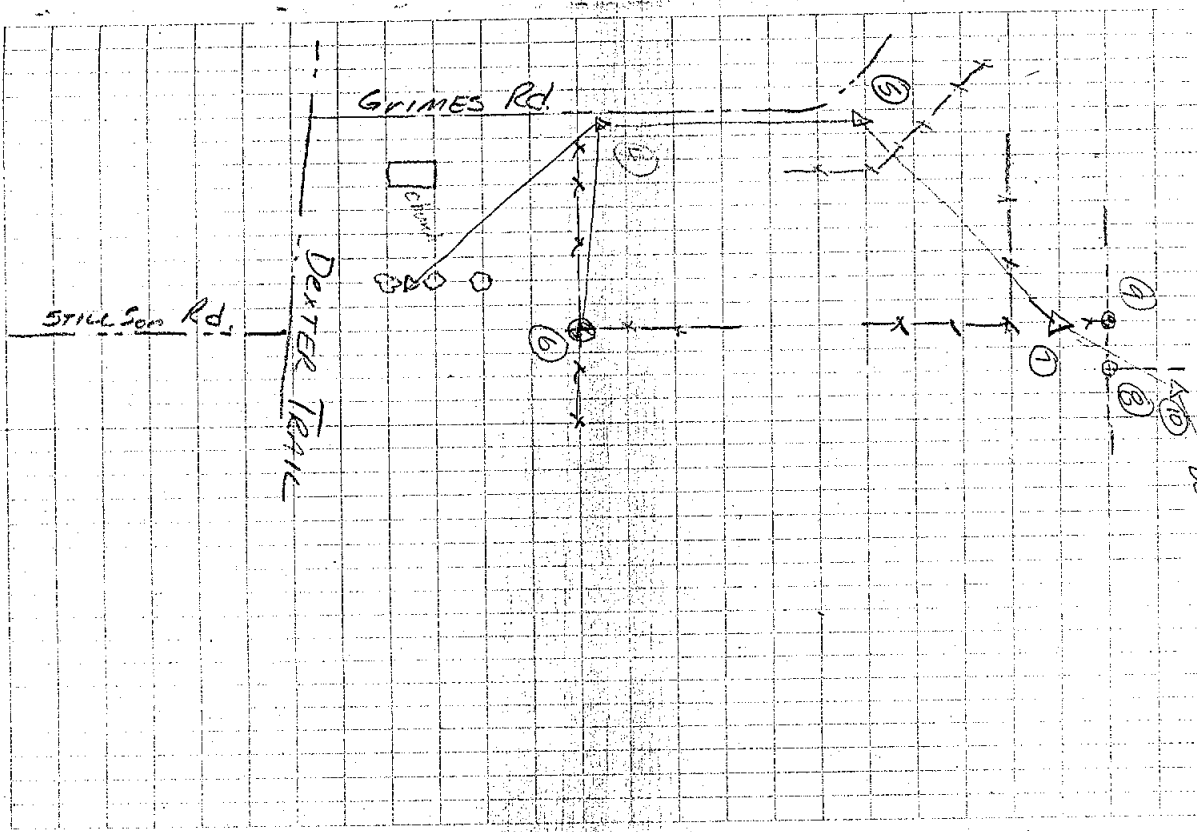

PLC
RUN

T 75°
PCM 27

22 MAY 1991

22

ST 1

ST - 21-05

ST - 20-04

ST - 22-07 (TIP Set 1/2" B/C)

BS D 00-00-27

FS D 231-36-24

FS R 180-00-14

FS R 51-36-11

FS D 60-00-08

FS D 291-36-13

FS D 240-00-00

FS D 11-36-02

MEAN 231-36-00 ✓

57W


231-36-57W

231-36-02 ✓

02'

231-36-02 ✓

35-595'

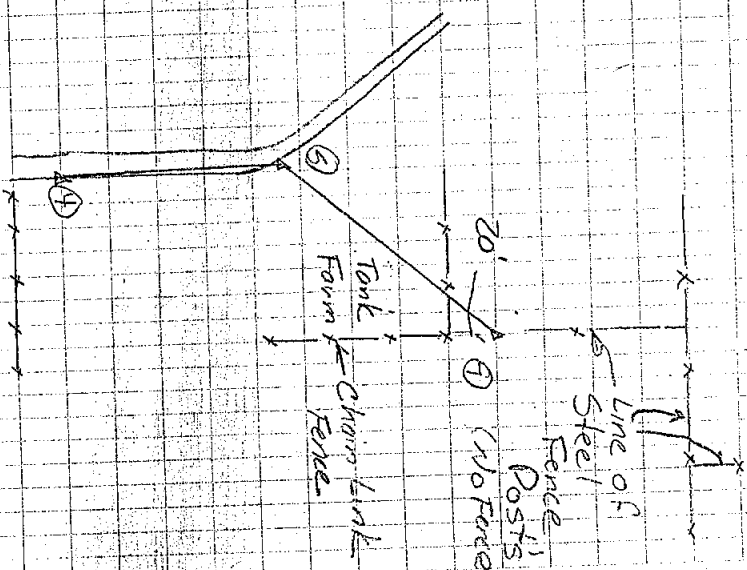

DLC
PUN


7 75°
FM 27

22 MAY 1992

23

ST-1			
ST-22-07			
BS	ST-21-05		
FS ₁	ST-23-08 (C-13 TNRZE	See pg 15	
FS ₂	ST-23-09 CC-1 TNRZE	See pg 15	
FS ₃	ST-23-10 (TR Set 1X2 Hub in Corn	field	
BS D	00-50-23		
FS ₁ D	189-44-05	189-43-42	
FS ₂ D	135-38-07	135-37-44	
FS ₃ D	183-12-20	183-11-57 ✓	
BS ₁	180-00-05		
FS ₁ R	09-44-08	189-44-03	
FS ₂	315-37-50	135-37-45	
FS ₃ R	03-11-55	183-11-50 ✓	53.5 ✓
BS D	60-00-21		
FS ₁	243-12-18	183-11-57 ✓	
BS ₁	246-00-09		53.5 ✓
FS ₃ R	63-12-03	183-11-54 ✓	
MEAN FS ₃	183-11-54 ✓		
Dist → BS	858.71 / 71	241.736 / 736	
Z	269° 51' 16"	HD = 858.70	
Dist → FS ₁	263.49 / 1.48	80.25 / 1.250	
Z	90°	HD → 263.31	
Dist → FS ₂	160.44 / 1.30	48.80 / 1.850	
Z	90°	HD → 160.28	
Dist → FS ₃	315.44 / 1.45	902.08 / 1.081	
Z	270-12-28	HD = 315.6. ✓	

FS₁ Mean 189-43-52.5
FS₂ Mean 135-37-44.5

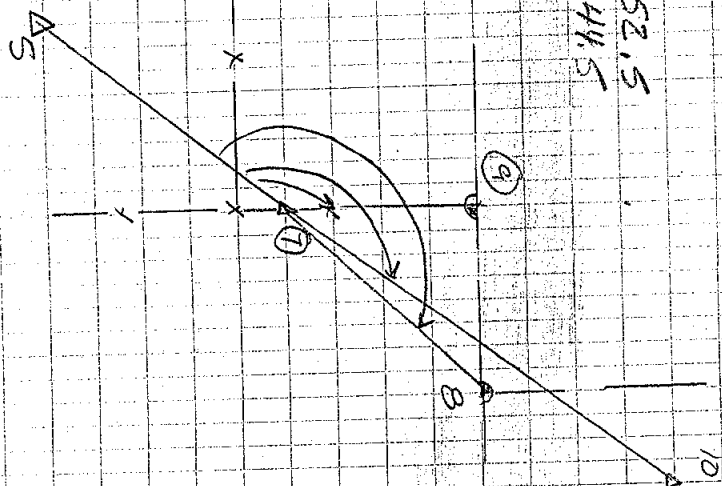

ST-23-10

ST-22-07

521-60-02 (TRAP - Super Cattle)

ST1

BS 0

00-00-28

178-05-35 ✓

FS 0

178-06-03

178-05-34 ✓

BS R

180-00-35

178-05-33 ✓

FS R

358-05-08

178-16-32

BS 0

60-00-20

178-05-24 ✓

FS 0

238-05-44

178-05-24 ✓

FS R

240-00-06

178-05-24 ✓

FS R

58-06-20

178-05-24 ✓

MEAN

178-05-29 ✓

801.57/.57

244.319/326

267-56-55

92-03-05

HD = 801.05

DLC

01N

T800

TRAP 27 2.1 May 94 24

Recovered 600 spp. 3' N.
of N. Edg. BIT 11' E
of Cen Sec. 32-T2N, R2E

SWAN RD.

02

10

07

25

TC

01

STI

BS

DC1

FS

ST-25-11 (Set 1x2 Hub & Stillson
on Sec Line Fence
T.R. Set 1/2" B&C N End
ST-25-12 (Occupation line)

BS

00-00-25

D

91-09-18

71-08-53 ✓

ZD

328-19-58

328-19-33 ✓

BS

180-00-36

R

271-09-28

71-08-52 ✓

ZR

148-20-08

328-19-24 ✓

BS

60-00-10

D

151-08-54

91-08-44 ✓

Z

28-19-27

328-19-29 ✓

BS

240-00-12

R

331-09-12

91-09-00 ✓

Z

208-19-43

328-19-31 ✓

Mean BS

91-08-52 ✓

FS

328-19-38 ✓

D.T. BS

FT 1945.95 / 95

593.127 / 128

Z

269° 56' 35"

90-08-25 HD = 1945.94 ✓

D.T. FS


Z

DLC
PLN

T80
RPH27

21 May 94

25

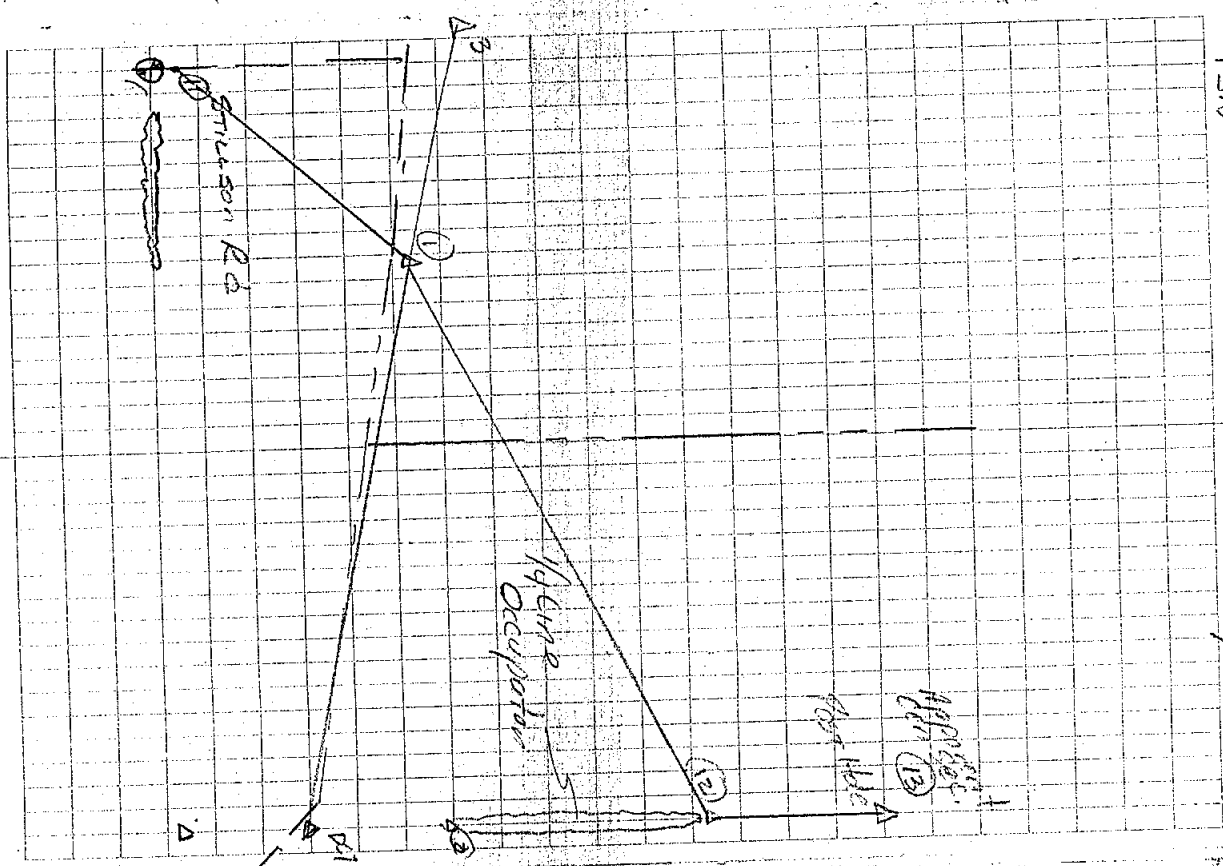

26

ST 1

X_e ST-25-12B₃ ST-18-01F₅, ST-24-13 (FD 5_g Wood Post in Depression
Sec pg. 11 D-2B₃ D 359-59-52F₅ D 90-05-20 90-05-28B₃ R 180-00-01 26F₃ R 270-05-25 90-05-24B₃ D 60-00-55

D 150-06-22 90 05 28

B₃ R 240-01-20 24

R 330-06-24 90 05 24

Mean 90-05-26

Dist To B₃ FS

Z. 270-06-00 89-54-00 269-54.30 90-05-30

F₁ 1600.13/.13 1017.87/.85

M 487.72/.723 310.247/.247


SD 1600.12 1017.86

AD 1600.12 1017.86

DC
RIN

21 May 1994

(26)

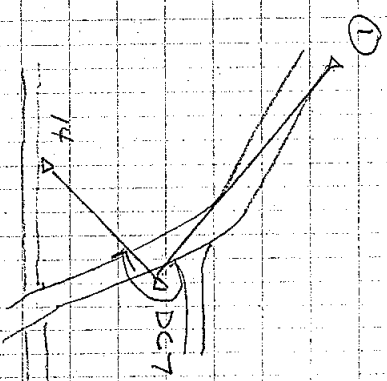

T DC7

B₃ 01F₅ 14 (Sec 14 on which DC7 is
EXTEND OR LINE TO DC7)B₃ D 180-00-10 236-13-33

D 56-13-43 236-13-33

B₃ R 000-00-01 36

R 236-13-40 236-13-33

B₃ D 60-00-15

D 296-13-50 236-13-35

B₃ R 240-00-17 36.5

D 116-13-54 236-13-38

Mean 236-13-36

Dist To B₃ FS

Z 269-48-00 90-12-00

F₁ 663.98/.98

M 202.381/.382

SD 663.98
AD 663.97

27

check Balance

ST 571-23.10
571-22-01
571-60-02

Dist TO BS

90-11-30
209-48-33

90-11-30

3156.48/48

902.095/096

3156.46

3156.44

571-21-05

571-22-07

571-20-04

Dist TO BS

270-07-20

89-52-40

858.79/179

261.764/761

058.79

058.79

058.79

ST 1

DLC
DID

760
APR 22 30 MON 91

(27)

Ne 571-19-03

55 571-20-04

571-18-01

Dist TO BS

90-36-00
209-24-20

90-36-30

700.58/58

213.538/537

700.58

700.54

DC-7

571-18-01

571-27-15

50-00-15

236-25-48

180-00-21

56-25-55

56-25-11

Mem 236-25-345

Mem

Mem

Mem

Mem

Mem

Mem

90-49-30

1184.01/072

361.88/195

11-85.01

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

90-49-30

1184.01/072

361.88/195

11-85.01

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

1184.89

(28)

The Couriers

T 571-25-11 (Hwy) Wood Street

E 571-18-01 (Recon. Bt. 50k. Bt. in

F 571-28-16 (3-3 STONY ROAD Bt. in

B 571-00-41

D 157-58-40 157-58-00

B 571-18-00-52

R 337-67-37 157-58-00

Mc...

Dist To B.S.

E 571-25-11

M 571-02-10

F 1945.811.81

M 573.083/.083


D 1945.80

ST

DLC
PLN

T 70
PM 27 30 May 94 28

See pg. 13

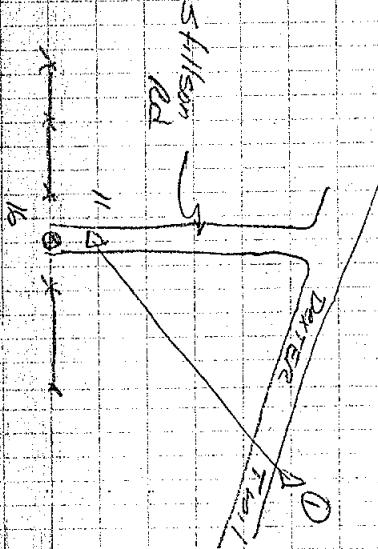

(29)

Tic Occupation S. Line Sec 5

ST1

DLC
DN

TPD
PPH 27 18 Jun 94

(29)

T ST1 - 18-001

B5 ST1-64-DC7

FS ST1-29-17 (LINE Sec 5 Set 603 in Area 10)

B5 240-00-25

288-55-28 48-55-03

60-00-32

108-55-28 48-54-56

B5 000-00-33

48-55-15 48-54-43

B5 180-00-32

228-55-31 48-54-59

Mean 48-54-55

Dist To FS

ZD 89-55-00

270-05

89-55

FT 1671.61 / 1671.61

M 509.508 / 509.508

SD 1671.60

HD 1671.60

T ST1-64-DC7

B5 ST1-18-001

FS ST1-29-18 (2 Drain Fd. PK. & Dexter Trail)

B5 D 000-00-50

210-40-54 210-40-04

180-01-00

30-41-05

210-40-05

Mean 210-40-045

Dist To FS

ZD 90-34-10

R 267-26-20

M 90-34-00

FT 721.35 / 721.36

M 219.870 / 219.870

SD 721.35

HD 721.31

30

STI DC
JP

13/Aug 94

T

18

B5

7

(107)

F5

19

X

180°

10'

T

19

B5

7

(107)

F5

20

Bend in Creek

X

270

40'

T

521-64-DC7

(107)

F5

521-18-01

F5

521-30-21 Bend in Creek

B5 D

000-00-16

283-07-06 283-06-50

180-00-10

103-07-10 283-07-00

Dist 10 92°

F5

Mem 283-06-55

FT

898.63 / 898.63

M

273.905 / 273.905

31

ST-1

1994- Contract + Monumentation Surveyor
Notes & Abbreviations

CLS = Clifford Land Surveys

16156 Turner Rd.

LANs. M: 48906

(LSIT) 4847266

Instruments for all field work

Wild T-2 Theodolite

Wild DI-1000 EDM SN 6007

owned by Enger Surveying &
Engineering

Abbreviations

DLG - Dave Clifford PS 25837

J.P. Jason Portier Survey Tech

RON Phil Norder LSIT

Set Standard B&C - Set $\frac{3}{4}$ " x 24"

Smooth Steel Bar and Yellow

Plastic Cap imprinted P4345

PS 25837

Set N&T - Set 16d spike and yellow

plastic witness tag PS 25837